

# **National Property Inspections**

Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240









Thursday, May 16, 2024
Inspector
Jay Heckart
(563) 676-7400
jay.heckart@npiinspect.com

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

## Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

**INVOICE #: 1560** 

Coralville IA 52241

Client Name: Dave Curtis

Johnson County - NPI Commercial

Inspection Date: 5/16/2024 8:00 AM

Property Location: 1102 HOLLYWOOD BLVD IOWA CITY IA 52240

TwentyOne Enterprises, Inc. DBA National Property Inspections

Billing Address: 913 S Dubuqu

913 S Dubuque Street Iowa City IA 52240

Client Phone:

(319) 688-5851

Client Email:

dcurtis@johnsoncountyiowa.gov

#### TYPE OF INSPECTIONS PERFORMED

 Commercial Building Inspection
 \$2,800.00

 Total
 \$2,800.00

 Due on Receipt
 \$2,800.00

Occupied Units: 3, 4, 6, 8, 9

15 Total Units

Checks can be mailed to the following address. Remit To: National Property Inspections 2275 Flintshire Vw. Coralville, IA 52241

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### **GENERAL INFORMATION**

#### GENERAL CONDITIONS AT TIME OF INSPECTION:

Property Occupied:  Estimated Age Of Property:  Property Faces:   North	Yes  55 Year(s)  ✓ South ☐ East ✓ West	Temperature: 60 Weather: ☑ Overcast	
Type of Property:  ☑ Commercial  ☐ Primary Construction:	☑ Multi-Tenant	Soil Conditions:  Damp/Wet Persons Present:	
☑ Wood	✓ Concrete	☑ Buyer ☑ Client	<ul><li>☑ Seller's Agent</li><li>☑ Tenant(s)</li></ul>

#### **DEFINITIONS:**

Below are listed the definitions used throughout the report to describe each feature of the property.

G (GOOD) Average to above-average condition for the building system evaluated, taking into consideration factors of age and design. Generally, other than normal maintenance, no repair is recommended or required. F (FAIR) Average condition for the building system evaluated, taking into consideration factors of age and design. Some short term or immediate maintenance or repairs are recommended to return the system to a good condition. P (POOR) Below-average condition for the building system evaluated, taking into consideration factors of age and design. Immediate repair, significant work or replacement is anticipated to return the building system to a good or fair condition. NI (NOT INSPECTED) The item/system was not inspected due to safety concerns, inaccessibility and/or concealment or seasonal conditions and no representations of whether or not it was functioning as intended were made. NA (NOT APPLICABLE) This item is not applicable or not present

#### **SCOPE OF THE INSPECTION:**

This assessment is in general accordance with the ASTM standard E2018-08 for Property Condition Assessments. The intent of this report is to identify and communicate conspicuous defects or material deferred maintenance of a subject property's material systems, components, or equipment as observed on the date of the Field Observer's Walk-Through Survey. This was a visual review of readily accessible areas and components. It was not technically exhaustive and no excavation, disassembly or removal of covers, panels or obstructions was performed. Hidden or obstructed defects may not be observed. In addition, some components were assessed on a random sampling of like items.

It is always recommended that all repairs and replacements are completed by a licensed contractor. The evaluation of the buildings and individual units was completed on Thursday, May 16th, 2024. Due to the buildings and units currently being in operation, there is no guarantee that the status of the items listed in this report, such as communal areas, mechanical components, exterior, etc. will remain the same up until the closing date. A final walk through of all areas prior to closing on the building is always recommended.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

# **Summary**

This summary is not the entire report. The complete report may include additional information of concern to the client. It is recommended that the client read the complete report.

#### 1 EAST BUILDING GRADING / DRAINAGE

**POOR** 

- The grading around the building was near level. This condition may allow water to accumulate around the house during rains/snow melt and has the potential to allow water to enter the dwelling. Monitor condition during rains as improvements in grading/drainage may be needed.
- Hardscape / concrete walkway on the south side of the building has started to settle away from the building creating a gap between the building and hardscape. This may allow for water intrusion that may expedite the settling of the concrete slabs. Monitor condition as improvements in drainage may be necessary if the slabs settle towards the building.
- Brush and debris build up along grade and foundation. Advise that exterior grade of the building is cleared to prevent moisture build up.

#### 2 NORTH BUILDING GRADING / DRAINAGE

POOR

- The grading around the building was near level. This condition may allow water to accumulate around the house during rains/snow melt and has the potential to allow water to enter the dwelling. Monitor condition during rains as improvements in grading/drainage may be needed.
- Brush should be cleared away from grade to prevent moisture accumulation around foundation.

#### 3 WEST BUILDING GRADING / DRAINAGE

**FAIR** 

- The grading around the dwelling was near level. Ideally, the grading should slope away from the building to allow water to run away from the foundation.
- Sections of the siding were in contact with the grade, garden bed, etc.. Proper clearance should be provided.

4 PARKING LOT FAIR

• The parking lot has common cracks and settling typical to the age and exposure. Monitor condition of parking lot as repairs or replacement may be necessary in the near future.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### 5 COMPLEX FLATWORK / SIDEWALKS

**POOR** 

- Due to settling of concrete walkways the sewer clean out in front of Unit #s 10 & 11 has become a tripping hazard. Advise that walkways are raised to level with clean out for safety.
- There were minor cracks and settling present in the concrete walkway. This is common and is caused by normal ground settlement and age. Recommend filling crack(s) with an approved concrete filler or sealant to prevent further damage due to water intrusion. Monitor walkways over time.
- Rear patios and porch steps showing signs of general deterioration and cracking.

#### **6 EAST BUILDING ROOFING**

**POOR** 

- Keep trees and branches trimmed to prevent damage to roof covering.
- Cable penetrating and laying on roof surface. This may cause damage to shingles in high winds. Recommend rerouting wire to protect roof shingles.
- Unit #15 furnace exhaust flue has a missing and damaged rain cap. This is creating a direct access for water to reach the inside of the unit and furnace system. Recommend that rain cap is replaced as soon as possible.

#### 7 NORTH BUILDING ROOFING

**POOR** 

- Exposed nail heads noted at various locations. Recommend sealing all nail heads to prevent water intrusion and monitoring the conditions of repaired areas.
- Roofing nails present on the roof at the time of the inspection. Recommend that the roof is walked and all nails are removed to prevent tire punctures, personal injury, etc.
- Cable penetrating and laying on roof surface. This may cause damage to shingles in high winds. Recommend rerouting wire to protect roof shingles.
- Previous repairs visible on roof surface. Monitor area over time and recommend reaching out to seller for details on reason for repair.

#### **8 WEST BUILDING ROOFING**

FAIR

Keep trees and branches trimmed to prevent damage to roof covering.

#### 9 EAST BUILDING FLASHING / VALLEYS

**FAIR** 

- Noted rusty flashing. Paint and/or seal as necessary.
- Some damage to flashing caulking due to exposure and age. Recommend that caulking is updated to prevent moisture penetration.

Inspection Date: Inspector: Jay Heckart

05/16/2024 Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### 10 NORTH BUILDING FLASHING/VALLEYS

POOR

- Some damage to flashing caulking due to exposure and age. Recommend that caulking is updated to prevent moisture penetration.
- Noted rusty flashing. Paint and/or seal as necessary.

#### 11 WEST BUILDING FLASHING/VALLEYS

**POOR** 

- Rusted and lifting flashing visible on the roof deck. This may be an avenue for water to get under the shingles causing water related damage.
- Some damage to flashing caulking due to exposure and age. Recommend that caulking is updated to prevent moisture penetration.

### 12 EAST BUILDING ROOF DRAINAGE SYSTEM

**FAIR** 

Mulch displacement in the south west corner of the building is typical to overflowing gutter systems.
 Monitor condition as gutter cleaning may be needed in this area.

#### 13 NORTH BUILDING ROOF DRAINAGE SYSTEM

**FAIR** 

 Corrugated pipe extensions were damaged. Advise that damaged piping is replaced to allow for proper drainage.

#### 14 EAST BUILDING EXTERIOR SURFACE

Exterior Wall Finish

POOR

Exterior Lighting

POOR

- There were penetrations in the siding that will eventually allow moisture intrusion. Any visible penetration, including electrical conduit from the meter, HVAC lines/vents, light/receptacle fixtures, etc. should be sealed or caulked where it penetrates the home to prevent possible water intrusion to the home.
- Multiple exterior lighting was not responding to switch. Recommend that bulbs are checked and replaced. Lights may be on timer linked to main security lights. Check with seller.

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

## Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### 15 NORTH BUILDING EXTERIOR SURFACE

Siding/Trim POOR Exterior Faucets POOR

Exterior Lighting POOR

- Northwest rear faucet pipe has burst. Recommend that faucet and damaged pipe are repaired prior to turning on water to this faucet.
- Some bulging in rear siding. Cause of bulging is unknown. Further review advised.
- There were penetrations in the siding that will eventually allow moisture intrusion. Any visible penetration, including electrical conduit from the meter, HVAC lines/vents, light/receptacle fixtures, etc. should be sealed or caulked where it penetrates the home to prevent possible water intrusion to the home.
- Wood trim missing above unit #9.
- Multiple exterior lighting was not responding to switch. Recommend that bulbs are checked and replaced. Lights may be on timer linked to main security lights. Check with seller.

#### 16 WEST BUILDING EXTERIOR SURFACE

Siding/Trim POOR
Exterior Faucets FAIR
Exterior Lighting POOR

- There were penetrations in the siding that will eventually allow moisture intrusion. Any visible penetration, including electrical conduit from the meter, HVAC lines/vents, light/receptacle fixtures, etc. should be sealed or caulked where it penetrates the home to prevent possible water intrusion to the home.
- Missing siding below unit 1 upper window has exposed the sheathing and flashing under the window. Recommend that siding is installed to prevent moisture entry.
- Bulging and loose siding typical to improperly cut vinyl siding visible. Proper installation advised to prevent permanent warping or bowing of vinyl planks.
- Unit #1 ventilation has an active bird nest present. Advise that nest is removed for proper ventilation.
- Multiple exterior lighting was not responding to switch. Recommend that bulbs are checked and replaced. Lights may be on timer linked to main security lights. Check with seller.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### 17 EAST BUILDING FENESTRATION SYSTEMS

**FAIR** 

- Keep window wells free of debris to help prevent water intrusion. Recommend installing covers/rain diverters on window wells to keep them free of debris and to divert water.
- Dryer vent was discharging into a window well. This could lead to excessive moisture and related deterioration to surrounding building materials. Recommend rerouting dryer vent to a more appropriate location.

### 18 NORTH BUILDING FENESTRATION SYSTEMS

**FAIR** 

- Basement windows near grade level. Ensure proper clearance between basement window and grading to help reduce risk of water intrusion.
- Not all window wells were covered. Recommend window wells covers for the prevention water, debris, and rodent/animal entry.
- Dryer vents were discharging into various window wells. This could lead to excessive moisture and related deterioration to surrounding building materials. Recommend rerouting dryer vent to a more appropriate location.

#### 19 WEST BUILDING FENESTRATION SYSTEMS

FAIR

- Basement windows near grade level. Ensure proper clearance between basement window and grading to help reduce risk of water intrusion.
- Recommend window wells covers for the prevention water, debris, and rodent/animal entry.
- Basement window near grade level. Ensure proper clearance between basement window and grading to help reduce risk of water intrusion. Recommend that window well covers are installed.

### 20 EAST BUILDING UNIT PATIO DOORS

FAIR

• Due to proximity of grade level windows to patio doors it is important to install strong window well covers to protect from falls and tripping.

#### 21 EAST BUILDING EXTERIOR FOUNDATION

**FAIR** 

- Cracks in grout lines of block foundation. Further evaluation advised and sealing of grout cracks to prevent moisture entry.
- Foundation penetrations should be sealed / caulked to prevent pest and moisture entry.

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### 22 NORTH BUILDING EXTERIOR FOUNDATION

**FAIR** 

• Foundation penetrations were uncaulked where AC suction lines enter the building.

#### 23 WEST BUILDING EXTERIOR FOUNDATION

FAIR

- One or more vertical cracks due to settling noted. Monitor regularly and evaluate/repair as required.
- Grout line cracks visible in the foundation. Seal as needed and monitor for further cracking and movement.

## 24 NORTH BUILDING ATTIC / ROOF FRAMING AND

POOR

- Open knock out in junction box located in the attic of unit # 8. Junction box should be sealed for electrical safety.
- Firewall / barrier betweens units # 10 & 11 was damaged and missing. Recommend that a proper firewall is installed for safety and to prevent direct access to individual units via the attic system.

## 25 WEST BUILDING ATTIC / ROOF FRAMING AND

**FAIR** 

• Attic framework showing signs of past moisture entry. All was dry at time of inspection, monitor condition as repairs may be necessary if additional staining or moisture entry is present.

#### 26 EAST BUILDING ATTIC VENTILATION

**POOR** 

- Bathroom vents were directed into the attic causing moisture to form on the roof sheathing. This will deteriorate the shingles from the inside out and cause early roof failure to sheathing. Recommend that bathroom vents are properly vented to the exterior of the building.
- Typical to the age of construction, soffit vents lacked baffles to help direct airflow in the attic. Over time insulation has settled and shifted causing some soffits to become blocked. This may cause ventilation issues on extreme hot and cold temperature days and effect efficiency. Monitor condition as improvements may be needed in the future.

### 27 NORTH BUILDING ATTIC VENTILATION

**POOR** 

- Bathroom vents were directed into the attic causing moisture to form on the roof sheathing. This will deteriorate the shingles from the inside out and cause early roof failure to sheathing. Recommend that bathroom vents are properly vented to the exterior of the building.
- Typical to the age of construction, soffit vents lacked baffles to help direct airflow in the attic. Over time insulation has settled and shifted causing some soffits to become blocked. This may cause ventilation issues on extreme hot and cold temperature days and effect efficiency. Monitor condition as improvements may be needed in the future.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

### 28 WEST BUILDING ATTIC VENTILATION

**POOR** 

- Bathroom vents were directed into the attic causing moisture to form on the roof sheathing. This will deteriorate the shingles from the inside out and cause early roof failure to sheathing. Recommend that bathroom vents are properly vented to the exterior of the building.
- Typical to the age of construction, soffit vents lacked baffles to help direct airflow in the attic. Over time insulation has settled and shifted causing some soffits to become blocked. This may cause ventilation issues on extreme hot and cold temperature days and effect efficiency. Monitor condition as improvements may be needed in the future.

#### 29 EAST BUILDING ATTIC INSULATION

**FAIR** 

- Blanket insulation in attic system was observed. In the interrupted areas the insulation has been compressed due to age, reducing its thermal efficiency. Consider adding more insulation in the interrupted areas for improved thermal efficiency.
- Moisture staining visible on attic insulation near bathroom vent termination point. Over time, insulation can develop mildew and mold growth. Moisture stained insulation should be replaced.

### 30 NORTH BUILDING ATTIC INSULATION

**FAIR** 

- Blanket insulation in attic system was observed. In the interrupted areas the insulation has been compressed due to age, reducing its thermal efficiency. Consider adding more insulation in the interrupted areas for improved thermal efficiency.
- Moisture staining visible on attic insulation near bathroom vent termination point. Over time, insulation can develop mildew and mold growth. Moisture stained insulation should be replaced.

#### 31 WEST BUILDING ATTIC INSULATION

**FAIR** 

- Blanket insulation in attic system was observed. In the interrupted areas the insulation has been compressed due to age, reducing its thermal efficiency. Consider adding more insulation in the interrupted areas for improved thermal efficiency.
- Moisture staining visible on attic insulation near bathroom vent termination point. Over time, insulation can develop mildew and mold growth. Moisture stained insulation should be replaced.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### 32 UNIT # 1 INTERIOR FOUNDATION

**POOR** 

- Efflorescence along foundation wall. Efflorescence is a powdery deposit of salts which forms on the surface of bricks and mortar. It is usually caused by water intrusion.
- Bubbling and cracking paint typical of moisture build up.
- Grout and step cracking visible on the south wall of foundation.

#### 33 UNIT # 2 INTERIOR FOUNDATION

**FAIR** 

• Cracks were observed in the foundation walls. These cracked areas did not have any evidence of water intrusion at time of this inspection. Water intrusion may develop after period of heavy rainfall or further deterioration.

#### 34 UNIT # 3 INTERIOR FOUNDATION

**POOR** 

- Foundation grout line cracks visible in foundation walls. Recommend that cracks are sealed and areas are monitored for further cracking and moisture.
- Foundation walls were painted and sealed in the back corner. This is usually a sign of previous water entry or cracking. Monitor area and talk with seller about repairs.
- Efflorescence on the concrete block walls. Efflorescence is a powdery deposit of salts which forms on the surface of bricks and mortar. It is usually caused by water intrusion. Monitor the basement for water intrusion.

#### 35 UNIT # 4 INTERIOR FOUNDATION

**FAIR** 

• Some grout cracking in foundation walls. No signs of water entry or moisture at time of inspection.

#### 36 UNIT # 5 INTERIOR FOUNDATION

**FAIR** 

 Settlement type grout cracks observed. Appeared typical at this time. Monitor regularly and evaluate/repair as required. No moisture or water entry at time of inspection.

#### 37 UNIT # 7 INTERIOR FOUNDATION

**FAIR** 

• Foundation blocks have cracks along the grout lines. Monitor condition and seal as needed to prevent moisture entry.

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### 38 UNIT # 8 INTERIOR FOUNDATION

**FAIR** 

Previous repairs noted. Monitor regularly and evaluate/repair as required. Dry at time of inspection.

#### 39 UNIT # 9 INTERIOR FOUNDATION

**FAIR** 

• Rusted outlet present at time of inspection. Advise that outlet is repaired or replaced for electrical safety.

#### **40 UNIT # 11 INTERIOR FOUNDATION**

**FAIR** 

Previous repairs noted. Monitor regularly and evaluate/repair as required. Dry at time of inspection.

#### 41 UNIT # 12 INTERIOR FOUNDATION

**POOR** 

- Past repairs and sealing of concrete foundation blocks. Monitor areas over time as additional repairs may be necessary.
- Efflorescence on the concrete block walls. Efflorescence is a powdery deposit of salts which forms on the surface of bricks and mortar. It is usually caused by water intrusion.

### **42 UNIT # 13 INTERIOR FOUNDATION**

**FAIR** 

 Foundation blocks were sealed and repaired. Monitor condition over time as additional repairs may be required.

### **43 UNIT # 14 INTERIOR FOUNDATION**

**POOR** 

- Efflorescence along foundation wall. Efflorescence is a powdery deposit of salts which forms on the surface of blocks and mortar. It is usually caused by water intrusion.
- Previous repairs visible on the foundation walls.

#### 44 UNIT # 15 INTERIOR FOUNDATION

**POOR** 

- Efflorescence on the concrete block walls. Efflorescence is a powdery deposit of salts which forms on the surface of bricks and mortar. It is usually caused by water intrusion.
- Past repairs visible. Monitor condition as future repairs may be required.

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### 45 UNIT # 1 FLOOR / SLAB

POOR

• Stains and visible water on the interior surfaces of the concrete floor slab appear to be the result of active moisture intrusion. The moisture meter showed elevated levels of moisture present in the slab at the time of the inspection. Moisture intrusion could damage materials and encourage the growth of microbes such as mold. The source of moisture should be located and corrected to avoid future moisture intrusion.

#### 46 UNIT # 9 FLOOR / SLAB

**POOR** 

 Basement had signs of active moisture at time of inspection. Source of water was unknown and should be monitored. Further evaluation advised.

#### 47 UNIT # 14 FLOOR / SLAB

**POOR** 

Active moisture / water visible on the concrete of the basement. No visible source of water.
 Recommend further evaluation.

#### **48 SUMP/SUMP PUMPS SYSTEMS**

**POOR** 

- Unit #10 Sump pump discharge pipe was hanging and causing a low point that could trap water or cause clogging. Recommend that discharge pipe is properly installed.
- Unit #11 Sump pump was draining directly into sewer system via the laundry drain. This is no longer allowed by most municipalities.

#### **49 UNIT #1 ELECTRICAL**

Panel POOR

- Screws used to secure the electrical panel cover were missing. Recommend installing the proper screws (non-pointed) to ensure proper electrical safety.
- Breaker #s 2 & 9 were double tapped. Double tapping is when 2 or more conductors (wires) are
  wired into a lug intended for 1 conductor. This can lead to arcing in turn damage or fire occurring in
  panel. Recommend repairs or installation of appropriate breakers to alleviate double tapping. (City
  inspector will typically allow the box outlet or low voltage transformer to be double tapped).

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### 50 UNIT #3 ELECTRICAL

Panel POOR

• Breaker #s 2 & 4 were double tapped. Double tapping is when 2 or more conductors(wires) are wired into a lug intended for 1 conductor. This can lead to arcing in turn damage or fire occurring in panel. Recommend repairs or installation of appropriate breakers to alleviate double tapping. (City inspector will typically allow the box outlet or low voltage transformer to be double tapped)

#### 51 UNIT #4 ELECTRICAL

Panel FAIR

- Screws used to secure the electrical panel cover were missing. Recommend installing the proper screws (non-pointed) to ensure proper electrical safety.
- Breaker #2 was double tapped. (City inspector will typically allow the box outlet or low voltage transformer to be double tapped)

#### **52 UNIT #5 ELECTRICAL**

Panel POOR

- Breaker #8 was double tapped. This can lead to arcing in turn damage or fire occurring in panel. Recommend repairs or installation of appropriate breakers to alleviate double tapping. (City inspector will typically allow the box outlet or low voltage transformer to be double tapped)
- Panel screws missing front cover.

#### 53 UNIT #6 ELECTRICAL

Panel FAIR

Screws used to secure the electrical panel cover were missing.

#### **54 UNIT #7 ELECTRICAL**

Panel POOR

Breakers #6&9 were double tapped. Further review and repair by qualified electrician advised.

#### 55 UNIT #8 ELECTRICAL

Panel POOR

Branch Circuits FAIR

- Screws used to secure the electrical panel cover were missing.
- Corrosion noted on breakers. This may cause the breakers to not perform properly and could be a electrical safety problem. Further review by qualified electrician advised.
- There were wire splices in the panel. Advise that wire nuts are used for proper protection.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

## Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### **56 UNIT #9 ELECTRICAL**

Panel POOR

BREAKER # 8 was double tapped at time of inspection. Further review by electrician advised.

#### **57 UNIT #10 ELECTRICAL**

Panel POOR

- Corrosion noted on breakers. This may cause the breakers to not perform properly and could be a electrical safety problem. Further review by qualified electrician advised.
- Double tapped breaker present in the panel.

#### **58 UNIT #11 ELECTRICAL**

Panel FAIR

• Breaker double tapped. (City inspector will typically allow the box outlet or low voltage transformer to be double tapped)

#### **59 UNIT #12 ELECTRICAL**

Panel

Branch Circuits

POOR

**FAIR** 

- Screws used to secure the electrical panel cover were missing. Recommend installing the proper screws (non-pointed) to ensure proper electrical safety.
- Burn / scorch marks visible on outlet next to panel. Further review and replacement of outlet by a
  qualified electrician advised.
- Splicing of wires within the panel.

#### **60 UNIT #13 ELECTRICAL**

Panel FAIR

- Screws used to secure the electrical panel cover were missing. Recommend installing the proper screws (non-pointed) to ensure proper electrical safety.
- Breaker double tapped. (City inspector will typically allow the box outlet or low voltage transformer to be double tapped)

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

## Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### 61 UNIT #14 ELECTRICAL

Panel POOR

- The screws used to hold the electric panel cover on were the wrong type (sharp points) and have the potential to pierce an electrical cable or wire.
- Double tapped breaker present in the panel. Further review by electrician advised.

#### **62 UNIT #15 ELECTRICAL**

Panel POOR

- Screws used to secure the electrical panel cover were missing.
- The screws used to hold the electric panel cover on were the wrong type (sharp points) and have the potential to pierce an electrical cable or wire.
- Breaker double tapped. (City inspector will typically allow the box outlet or low voltage transformer to be double tapped)

## 63 UNIT # 3 PLUMBING

Supply POOR

• Issues have risen in regards to CSST (corrugated stainless steel tubing) and lighting strikes on or near homes. It is now required that this gas line plumbing be grounded. CSST tubing installed on water heater gas line.

#### 64 UNIT # 8 PLUMBING

Supply

It is now required that CSST gas line plumbing be grounded.

#### 65 UNIT # 2 WATER HEATER

**POOR** 

- Most water heaters have a life span of ten to twelve years. Unit was functional, but was rated
  marginal due to its age. Ultimately, you should consider budgeting for replacement of the hot water
  heater in the foreseeable future.
- There should be a minimum of 12" of vertical rise between the draft hood and the first elbow. This
  allows for proper ventilation of the water heater gases. Further review by a plumber or HVAC tech
  advised.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### 66 UNIT # 3 WATER HEATER

**FAIR** 

• There should be a minimum of 12" of vertical rise between the draft hood and the first elbow. This allows for proper ventilation of the water heater gases. Further review by a plumber or HVAC tech advised.

### 67 UNIT # 4 WATER HEATER

**POOR** 

• There should be a minimum of 12" of vertical rise between the draft hood and the first elbow. This allows for proper ventilation of the water heater gases. Excess build up of rust and corrosion on vent pipe. This could lead to leaking of fumes. Further review by a plumber or HVAC tech advised.

#### 68 UNIT # 5 WATER HEATER

**FAIR** 

 There was excessive rust present at the cold water copper pipe fittings located at the top of the water heater.

#### 69 UNIT # 6 WATER HEATER

**POOR** 

- Most water heaters have a life span of ten to twelve years. Unit was functional, but was rated marginal due to its age. Ultimately, you should consider budgeting for replacement of the hot water heater in the foreseeable future.
- A moderate amount of rust flaking visible on the bottom of the tank indicated that water heater components have experienced some deterioration.
- Cover plate for fire chamber was missing at time of inspection. Advise that cover plate is replaced for safety.
- There should be a minimum of 12" of vertical rise between the draft hood and the first elbow. This
  allows for proper ventilation of the water heater gases. Further review by a plumber or HVAC tech
  advised.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### 70 UNIT # 7 WATER HEATER

**FAIR** 

• There should be a minimum of 12" of vertical rise between the draft hood and the first elbow. This allows for proper ventilation of the water heater gases. Further review by a plumber or HVAC tech advised.

#### 71 UNIT # 8 WATER HEATER

**POOR** 

- There should be a minimum of 12" of vertical rise between the draft hood and the first elbow. This allows for proper ventilation of the water heater gases. Further review by a plumber or HVAC tech advised.
- Rust and corrosion visible on flue piping. This may lead to pitting and hole development. Monitor condition and replace flue piping as needed.
- The water heater is believed to be beyond design life but was operational at time of inspection. Monitor condition as early repairs/replacement may be needed

#### 72 UNIT # 9 WATER HEATER

**POOR** 

- The water heater is believed to be beyond design life but was operational at time of inspection.
- There should be a minimum of 12" of vertical rise between the draft hood and the first elbow. Further review by a plumber or HVAC tech advised.
- Cover plate missing from lower compartment of water heater.

#### 73 UNIT # 10 WATER HEATER

FAIR

- There should be a minimum of 12" of vertical rise between the draft hood and the first elbow. This allows for proper ventilation of the water heater gases. Further review by a plumber or HVAC tech advised.
- •
- Unit was functional, but was rated marginal due to its age. Ultimately, you should consider budgeting for replacement of the hot water heater in the foreseeable future.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### 74 UNIT # 11 WATER HEATER

**FAIR** 

• There should be a minimum of 12" of vertical rise between the draft hood and the first elbow. This allows for proper ventilation of the water heater gases. Further review by a plumber or HVAC tech advised.

#### 75 UNIT # 12 WATER HEATER

**FAIR** 

- There should be a minimum of 12" of vertical rise between the draft hood and the first elbow. This allows for proper ventilation of the water heater gases. Further review by a plumber or HVAC tech advised.
- Rust and corrosion visible on the lower portion of the water heater tank.
- The water heater is beyond design life but was operational at time of inspection. Monitor condition as early repairs/replacement may be needed

#### 76 UNIT # 13 WATER HEATER

**FAIR** 

- There should be a minimum of 12" of vertical rise between the draft hood and the first elbow. This
  allows for proper ventilation of the water heater gases. Further review by a plumber or HVAC tech
  advised.
- Burner chamber cover plate was missing at time of inspection.

#### 77 UNIT # 14 WATER HEATER

**POOR** 

- There should be a minimum of 12" of vertical rise between the draft hood and the first elbow. This
  allows for proper ventilation of the water heater gases. Further review by a plumber or HVAC tech
  advised.
- Most water heaters have a life span of ten to twelve years. Unit was functional, but beyond its design life.

#### 78 UNIT # 15 WATER HEATER

FAIR

- There should be a minimum of 12" of vertical rise between the draft hood and the first elbow. This
  allows for proper ventilation of the water heater gases. Further review by a plumber or HVAC tech
  advised.
- The water heater is believed to be beyond design life but was operational at time of inspection. Monitor condition as early repairs/replacement may be needed

Inspection Date: Inspector: Jay Heckart

05/16/2024 Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

# 79 LAUNDRY FACILITIES Dryer Vents **POOR** Multiple damaged exterior dryer vent covers. Recommend that vent covers are replaced to prevent pest entry. 80 UNIT # 3 FURNACE Operation **FAIR** Rated marginal due to unit being beyond standard design life. Due to the age of unit, be aware that it could need repairs or replacing at any time. 81 UNIT # 6 FURNACE Operation POOR Gas connections with visible repairs housed within the furnace system. Further review by a qualified HVAC contractor to determine if repairs are done properly and if gas connections should be moved outside of unit. Rated marginal due to unit being beyond standard design life. Due to the age of unit, be aware that it could need repairs or replacing at any time. 82 UNIT # 8 FURNACE Operation **FAIR** At the time of inspection, the unit was working. However, it was at or beyond life design. 83 UNIT # 10 FURNACE Operation **FAIR** Rated marginal due to age. Unit functional at time of inspection. 84 UNIT # 14 FURNACE

FAIR

• The flexible gas line was installed through the furnace cabinet in violation of installation instructions. Flex lines are thin and vulnerable to damage. Only a solid metal pipe may be installed through the furnace cabinet. Further review by HVAC tech advised.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com

05/16/2024 Inspector Phone: (563) 676-7400

Operation



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### 85 UNIT # 15 FURNACE

Operation FAIR

• Rated fair due to unit being beyond standard design life. Due to the age of unit, be aware that it could need repairs or replacing at any time.

#### 86 UNIT # 8 DRAFT CONTROL/VENT

**POOR** 

- The exhaust flue for the furnace was loose inside of the attic creating a health hazard for CO leakage. Advise that pipe is properly secured and installed for safety.
- Test hole in flue pipe should be sealed to help prevent combustion gases from entering the house.

#### 87 UNIT # 15 DRAFT CONTROL/VENT

**POOR** 

Rain cap missing from exterior flue. Rust build up and corrosion visible on interior flue.

#### 88 UNIT # 3 HVAC DISTRIBUTION

Distribution

POOR

Blower

POOR

• Fins on the blower had accumulated dirt and debris which have slowed down the fans rotation and reduced the amount of air that the blower motor is capable of moving. Excessive noise from fan motor. Advise that the blower fins are properly cleaned by a qualified HVAC tech.

### 89 UNIT # 5 HVAC DISTRIBUTION

Distribution

FAIR

• Gaps and rust present in air ducts. Recommend that any gaps are properly sealed and rust is monitored for holes or additional damage. Repair or replace damaged duct system as needed.

#### 90 UNIT # 6 HVAC DISTRIBUTION

Blower

FAIR

• Fins on the blower had accumulated dirt which may slow down the fans rotation and reduce the amount of air that the blower motor is capable of moving. Advise that the blower fins are properly cleaned by a qualified HVAC tech.

Inspection Date: Inspector: Jay Heckart

05/16/2024 Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### 91 UNIT # 9 HVAC DISTRIBUTION

Blower

• Blower compartment and fan was full of debris and dust build up. This may cause damage to the fan and its components. Further repair and cleaning by HVAC tech advised.

### 92 UNIT # 10 HVAC DISTRIBUTION

Blower POOR

• Fins on the blower had accumulated dirt which may slow down the fans rotation and reduce the amount of air that the blower motor is capable of moving. Advise that the blower fins are properly cleaned by a qualified HVAC tech.

#### 93 UNIT # 15 HVAC DISTRIBUTION

Blower

• Fins on the blower had accumulated dirt which may slow down the fans rotation and reduce the amount of air that the blower motor is capable of moving. Advise that the blower fins are properly cleaned by a qualified HVAC tech.

94 UNIT # 1 COOLING FAIR

- A/C suction line requires re-insulation to improve efficiency.
- The HVAC condenser unit was not level. It is very important for the condenser to be level to reduce wear on the fan barings and enable the lubricating oil to reach all parts of the compressor motor.

95 UNIT # 2 COOLING POOR

- Unit is at or near design life. Due to the age of unit, be aware that it could need repairs or replacing at any time.
- No pad. The air conditioner compressor housing was not mounted on a stable surface. Over time, it could move out of level which will create mechanical problems such as premature fan bearing wear.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

## Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### 96 UNIT # 3 COOLING

**FAIR** 

 Unit is at or near design life. Due to the age of unit, be aware that it could need repairs or replacing at any time.

### 97 UNIT # 4 COOLING

**POOR** 

- Rated marginal due to unit being at or near design life. Due to the age of unit, be aware that it could need repairs or replacing at any time.
- The HVAC condenser unit was not level. It is very important for the condenser to be level to reduce wear on the fan barings and enable the lubricating oil to reach all parts of the compressor motor.
- Condenser service wire is exposed due to conduit coming loose from breaker box. Recommend that conduit is properly secured to prevent damage to wire and for electrical safety.

#### 98 UNIT # 5 COOLING

**FAIR** 

- Rated marginal due to unit being at or near design life. Due to the age of unit, be aware that it could need repairs or replacing at any time.
- A/C suction line requires re-insulation to improve efficiency.

#### 99 UNIT # 6 COOLING

FAIR

• Rated marginal due to unit being at or near design life. Due to the age of unit, be aware that it could need repairs or replacing at any time.

#### 100 UNIT # 9 COOLING

**POOR** 

- The HVAC condenser was not installed on a visible pad and may become un level due to settling. It is very important for the condenser to be level to enable the lubricating oil to reach all parts of the compressor motor.
- The presence of condensation on the interior side of the suction lines noted during the inspection. The presence of frost or ice could indicate the unit was not operating properly and requires service.

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### 101 UNIT # 10 COOLING

POOR

• AC unit was not installed on a visible pad. Advise that pad be installed to prevent AC unit from settling or being uneven.

#### **102 UNIT # 11 COOLING**

**FAIR** 

• No visible pad installed under AC unit. Advise that AC unit is installed on top of a concrete or plastic pad to prevent settling.

#### **103 UNIT # 12 COOLING**

**FAIR** 

• Leaf debris built up around the AC unit. Clean exterior condensing unit on a routine basis. Obstructed air flow could lead to poor efficiency/damage to the unit.

#### **104 UNIT # 14 COOLING**

**FAIR** 

• Rated marginal due to unit being at or near design life. Due to the age of unit, be aware that it could need repairs or replacing at any time.

#### **105 UNIT # 15 COOLING**

**FAIR** 

• Unit is at or near design life. Due to the age of unit, be aware that it could need repairs or replacing at any time.

#### 106 UNIT # 1 KITCHEN

Stove Top/Oven

**POOR** 

• Stove top and oven were installed in direct contact with drywall. Recommend a protective material is installed in between oven for fire protection.

#### 107 UNIT # 2 KITCHEN

Sink/Faucet

FAIR

Stove Top/Oven

POOR

Dishwasher/Cross Flow Protection

POOR

- Stove top and oven were installed in direct contact with drywall. Oven door was also rubbing on wall causing damage to drywall. Recommend a protective material is installed in between oven for fire protection.
- Dishwasher drainage loop not properly installed. A high loop prevents waste water back flowing from your sink to your dishwasher. If the drain hose is not elevated, there is a potential for water to run the wrong way through your drain hose and can cause standing water at the bottom of the dishwasher. Recommend proper high loop be installed.
- Dishwasher status lights were blinking and would not respond to touch. Further evaluation advised.

Inspection Date:

Inspector: Jay Heckart

Email: jay.heckart@npiinspect.com

05/16/2024

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

- Sink faucet head was leaking at time of inspection. Advise that faucet head is repaired or replaced.
- Large amounts of grease build up on stove top surface. Recommend that surface is properly cleaned.

#### 108 UNIT # 3 KITCHEN

Stove Top/Oven POOR

• Stove top and oven were installed in direct contact with drywall. Recommend a protective material is installed in between oven for fire protection.

#### 109 UNIT # 4 KITCHEN

Ceilings FAIR

Stove Top/Oven POOR

- Stove top and oven were installed in direct contact with drywall. Recommend a protective material is installed in between oven for fire protection. Burn marks / discoloration and heat damage visible on wall next to stove.
- Ceiling was stained above the over. Recommend that stains are cleaned off to prevent permanent staining of ceiling.

#### 110 UNIT # 5 KITCHEN

Stove Top/Oven POOR

• Stove top and oven were installed in direct contact with drywall. Recommend a protective material is installed in between oven for fire protection. Heat damage to drywall next to oven visible.

## **111 UNIT # 7 KITCHEN**

Stove Top/Oven POOR

Dishwasher/Cross Flow Protection POOR

- Dishwasher cross-flow protection not installed properly. Discharge tube should be mounted to the underside of the countertop to create a high point to prevent water from flowing backwards into the dishwasher unit from the sink or drainage pipes.
- Oven and stove top was installed directly against unprotected drywall. Drywall showing signs of heat damage and discoloration.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

112 UNIT # 8 KITCH	EN	
--------------------	----	--

Stove Top/Oven

POOR

Stove installed in direct contact with drywall.

### 113 UNIT # 9 KITCHEN

Wall(s)

FAIR

Countertops/Cabinets

POOR

Stove Top/Oven

**POOR** 

- Lower sink left door was damaged at time of inspection.
- Drywall next to oven is starting to show heat damage and staining. Advise that a protective barrier is installed between oven and wall.

#### **114 UNIT # 10 KITCHEN**

Stove Top/Oven

POOR

• Stove was installed in contact with the drywall. Recommend a protective material is installed to prevent damage to dry wall and possible fire risk.

#### **115 UNIT # 12 KITCHEN**

Dishwasher/Cross Flow Protection

POOR

• Dishwasher cross-flow protection not installed properly. Discharge tube should be mounted to the underside of the countertop to create a high point to prevent water from flowing backwards into the dishwasher unit from the sink or drainage pipes.

#### 116 UNIT # 1 BATHROOM

Countertops/Cabinets

FAIR

Tub/Shower

FAIR

- Countertop along backsplash is not caulked. Recommend that caulk is applied to avoid water getting behind cabinets.
- Shower / tub enclosure needs improvement in caulking to create a water tight seal.

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### 117 UNIT # 2 BATHROOM

Countertops/Cabinets

FAIR

Tile Work/Enclosure

POOR

- Countertop along backsplash is not caulked. Recommend that caulk is applied to avoid water getting behind cabinets.
- Shower enclosure was chipped and showing damage. Advise that enclosure is repaired or replaced to prevent leaks from developing.

#### 118 UNIT # 3 BATHROOM

Countertops/Cabinets

FAIR

Toilet

POOR

Exhaust Fan

- POOR
- Countertop along backsplash is not caulked. Recommend that caulk is applied to avoid water getting behind cabinets.
- The toilet was loose at base. This may cause unseen seepage to occur which may not show until some later date. Also there is a potential for sewage gas to enter the dwelling when a toilet is loose at base. Further evaluation and repair by a qualified plumber advised.
- Exhaust fan did not respond to the switch. Further evaluation and repair advised.

### 119 UNIT # 4 BATHROOM

Countertops/Cabinets

FAIR

Tub/Shower

POOR

- Shower / tub faucet head was loose and not properly secured to enclosure. Recommend that faucet head is properly installed and caulked to prevent moisture / water entry behind enclosure.
- Countertop along backsplash is not caulked. Recommend that caulk is applied to avoid water getting behind cabinets.

#### 120 UNIT # 5 BATHROOM

Countertops/Cabinets

FAIR

 Countertop along backsplash is not caulked. Recommend that caulk is applied to avoid water getting behind cabinets.

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

### 121 UNIT # 6 BATHROOM

Countertops/Cabinets FAIR

Toilet

POOR

- The toilet was loose at base. Further evaluation and repair by a qualified plumber advised.
- Countertop along backsplash is not caulked. Recommend that caulk is applied to avoid water getting behind cabinets.

#### 122 UNIT # 7 BATHROOM

Countertops/Cabinets FAIR

Recommend that caulk is applied to avoid water getting behind cabinets.

#### 123 UNIT # 8 BATHROOM

Countertops/Cabinets FAIR

Toilet

POOR

- The toilet was loose at base. Further evaluation and repair by a qualified plumber advised.
- Countertop along backsplash is not caulked. Recommend that caulk is applied to avoid water getting behind cabinets.

#### 124 UNIT # 9 BATHROOM

Countertops/Cabinets FAIR

Tile Work/Enclosure POOR

- Countertop along backsplash is not caulked. Recommend that caulk is applied to avoid water getting behind cabinets.
- Shower / Tub enclosure was chipped and damaged. This may lead to holes or cracks developing.
   Advise that enclosure is repaired or replaced to prevent possible water related damage.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### 125 UNIT # 10 BATHROOM

Countertops/Cabinets FAIR

Toilet POOR

Tub/Shower POOR

- Countertop along backsplash is not caulked. Recommend that caulk is applied to avoid water getting behind cabinets.
- The toilet was loose at base.
- Tub / shower enclosure was chipped and damaged. Recommend that enclosure is repaired or replaced to prevent leaks from developing.

#### **126 UNIT # 11 BATHROOM**

Countertops/Cabinets FAIR

Toilet POOR

- Toilet was loud and runs continuously after flushing. Further review and repair by plumber advised.
- Countertop along backsplash is not caulked. Recommend that caulk is applied to avoid water getting behind cabinets.

#### 127 UNIT # 12 BATHROOM

Countertops/Cabinets FAIR

Sink/Faucet POOR

- The sink was draining very slowly, suggesting there is a restriction in the drain pipe or trap located under the sink. Further review by plumber advised.
- Countertop along backsplash is not caulked. Recommend that caulk is applied to avoid water getting behind cabinets.

### **128 UNIT # 13 BATHROOM**

Countertops/Cabinets FAIR

 Countertop along backsplash is not caulked. Recommend that caulk is applied to avoid water getting behind cabinets.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### **129 UNIT # 14 BATHROOM**

Exhaust Fan POOR

Water Pressure/Flow/Drainage

POOR

- Water was shut off to bathroom sink. Advise that water is turned on and fixture & plumbing are checked for leaks.
- Exhaust fan had excess noise when in operation. Recommend that fan is cleaned and checked for proper operation.

#### 130 UNIT # 15 BATHROOM

Countertops/Cabinets FAIR

Toilet POOR

Tub/Shower POOR

- The toilet was loose at base. Further evaluation and repair by a qualified plumber advised.
- Countertop along backsplash is not caulked. Recommend that caulk is applied to avoid water getting behind cabinets.
- Shower / tub enclosure was chipped and damaged. Advise that tub enclosure is repaired to prevent leaks from developing.

#### 131 UNIT # 1 BEDROOMS & LIVING SPACE

Closet

• Be aware of exposed bulb in closet. Lights in closets should be in an enclosed fixture for fire safety or to prevent breakage. Newer LED bulbs are less of a concern with heat and breakage due to plastic.

#### 132 UNIT # 2 BEDROOMS & LIVING SPACE

Closet FAIR

- Be aware of exposed bulb in closet. Lights in closets should be in an enclosed fixture for fire safety or to prevent breakage. Newer LED bulbs are less of a concern with heat and breakage due to plastic.
- Missing window screen in front bedroom.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

# Closet **FAIR** Window screens missing. • Be aware of exposed bulb in closet. 134 UNIT # 4 BEDROOMS & LIVING SPACE **FAIR** Be aware of exposed bulb in closet. 135 UNIT # 5 BEDROOMS & LIVING SPACE Closet **FAIR**

## 136 UNIT # 6 BEDROOMS & LIVING SPACE

133 UNIT # 3 BEDROOMS & LIVING SPACE

Closet **FAIR** 

 Be aware of exposed bulb in closet. Lights in closets should be in an enclosed fixture for fire safety or to prevent breakage. Newer LED bulbs are less of a concern with heat and breakage due to plastic.

 Be aware of exposed bulb in closet. Lights in closets should be in an enclosed fixture for fire safety or to prevent breakage. Newer LED bulbs are less of a concern with heat and breakage due to plastic.

#### 137 UNIT # 7 BEDROOMS & LIVING SPACE

Interior Doors/Hardware **FAIR** Closet

- Be aware of exposed bulb in closet.
- Upstairs bedroom door knobs were loose and not properly secured. Recommend that knobs are secured to the door for proper operation.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com

Inspector Phone: (563) 676-7400 05/16/2024

**FAIR** 



# **National Property Inspections**

## Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

Closet	FAIR
Be aware of exposed bulb in closet.	
139 UNIT # 9 BEDROOMS & LIVING SPACE	
Closet	FAIR
Be aware of exposed bulb in closet.	
40 UNIT # 10 BEDROOMS & LIVING SPACE	
Closet	FAIR
Be aware of exposed bulb in closet.	
141 UNIT # 11 BEDROOMS & LIVING SPACE	
Closet	FAIR
Be aware of exposed bulb in closet.	
142 UNIT # 12 BEDROOMS & LIVING SPACE	
Closet	FAIR
Be aware of exposed bulb in closet.	
143 UNIT # 13 BEDROOMS & LIVING SPACE	
Closet	FAIR
Be aware of exposed bulb in closet.	
144 UNIT # 14 BEDROOMS & LIVING SPACE	
Closet	FAIR
Be aware of exposed bulb in closet.	

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

## Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

## 145 UNIT # 15 BEDROOMS & LIVING SPACE

Closet

• Be aware of exposed bulb in closet. Lights in closets should be in an enclosed fixture for fire safety or to prevent breakage. Newer LED bulbs are less of a concern with heat and breakage due to plastic.

F (FAIR)	Average condition for the building system evaluated, taking into consideration factors of age and design. Some short term or immediate maintenance or repairs are recommended to return the system to a good condition.
P (POOR)	Below-average condition for the building system evaluated, taking into consideration factors of age and design. Immediate repair, significant work or replacement is anticipated to return the building system to a good or fair condition.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

## Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

		G	F	P	NI	NA
EAST BUILDING GRADING / DRAINAGE	☑ Recommend Repairs			V		

☑Near Level


☑Hardscape

#### Comments:

- The grading around the building was near level. This condition may allow water to accumulate around the house during rains/snow melt and has the potential to allow water to enter the dwelling. Monitor condition during rains as improvements in grading/drainage may be needed.
- Hardscape / concrete walkway on the south side of the building has started to settle away from the building creating a gap between the building and hardscape. This may allow for water intrusion that may expedite the settling of the concrete slabs. Monitor condition as improvements in drainage may be necessary if the slabs settle towards the building.
- Brush and debris build up along grade and foundation. Advise that exterior grade of the building is cleared to prevent moisture build up.



East Building Grading / Drainage:

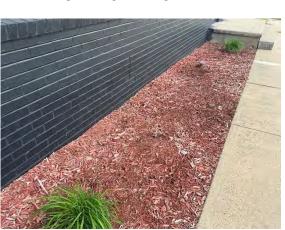

East Building Grading / Drainage:



East Building Grading / Drainage: HARDSCAPE GRADE



East Building Grading / Drainage: DEBRIS AND BUILD UP ALONG GRADE

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

## Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

		G	F	P	NI	NA
NORTH BUILDING GRADING / DRAINAGE	☑ Recommend Repairs			V		

☑Near Level

#### Comments:

- The grading around the building was near level. This condition may allow water to accumulate around the house during rains/snow melt and has the potential to allow water to enter the dwelling. Monitor condition during rains as improvements in grading/drainage may be needed.
- Brush should be cleared away from grade to prevent moisture accumulation around foundation.



North Building Grading / Drainage:



North Building Grading / Drainage:



North Building Grading / Drainage:



North Building Grading / Drainage:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

## Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



North Building Grading / Drainage:



North Building Grading / Drainage:

## WEST BUILDING GRADING / DRAINAGE

☑ Monitor Condition

G	F	P	NI	NA
	V			

☑Near Level

#### Comments:

- The grading around the dwelling was near level. Ideally, the grading should slope away from the building to allow water to run away from the foundation.
- Sections of the siding were in contact with the grade, garden bed, etc.. Proper clearance should be provided.



West Building Grading / Drainage:



West Building Grading / Drainage:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400




# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



West Building Grading / Drainage:

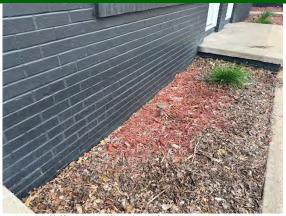

West Building Grading / Drainage:

		G	F	P	NI	NA
PARKING LOT	☑ Monitor Condition		V			

☑ Concrete ☑ Cracks ☑ General Deterioration

#### Comments:

• The parking lot has common cracks and settling typical to the age and exposure. Monitor condition of parking lot as repairs or replacement may be necessary in the near future.



Parking Lot:



Parking Lot:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



## **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240







Parking Lot:

#### COMPLEX FLATWORK / SIDEWALKS

☑ Recommend Repairs

G	F	P	NI	NA
		V		

**☑** Concrete

☑ Cracks/Settlement

☑ General Deterioration

#### Comments:

- Due to settling of concrete walkways the sewer clean out in front of Unit #s 10 & 11 has become a tripping hazard. Advise that walkways are raised to level with clean out for safety.
- There were minor cracks and settling present in the concrete walkway. This is common and is caused by normal ground settlement and age. Recommend filling crack(s) with an approved concrete filler or sealant to prevent further damage due to water intrusion. Monitor walkways over time.
- Rear patios and porch steps showing signs of general deterioration and cracking.



Complex Flatwork / Sidewalks:



Complex Flatwork / Sidewalks:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Complex Flatwork / Sidewalks: CRACKING AND GENERAL DETERIORATION OF ENTRYWAY SLAB



Complex Flatwork / Sidewalks:



Complex Flatwork / Sidewalks: SETTLED WALKWAY WITH TRIPPING HAZARD



Complex Flatwork / Sidewalks:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



## **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Complex Flatwork / Sidewalks:



Complex Flatwork / Sidewalks: SETTLING AND DETERIORATION OF SLAB

### EAST BUILDING ROOFING

NG 

☑ Recommend Repa

Design Life: 20-25 Year(s) Layers: 1 100% Visible

☑ Walked On ☑ Asphalt / Composition ☑ Trim Trees / Branches ☑ Cable Laying On Roof Surface

☑ Missing Rain Cap

#### Comments:

- Roofing consists of architectural style shingles. These are a thicker, longer lasting shingle with a dimensional appeal.
- Keep trees and branches trimmed to prevent damage to roof covering.
- Cable penetrating and laying on roof surface. This may cause damage to shingles in high winds. Recommend rerouting wire to protect roof shingles.
- Unit #15 furnace exhaust flue has a missing and damaged rain cap. This is creating a direct access for water to reach the inside of the unit and furnace system. Recommend that rain cap is replaced as soon as possible.

Leaks not always detectable.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com

05/16/2024 Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



East Building Roofing:



East Building Roofing: WIRE LAYING ON ROOF SHINGLES



East Building Roofing:



East Building Roofing: TREE BRANCHES IN CONTACT WITH ROOF

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



East Building Roofing:



East Building Roofing: DAMAGED AND MISSING RAIN CAP



East Building Roofing:



East Building Roofing:

☑ Recommend Repairs

### NORTH BUILDING ROOFING

Design Life: 20-25 Year(s) Layers: 1 100% Visible

✓ Asphalt / Composition ✓ Exposed Nails ✓ Nails Present ✓ Cable Laying On Roof Surface

 $\square_{Age}$ 

#### Comments

• Roofing consists of architectural style shingles. These are a thicker, longer lasting shingle with a dimensional appeal.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com

05/16/2024 Inspector Phone: (563) 676-7400

NI

 $\checkmark$ 

NA



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

- Exposed nail heads noted at various locations. Recommend sealing all nail heads to prevent water intrusion and monitoring the conditions of repaired areas.
- Roofing nails present on the roof at the time of the inspection. Recommend that the roof is walked and all nails are removed to prevent tire punctures, personal injury, etc.
- Cable penetrating and laying on roof surface. This may cause damage to shingles in high winds. Recommend rerouting wire to protect roof shingles.
- Previous repairs visible on roof surface. Monitor area over time and recommend reaching out to seller for details on reason for repair.



North Building Roofing:



North Building Roofing:



North Building Roofing: NAILS LEFT ON ROOF



North Building Roofing: EXPOSED NAIL HEAD

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



North Building Roofing:



North Building Roofing: PAST REPAIRS NOTED



North Building Roofing:



North Building Roofing: WIRES PENETRATING SHINGLES AND LAYING ON THE ROOF

☑ Monitor Condition

G

 $\overline{\mathbf{A}}$ 

### WEST BUILDING ROOFING

Design Life: 20-25 Year(s)

Layers: 1

100% Visible

☑ Walked On ☑ Asphalt / Composition ☑ Trim Trees / Branches

#### Comments:

- Roofing consists of architectural style shingles. These are a thicker, longer lasting shingle with a dimensional appeal.
- Keep trees and branches trimmed to prevent damage to roof covering.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com

05/16/2024 Inspector Phone: (563) 676-7400

NI

NA



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



West Building Roofing:



West Building Roofing:



West Building Roofing:



West Building Roofing:



West Building Roofing: TREE IN CONTACT WITH ROOF



West Building Roofing:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

				G	F	P	NI	NA
EAST BUILD	ING FLASHING / VALLEYS	Monitor Condition			V			
✓Metal	☑ Plastic	☐ General Deterioration	⊠Rι	ust				

#### Comments:

- Check flashing sealant on a regular basis to ensure a good water tight seal.
- Noted rusty flashing. Paint and/or seal as necessary.
- Some damage to flashing caulking due to exposure and age. Recommend that caulking is updated to prevent moisture penetration.



East Building Flashing / Valleys:



East Building Flashing / Valleys: CRACKED AND WEATHERED CAULKING



East Building Flashing / Valleys: RUSTED FLASHING



East Building Flashing / Valleys: RUSTED FLASHING

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



East Building Flashing / Valleys:



East Building Flashing / Valleys:

			G	F	P	NI	NA
NORTH BUIL	DING FLASHING/VALLEYS	☑ Recommend Repairs			Ø		
✓Metal	☑ Plastic	☐ General Deterioration	<b>☑</b> Rust				

#### Comments:

- Check flashing sealant on a regular basis to ensure a good water tight seal.
- Some damage to flashing caulking due to exposure and age. Recommend that caulking is updated to prevent moisture penetration.
- Noted rusty flashing. Paint and/or seal as necessary.



North Building Flashing/Valleys:



North Building Flashing/Valleys:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



North Building Flashing/Valleys:



North Building Flashing/Valleys: RUSTED AND LIFTING FLASHING



North Building Flashing/Valleys:



North Building Flashing/Valleys: EXPOSED NAIL HEAD



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



North Building Flashing/Valleys: RUSTED AND EXPOSED NAIL HEAD



North Building Flashing/Valleys:

### WEST BUILDING FLASHING/VALLEYS

☑ Recommend Repairs

G	F	P	NI	NA
		V		

☑ Metal ☑ Rust

☑ Lifting

☑ General Deterioration

#### Comments:

• Check flashing sealant on a regular basis to ensure a good water tight seal.

✓ Plastic

- Rusted and lifting flashing visible on the roof deck. This may be an avenue for water to get under the shingles causing water related damage.
- Some damage to flashing caulking due to exposure and age. Recommend that caulking is updated to prevent moisture penetration.



West Building Flashing/Valleys:



West Building Flashing/Valleys: RUSTED AND LIFTING FLASHING

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



West Building Flashing/Valleys:



West Building Flashing/Valleys:



West Building Flashing/Valleys:



West Building Flashing/Valleys:



West Building Flashing/Valleys:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



## **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

		G	F	P	NI	NA
EAST BUILDING ROOF DRAINAGE SYSTEM	☑ Monitor Condition		V			

☑ Aluminum ☑ Corrugate Pipe ☑ Leaking

#### Comments:

- Gutters were in good condition and free of debris, with downspouts and extensions present.
- A full inspection of gutter(s) requires wet weather. Monitor gutters during rainfall to ensure that no water is dripping next to the foundation and that all water is being diverted 4-6 feet away from the foundation. Ensure that the back side of the gutter is fastened to the fascia board as needed and that the gutters and downspouts are cleaned out on a regular basis to reduce the risk of dripping water and/or overflowing toughs. Proper guttering and grading is essential for reducing the risk of water intrusion into the home.
- Mulch displacement in the south west corner of the building is typical to overflowing gutter systems. Monitor condition as gutter cleaning may be needed in this area.



East Building Roof Drainage System:



East Building Roof Drainage System:



East Building Roof Drainage System:



East Building Roof Drainage System:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



## **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

					G	F	P	NI	NA
NORTH BUILDIN	G ROOF DRAINAGE SY	YSTEM	☑ Monitor Condition			Ø			
✓Aluminum	☑Corrugate Pipe	☑PVC		⊠Sub	b Gra	de			

☑ Damaged Extension(s)

#### Comments:

- A full inspection of gutter(s) requires wet weather. Monitor gutters during rainfall to ensure that no water is dripping next to the foundation and that all water is being diverted 4-6 feet away from the foundation. Ensure that the back side of the gutter is fastened to the fascia board as needed and that the gutters and downspouts are cleaned out on a regular basis to reduce the risk of dripping water and/or overflowing toughs. Proper guttering and grading is essential for reducing the risk of water intrusion into the home.
- Corrugated pipe extensions were damaged. Advise that damaged piping is replaced to allow for proper drainage.



North Building Roof Drainage System:



North Building Roof Drainage System:



North Building Roof Drainage System:



North Building Roof Drainage System: DAMAGED **PIPING** 

Inspection Date: Inspector: Jay Heckart 05/16/2024

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



North Building Roof Drainage System:

### WEST BUILDING ROOF DRAINAGE SYSTEM

G	F	P	NI	NA
$\overline{\mathbf{A}}$				

☑ Aluminum ☑ Corrugate Pipe ☑ PVC ☑ Sub Grade

#### Comments:

- Gutters were in good condition and free of debris, with downspouts and extensions present.
- A full inspection of gutter(s) requires wet weather. Monitor gutters during rainfall to ensure that no water is dripping next to the foundation and that all water is being diverted 4-6 feet away from the foundation. Ensure that the back side of the gutter is fastened to the fascia board as needed and that the gutters and downspouts are cleaned out on a regular basis to reduce the risk of dripping water and/or overflowing toughs. Proper guttering and grading is essential for reducing the risk of water intrusion into the home.



West Building Roof Drainage System:



West Building Roof Drainage System:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



West Building Roof Drainage System:

#### EAST BUILDING EXTERIOR SURFACE

☑ Recommend Repairs

Email: jay.heckart@npiinspect.com

EIIST DCIEDI	TO ETTERMOTE SOTH TICE	_ 1100011111111111 110puns					
☑Vinyl	☑ Needs Caulk / Seal						
			G	F	P	NI	NA
EXTERIOR WALL FIN	NISH				Ø		
EXTERIOR FAUCETS			Ø				
EXTERIOR ELECTRIC	CAL OUTLETS						Ø
EXTERIOR LIGHTING	3				V		

#### Comments:

- There were penetrations in the siding that will eventually allow moisture intrusion. Any visible penetration, including electrical conduit from the meter, HVAC lines/vents, light/receptacle fixtures, etc. should be sealed or caulked where it penetrates the home to prevent possible water intrusion to the home.
- Multiple exterior lighting was not responding to switch. Recommend that bulbs are checked and replaced. Lights may be on timer linked to main security lights. Check with seller.

Inspection Date: Inspector: Jay Heckart

05/16/2024 Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



East Building Exterior Surface:



East Building Exterior Surface: UNCAULKED PENETRATIONS



East Building Exterior Surface:



East Building Exterior Surface:

NORTH BUILDING	EXTERIOR SURFACE	☑ Recommend Repair	rs.					
☑ General Deterioration	☑ Needs Caulk / Seal	☑ Damaged Exterior Faucet	✓Viny					
			(	i i	,	P	NI	NA
SIDING/TRIM				J [	]	Ø		
EXTERIOR FAUCETS				J [	] [	Ø		
EXTERIOR ELECTRICAL OU	TLETS			J   [	]			Ø
EXTERIOR LIGHTING				] [	] [	Ø		

#### Comments:

Inspection Date: Inspector: Jay Heckart

05/16/2024 Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

- Northwest rear faucet pipe has burst. Recommend that faucet and damaged pipe are repaired prior to turning on water to this faucet.
- Some bulging in rear siding. Cause of bulging is unknown. Further review advised.
- There were penetrations in the siding that will eventually allow moisture intrusion. Any visible penetration, including electrical conduit from the meter, HVAC lines/vents, light/receptacle fixtures, etc. should be sealed or caulked where it penetrates the home to prevent possible water intrusion to the home.
- Wood trim missing above unit #9.
- Multiple exterior lighting was not responding to switch. Recommend that bulbs are checked and replaced. Lights may be on timer linked to main security lights. Check with seller.



North Building Exterior Surface:



North Building Exterior Surface: UNCAULKED PENETRATIONS



North Building Exterior Surface: BULGING IN SIDING



North Building Exterior Surface: LOOSE AND BURST EXTERIOR FAUCET

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



North Building Exterior Surface: UNCAULKED PENETRATIONS



North Building Exterior Surface: BULGING SIDING



North Building Exterior Surface:



North Building Exterior Surface: MISSING WOOD TRIM

#### WEST BUILDING EXTERIOR SURFACE

☑ Monitor Condition☑ Recommend Repairs

✓Vinyl	☐ General Deterioration	☑Missing / Loose	⊠Ne	eds C	aulk /	Seal		
☑ Improper Installation	☑ Missing Exterior Faucet Har	ndles						
				G	F	P	NI	NA
SIDING/TRIM						$\overline{\mathbf{A}}$		
EXTERIOR FAUCETS					Ø			
EXTERIOR ELECTRICAL OUT	TLETS							Ø
EXTERIOR LIGHTING						V		

#### Comments:

• Exterior faucet handles missing from some faucets and water was turned off at time of inspection.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com

05/16/2024 Inspector Phone: (563) 676-7400



## **National Property Inspections**

#### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

- There were penetrations in the siding that will eventually allow moisture intrusion. Any visible penetration, including electrical conduit from the meter, HVAC lines/vents, light/receptacle fixtures, etc. should be sealed or caulked where it penetrates the home to prevent possible water intrusion to the home.
- Missing siding below unit 1 upper window has exposed the sheathing and flashing under the window. Recommend that siding is installed to prevent moisture entry.
- Bulging and loose siding typical to improperly cut vinyl siding visible. Proper installation advised to prevent permanent warping or bowing of vinyl planks.
- Unit #1 ventilation has an active bird nest present. Advise that nest is removed for proper ventilation.
- Multiple exterior lighting was not responding to switch. Recommend that bulbs are checked and replaced. Lights may be on timer linked to main security lights. Check with seller.



West Building Exterior Surface:



West Building Exterior Surface: UNCAULKED SIDING PENETRATIONS



West Building Exterior Surface:



West Building Exterior Surface: MISSING HANDLE ON EXTERIOR FAUCET

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



West Building Exterior Surface: LOOSE SIDING TRIM



West Building Exterior Surface: LOOSE AND BULGING SIDING



West Building Exterior Surface:



West Building Exterior Surface: MISSING TRIM WORK AROUND WINDOW

FACT	RIIII	DINC	FENESTD	ATION	SVSTEMS

☑ Monitor Condition

G	F	P	NI	NA
	V			

**☑** Vinyl

☑ Window Wells

☑ Grade Level Windows

#### Comments:

- Recommend all screens be in place or accounted for at final walk through. Multiple units were missing screens from bedroom and living room windows.
- Keep window wells free of debris to help prevent water intrusion. Recommend installing covers/rain diverters on window wells to keep them free of debris and to divert water.
- Dryer vent was discharging into a window well. This could lead to excessive moisture and related deterioration to surrounding building materials. Recommend rerouting dryer vent to a more appropriate location.

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



East Building Fenestration Systems: WINDOW WELL COVERS MISSING



East Building Fenestration Systems:



East Building Fenestration Systems: DRYER EXHAUST TERMINATING IN WINDOW WELL



East Building Fenestration Systems:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



East Building Fenestration Systems:




East Building Fenestration Systems:

		G	F	P	NI	NA
NORTH BUILDING FENESTRATION SYSTEMS	☑ Monitor Condition		V			

☑ Vinyl ☑ Window Wells ☑ Grade Level Windows

#### Comments:

- All accessible main windows were checked for leaks and operation. No leaks or water stains were observed and windows were operating properly. Keep all exterior and interior sills caulked as a part of normal maintenance.
- Basement windows near grade level. Ensure proper clearance between basement window and grading to help reduce risk of water intrusion.
- Not all window wells were covered. Recommend window wells covers for the prevention water, debris, and rodent/animal entry.
- Dryer vents were discharging into various window wells. This could lead to excessive moisture and related deterioration to surrounding building materials. Recommend rerouting dryer vent to a more appropriate location.

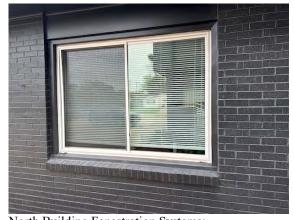

North Building Fenestration Systems:



North Building Fenestration Systems:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



## **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



North Building Fenestration Systems:



North Building Fenestration Systems: NO WINDOW WELL COVER AND FILLED WITH DEBRIS



North Building Fenestration Systems:



North Building Fenestrati	on Systems:
---------------------------	-------------

		G	F	P	NI	NA
WEST BUILDING FENESTRATION SYSTEMS	☑ Monitor Condition		V			

☑ Vinyl ☑ Window Wells ☑ Grade Level Windows

#### Comments:

- All accessible windows were checked for leaks and operation. No leaks or water stains were observed and windows were operating properly. Keep all exterior and interior sills caulked as a part of normal maintenance.
- Basement windows near grade level. Ensure proper clearance between basement window and grading to help reduce risk of water intrusion.
- Recommend window wells covers for the prevention water, debris, and rodent/animal entry.
- Basement window near grade level. Ensure proper clearance between basement window and grading to help reduce risk of water intrusion. Recommend that window well covers are installed.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com

05/16/2024 Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



West Building Fenestration Systems:



West Building Fenestration Systems:



West Building Fenestration Systems:



West Building Fenestration Systems:



## **National Property Inspections**

#### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



West Building Fenestration Systems: GRADE LEVEL WINDOW



West Building Fenestration Systems:



West Building Fenestration Systems: GRADE LEVEL WINDOWS WITH NO WINDOW WELLS

#### EAST BUILDING UNIT MAIN DOORS

G	F	P	NI	NA
Ø				

### ☑ Metal

#### Comments:

• Entry doors and the associated hardware were tested and operated as intended. The exterior doors are in acceptable condition with no visual flaws or defects.

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



East Building Unit Main Doors:



East Building Unit Main Doors:



East Building Unit Main Doors:



East Building Unit Main Doors:

			G	F	P	NI	NA
EAST BUILD	ING UNIT PATIO DOORS	☑ Monitor Condition		Ø			
<b>V</b> inyl	☑ Sliding Glass Patio Door						

### Comments:

- Patio doors and the associated hardware were tested and operated as intended. Recommend that the track and rollers are cleaned on a regular basis to prevent damage to the track system.
- Due to proximity of grade level windows to patio doors it is important to install strong window well covers to protect from falls and tripping.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com

Inspector Phone: (563) 676-7400 05/16/2024



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



East Building Unit Patio Doors:



East Building Unit Patio Doors:



East Building Unit Patio Doors:



East Building Unit Patio Doors:

### NORTH BUILDING UNIT MAIN DOORS

G	F	P	NI	NA
☑				

#### **☑** Metal

#### Comments:

• Entry doors and the associated hardware were tested and operated as intended. The exterior doors are in acceptable condition with no visual flaws or defects.

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



North Building Unit Main Doors:



North Building Unit Main Doors:



North Building Unit Main Doors:



North Building Unit Main Doors:



North Building Unit Main Doors:



North Building Unit Main Doors:

Inspection Date: 05/16/2024


Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

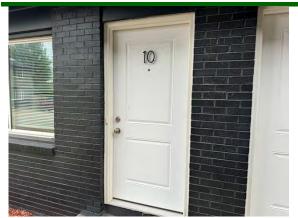

North Building Unit Main Doors:



North Building Unit Main Doors:

		G	F	P	NI	NA
NORTH BUILDING	G UNIT PATIO DOORS	$\square$				
<b></b> Vinyl	☑ Sliding Glass Patio Door					

#### Comments:

• Patio doors and the associated hardware were tested and operated as intended. Recommend that the track and rollers are cleaned on a regular basis to prevent damage to the track system.



North Building Unit Patio Doors:



North Building Unit Patio Doors:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



North Building Unit Patio Doors:



North Building Unit Patio Doors:





North Building Unit Patio Doors:



North Building Unit Patio Doors:



North Building Unit Patio Doors:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

# WEST BUILDING UNIT MAIN DOORS G F P NI NA U D D D

✓ Metal

#### Comments:

• Entry doors and the associated hardware were tested and operated as intended. The exterior doors are in acceptable condition with no visual flaws or defects.



West Building Unit Main Doors:



West Building Unit Main Doors:



West Building Unit Main Doors:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



## **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### NA ΝI G WEST BUILDING UNIT PATIO DOORS $\overline{\mathbf{V}}$ **☑** Vinyl

☑ Sliding Glass Patio Door

#### Comments:

• Patio doors and the associated hardware were tested and operated as intended. Recommend that the track and rollers are cleaned on a regular basis to prevent damage to the track system.



West Building Unit Patio Doors:



West Building Unit Patio Doors:



West Building Unit Patio Doors:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

EAST BUILDING EXTERIOR FOUNDATION	☑ Monitor Condition	Ø		
	_			

☑ Concrete Block ☑ General Deterioration ☑ Grout Cracks

#### Comments:

- Limited exterior visibility due to building design and landscaping.
- Cracks in grout lines of block foundation. Further evaluation advised and sealing of grout cracks to prevent moisture entry.
- Foundation penetrations should be sealed / caulked to prevent pest and moisture entry.



East Building Exterior Foundation: FOUNDATION PENETRATIONS



East Building Exterior Foundation: GROUT AND VERTICAL CRACKS IN FOUNDATION BLOCKS



East Building Exterior Foundation: UNCAULKED PENETRATION

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

		G	F	P	NI	NA
NORTH BUILDING EXTERIOR FOUNDATION	☑ Monitor Condition		V			

☑Concrete Block

☑ Needs Caulk / Seal

#### Comments:

- There was limited visibility of the foundation due to landscaping, building design and siding. It appeared to be in acceptable condition.
- Foundation penetrations were uncaulked where AC suction lines enter the building.



North Building Exterior Foundation:



North Building Exterior Foundation: AC LINE PENETRATING FOUNDATION



North Building Exterior Foundation:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



## **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

			G	F	P	NI	NA	ı
WEST BUILDING	<b>EXTERIOR FOUNDATION</b>	☑ Monitor Condition		Ø				ĺ
☑Concrete Block	☑ Limited Observation	☑Needs Caulk / Seal	☑ Vertic	al Cracl	cs			

☑ Limited Observation

☑ Needs Caulk / Seal

#### Comments:

- There was limited visibility of the foundation due to landscaping, building design and siding. See interior section for
- One or more vertical cracks due to settling noted. Monitor regularly and evaluate/repair as required.
- Grout line cracks visible in the foundation. Seal as needed and monitor for further cracking and movement.



West Building Exterior Foundation:



West Building Exterior Foundation: VERTICAL AND GROUT CRACKS IN FOUNDATION

Attic / Roof

Method of Inspection

☑ Physical Entry

☑ Visual from Access

90 % Visible

## EAST BUILDING ATTIC / ROOF FRAMING AND SHEATHING

G	F	P	NI	NA
Ø				

Plywood / Panel Board / OSB

**☑** Trusses

#### Comments:

• The attic interior was visually examined. No cracked trusses were observed at time of inspection. Staining and framework condition typical to age of construction. Attic framework and sheathing should be inspected on a regular basis for cracked trusses, staining, and other deficiencies.

Leaks not always detectable.

Inspection Date: Inspector: Jay Heckart

Inspector Phone: (563) 676-7400 05/16/2024



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



East Building Attic / Roof Framing and Sheathing:



East Building Attic / Roof Framing and Sheathing:



East Building Attic / Roof Framing and Sheathing:



East Building Attic / Roof Framing and Sheathing:



East Building Attic / Roof Framing and Sheathing:



East Building Attic / Roof Framing and Sheathing:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



## **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



East Building Attic / Roof Framing and Sheathing:



East Building Attic / Roof Framing and Sheathing:

# NORTH BUILDING ATTIC / ROOF FRAMING AND SHEATHING

☑ Recommend Repairs

G	F	P	NI	NA
		V		

Plywood / Panel Board / OSB

**☑** Trusses

☑ Open Electrical Junction(s)

☑ Damaged Fire Wall

#### Comments:

- General deterioration, staining, and aging of construction material present. Monitor condition of attic system as repairs may be necessary in the future.
- Open knock out in junction box located in the attic of unit # 8. Junction box should be sealed for electrical safety.
- Firewall / barrier betweens units # 10 & 11 was damaged and missing. Recommend that a proper firewall is installed for safety and to prevent direct access to individual units via the attic system.



North Building Attic / Roof Framing and Sheathing:



North Building Attic / Roof Framing and Sheathing:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



North Building Attic / Roof Framing and Sheathing:



North Building Attic / Roof Framing and Sheathing: OPEN JUNCTION BOX



North Building Attic / Roof Framing and Sheathing:



North Building Attic / Roof Framing and Sheathing:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



North Building Attic / Roof Framing and Sheathing: DAMAGED AND MISSING FIRE WALL



North Building Attic / Roof Framing and Sheathing:

# WEST BUILDING ATTIC / ROOF FRAMING AND SHEATHING

☑ Monitor Condition

G	F	P	NI	NA
	$\overline{\checkmark}$			

☑ Plywood / Panel Board / OSB

**☑**Trusses

#### Comments:

• Attic framework showing signs of past moisture entry. All was dry at time of inspection, monitor condition as repairs may be necessary if additional staining or moisture entry is present.



West Building Attic / Roof Framing and Sheathing:



West Building Attic / Roof Framing and Sheathing:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



West Building Attic / Roof Framing and Sheathing: STAINING VISIBLE ON ATTIC FRAME WORK



West Building Attic / Roof Framing and Sheathing:



West Building Attic / Roof Framing and Sheathing:



West Building Attic / Roof Framing and Sheathing:



West Building Attic / Roof Framing and Sheathing:



West Building Attic / Roof Framing and Sheathing:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

		G	F	P	NI	NA	
EAST BUILDING ATTIC VENTILATION	☑ Recommend Repairs			Ø			

**☑** Ridge

**☑** Soffit

☑ Bathroom Vents Terminating In Attic

☑No Soffit Baffles Installed

#### Comments:

- Bathroom vents were directed into the attic causing moisture to form on the roof sheathing. This will deteriorate the shingles from the inside out and cause early roof failure to sheathing. Recommend that bathroom vents are properly vented to the exterior of the building.
- Typical to the age of construction, soffit vents lacked baffles to help direct airflow in the attic. Over time insulation has settled and shifted causing some soffits to become blocked. This may cause ventilation issues on extreme hot and cold temperature days and effect efficiency. Monitor condition as improvements may be needed in the future.



East Building Attic Ventilation:



TERMINATING IN ATTIC



East Building Attic Ventilation:



East Building Attic Ventilation: SOFFIT VENTILATION WITH NO BAFFLES INSTALLED

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



East Building Attic Ventilation: VENTILATION FROM THE SOFFITS WITH NO BAFFLES IN PLACE

#### NORTH BUILDING ATTIC VENTILATION

☑ Recommend Repairs

G F P NI NA
□ □ ☑ □ □

☑ Ridg

**☑** Soffit

☑ Bathroom Vents Terminating In Attic

☑No Soffit Baffles Installed

#### Comments:

- Bathroom vents were directed into the attic causing moisture to form on the roof sheathing. This will deteriorate the shingles from the inside out and cause early roof failure to sheathing. Recommend that bathroom vents are properly vented to the exterior of the building.
- Typical to the age of construction, soffit vents lacked baffles to help direct airflow in the attic. Over time insulation has settled and shifted causing some soffits to become blocked. This may cause ventilation issues on extreme hot and cold temperature days and effect efficiency. Monitor condition as improvements may be needed in the future.



North Building Attic Ventilation: BATHROOM VENT TERMINATING IN ATTIC



North Building Attic Ventilation:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



North Building Attic Ventilation:



North Building Attic Ventilation:



North Building Attic Ventilation:

			G	F	P	NI	NA
WEST BUILDING ATTIC VENTILATION  ☑ Recommend Repairs					V		
☑Ridge	☑ Soffit	☑ Bathroom Vents Terminating In Attic					_

#### Comments:

- Bathroom vents were directed into the attic causing moisture to form on the roof sheathing. This will deteriorate the shingles from the inside out and cause early roof failure to sheathing. Recommend that bathroom vents are properly vented to the exterior of the building.
- Typical to the age of construction, soffit vents lacked baffles to help direct airflow in the attic. Over time insulation has settled and shifted causing some soffits to become blocked. This may cause ventilation issues on extreme hot and cold temperature days and effect efficiency. Monitor condition as improvements may be needed in the future.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com

05/16/2024 Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



West Building Attic Ventilation:



West Building Attic Ventilation: SOFFIT VENTS WITHOUT BAFFLES



West Building Attic Ventilation: BATHROOM EXHAUST FAN VENTING INTO THE ATTIC WITH MOISTURE STAINING ON INSULATION

EAST	RIII	DING	ATTIC	INSIII	ATION
LADI	DUIL	DING	AIII	INSUL	AIIUI

☑ Monitor Condition

G	F	P	NI	NA
	Ø			

☑ Blanket ☑ Signs of Moisture

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

#### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### Comments:

The U.S. Department of Energy (DOE) has recommendations for new and existing homes in relation to R-value. The insulation recommendations for ceilings, wood-frame walls, floors, foundation walls, crawlspace walls, and slabs have been increased overall and generally exceed those required by most building codes.

The R-value is an indicator of insulation's resistance to heat flow. The higher the R-value, the greater the insulating effectiveness.

lowa is located in Climate Zone 5 according to the U.S. Department of Energy. Component R-Value requirements by component listed below.

Ceiling - R49 Wood Framed Wall - R20 or R13 Mass Wall - R13/17 Floor - R30g Basement Wall - R15/19 Floor Slab - R10, Depth = 2 ft Crawl Space - R15/19

- Blanket insulation in attic system was observed. In the interrupted areas the insulation has been compressed due to age, reducing its thermal efficiency. Consider adding more insulation in the interrupted areas for improved thermal efficiency.
- Moisture staining visible on attic insulation near bathroom vent termination point. Over time, insulation can develop mildew and mold growth. Moisture stained insulation should be replaced.



East Building Attic Insulation:



East Building Attic Insulation: STAINING ON INSULATION VISIBLE FROM BATHROOM VENTILATION

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com

05/16/2024 Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



East Building Attic Insulation:



East Building Attic Insulation: STAINING ON INSULATION



East Building Attic Insulation:



East Building Attic Insulation:



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



East Building Attic Insulation: MOISTURE STAINING IN INSULATION AROUND BATHROOM VENT

### NORTH BUILDING ATTIC INSULATION

	G	F	P	NI	NA
☑ Monitor Condition		V			

☑Blanket

☑ Signs of Moisture

#### Comments:

- Blanket insulation in attic system was observed. In the interrupted areas the insulation has been compressed due to age, reducing its thermal efficiency. Consider adding more insulation in the interrupted areas for improved thermal efficiency.
- Moisture staining visible on attic insulation near bathroom vent termination point. Over time, insulation can develop mildew and mold growth. Moisture stained insulation should be replaced.



North Building Attic Insulation:



North Building Attic Insulation: MOISTURE STAINING AROUND BATHROOM VENT

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



North Building Attic Insulation: MOISTURE STAINING INSULATION



North Building Attic Insulation:



North Building Attic Insulation:



North Building Attic Insulation:



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



North Building Attic Insulation:

### WEST BUILDING ATTIC INSULATION

☑ Monitor Condition

G	F	P	NI	NA
	V			

☑Blanket

☑ Signs of Moisture

#### Comments:

- Blanket insulation in attic system was observed. In the interrupted areas the insulation has been compressed due to age, reducing its thermal efficiency. Consider adding more insulation in the interrupted areas for improved thermal efficiency.
- Moisture staining visible on attic insulation near bathroom vent termination point. Over time, insulation can develop mildew and mold growth. Moisture stained insulation should be replaced.



West Building Attic Insulation:



West Building Attic Insulation:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



West Building Attic Insulation:



West Building Attic Insulation:

### Interior Foundation

Foundation Type **☑** Basement

		G	F	P	NI	NA
UNIT # 1 INTERIOR FOUNDATION	☑ Recommend Repairs			Ø		
☑ Efflorescence / Suspected Leak(s)	☐ General Deterioration ☐	Step Cra	acks			

#### Comments:

- Efflorescence along foundation wall. Efflorescence is a powdery deposit of salts which forms on the surface of bricks and mortar. It is usually caused by water intrusion.
- Bubbling and cracking paint typical of moisture build up.
- Grout and step cracking visible on the south wall of foundation.

Inspection Date: Inspector: Jay Heckart 05/16/2024

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 1 Interior Foundation:



Unit # 1 Interior Foundation: SIGNS OF MOISTURE / ACTIVE WATER



Unit # 1 Interior Foundation: GROUT LINE CRACKS AND PAINT BUBBLING



Unit # 1 Interior Foundation: MOISTURE AND PAST REPAIRS

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 1 Interior Foundation: EFFLORESCENCE



Unit # 1 Interior Foundation: MOISTURE LEVEL 96%



Unit # 1 Interior Foundation:



Unit # 1 Interior Foundation:

		G	F	P	NI	NA
UNIT # 2 INTERIOR FOUNDATION	☑ Monitor Condition		V			

#### ☑ Step Cracks

#### Comments:

• Cracks were observed in the foundation walls. These cracked areas did not have any evidence of water intrusion at time of this inspection. Water intrusion may develop after period of heavy rainfall or further deterioration.

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 2 Interior Foundation:



Unit # 2 Interior Foundation:



Unit # 2 Interior Foundation: SIGNS OF WATER INTRUSION



Unit # 2 Interior Foundation: GROUT CRACKS

### **UNIT #3 INTERIOR FOUNDATION**

☑ Recommend Repairs

G F P NI NA
□ □ ☑ □ □

☑ Efflorescence / Suspected Leak(s)

☑ General Deterioration

☑ Step Cracks

#### Comments:

- Foundation grout line cracks visible in foundation walls. Recommend that cracks are sealed and areas are monitored for further cracking and moisture.
- Foundation walls were painted and sealed in the back corner. This is usually a sign of previous water entry or cracking. Monitor area and talk with seller about repairs.
- Efflorescence on the concrete block walls. Efflorescence is a powdery deposit of salts which forms on the surface of bricks and mortar. It is usually caused by water intrusion. Monitor the basement for water intrusion.

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 3 Interior Foundation:



Unit # 3 Interior Foundation: GROUT LINE CRACKS



Unit # 3 Interior Foundation: PAST REPAIRS



Unit # 3 Interior Foundation:



Unit # 3 Interior Foundation:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**


### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

		G	F	P	NI	NA
UNIT # 4 INTERIOR FOUNDATION	☑ Monitor Condition		V			

☑ Step Cracks

#### Comments:

• Some grout cracking in foundation walls. No signs of water entry or moisture at time of inspection.

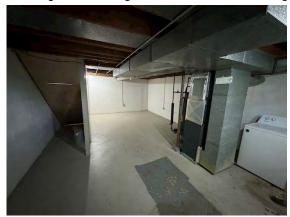

Unit # 4 Interior Foundation:



Unit # 4 Interior Foundation:



Unit # 4 Interior Foundation: GROUT CRACKS

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

		G	F	P	NI	NA
UNIT # 5 INTERIOR FOUNDATION	☑ Monitor Condition		V			


☑ Step Cracks

#### Comments:

• Settlement type grout cracks observed. Appeared typical at this time. Monitor regularly and evaluate/repair as required. No moisture or water entry at time of inspection.



Unit # 5 Interior Foundation:

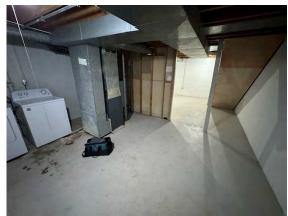

Unit # 5 Interior Foundation:



Unit # 5 Interior Foundation: GROUT CRACKS VISIBLE

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240


	G	F	P	NI	NA
UNIT # 6 INTERIOR FOUNDATION	Ø				

#### Comments:

• No major settlement or cracks were observed. Interior walls were plumb and in good condition.



Unit # 6 Interior Foundation:

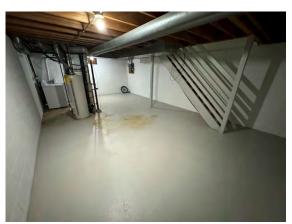

Unit # 6 Interior Foundation:

		G	F	P	NI	NA
UNIT # 7 INTERIOR FOUNDATION	☑ Monitor Condition		Ø			

☑ Grout Cracks

#### Comments:

• Foundation blocks have cracks along the grout lines. Monitor condition and seal as needed to prevent moisture entry.



Unit # 7 Interior Foundation:



Unit # 7 Interior Foundation:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 7 Interior Foundation:

### **UNIT #8 INTERIOR FOUNDATION**

☑ Monitor Condition

G F P NI NA
□ ☑ □ □ □

 ${\color{red} \,\boxtimes\,} Efflorescence \,/\,\, Suspected\,\, Leak(s)$ 


☑ Past Repairs

#### Comments:

• Previous repairs noted. Monitor regularly and evaluate/repair as required. Dry at time of inspection.



Unit # 8 Interior Foundation:

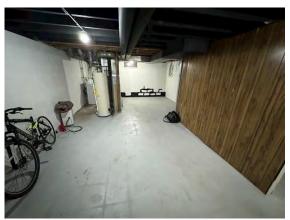

Unit # 8 Interior Foundation:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 8 Interior Foundation:



Unit # 8 Interior Foundation: SIGNS OF PREVIOUS MOISTURE AND EFFLORESCENCE


### **UNIT #9 INTERIOR FOUNDATION**

☑ Monitor Condition

G	F	P	NI	NA
	$\overline{\mathbf{A}}$			

#### Comments:

• Rusted outlet present at time of inspection. Advise that outlet is repaired or replaced for electrical safety.

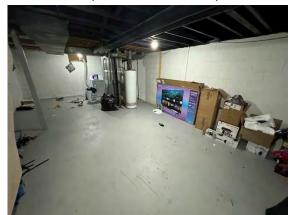

Unit # 9 Interior Foundation:



Unit # 9 Interior Foundation:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 9 Interior Foundation:

### **UNIT # 10 INTERIOR FOUNDATION**

G	F	P	NI	NA
Ø				

#### Comments:

• No excessive settlement or cracks were observed. Interior walls were plumb and in good condition.



Unit # 10 Interior Foundation:



Unit # 10 Interior Foundation:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**


### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

		G	F	P	NI	NA
UNIT # 11 INTERIOR FOUNDATION	☑ Monitor Condition		Ø			


☑ Past Repairs

#### Comments:

• Previous repairs noted. Monitor regularly and evaluate/repair as required. Dry at time of inspection.

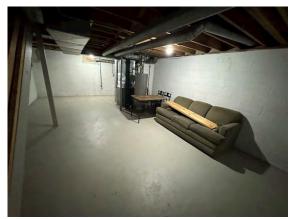

Unit # 11 Interior Foundation:

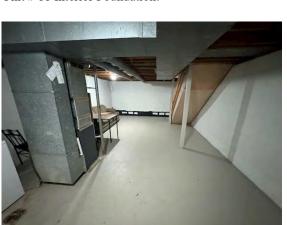

Unit # 11 Interior Foundation:



Unit # 11 Interior Foundation:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

		(	j	F	P	NI	NA
UNIT # 12 INTERIOR FOUNDATION	☑ Recommend Repairs				$\overline{\mathbf{V}}$		
☑ Efflorescence / Suspected Leak(s)	☑ Step Cracks	<b></b> Past	Rep	airs			

#### Comments:

- Past repairs and sealing of concrete foundation blocks. Monitor areas over time as additional repairs may be necessary.
- Efflorescence on the concrete block walls. Efflorescence is a powdery deposit of salts which forms on the surface of bricks and mortar. It is usually caused by water intrusion.



Unit # 12 Interior Foundation:



Unit # 12 Interior Foundation: EFFLORESCENCE



Unit # 12 Interior Foundation:



Unit # 12 Interior Foundation:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 12 Interior Foundation: EFFLORESCENCE



Unit # 12 Interior Foundation:

### **UNIT # 13 INTERIOR FOUNDATION**

☑ Monitor Condition

G	F	P	NI	NA
	Ø			

☑ Past Repairs

#### Comments:

• Foundation blocks were sealed and repaired. Monitor condition over time as additional repairs may be required.



Unit # 13 Interior Foundation:



Unit # 13 Interior Foundation:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 13 Interior Foundation:

### **UNIT # 14 INTERIOR FOUNDATION**

☑ Recommend Repairs

G	F	P	NI	NA
		V		

 ${\color{red} \,\boxtimes\,} Efflorescence \,/\,\, Suspected\,\, Leak(s)$ 

☑ Past Repairs

#### Comments:

- Efflorescence along foundation wall. Efflorescence is a powdery deposit of salts which forms on the surface of blocks and mortar. It is usually caused by water intrusion.
- Previous repairs visible on the foundation walls.



Unit # 14 Interior Foundation:



Unit # 14 Interior Foundation:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



## **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 14 Interior Foundation:



Unit # 14 Interior Foundation: EFFLORESCENCE

### **UNIT # 15 INTERIOR FOUNDATION**

☑ Recommend Repairs

G	F	P	NI	NA
		V		

 $\square$  Efflorescence / Suspected Leak(s)

☑ Past Repairs

#### Comments:

- Efflorescence on the concrete block walls. Efflorescence is a powdery deposit of salts which forms on the surface of bricks and mortar. It is usually caused by water intrusion.
- Past repairs visible. Monitor condition as future repairs may be required.



Unit # 15 Interior Foundation:



Unit # 15 Interior Foundation: EFFLORESCENCE

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 15 Interior Foundation:



Unit # 15 Interior Foundation:

### UNIT # 1 FLOOR / SLAB

Recommend Repairs

G	F	P	NI	NA
		V		

☑ Concrete

☑Moisture

**☑** Staining

#### Comments:

• Stains and visible water on the interior surfaces of the concrete floor slab appear to be the result of active moisture intrusion. The moisture meter showed elevated levels of moisture present in the slab at the time of the inspection. Moisture intrusion could damage materials and encourage the growth of microbes such as mold. The source of moisture should be located and corrected to avoid future moisture intrusion.



Unit # 1 Floor / Slab:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

	G	F	P	NI	NA
UNIT # 2 FLOOR / SLAB	Ø				

**☑**Concrete

#### Comments:

All visible concrete flooring was in good condition at time of inspection with no major defects noted.



Unit # 2 Floor / Slab:

### **UNIT #3 FLOOR / SLAB**

G F P NI NA
☑ □ □ □ □

**☑**Concrete

#### Comments:

• All visible concrete flooring was in good condition at time of inspection with no major defects noted.



Unit # 3 Floor / Slab:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

	G	F	P	NI	NA
UNIT # 4 FLOOR / SLAB	Ø				

**☑** Concrete

#### Comments:

• Concrete slab had no cracks and appeared acceptable at time of inspection.



Unit # 4 Floor / Slab:

	G	F	P NI NA	NA	
UNIT # 5 FLOOR / SLAB	Ø				

**☑**Concrete

#### Comments:

• All visible concrete flooring was in good condition at time of inspection with no major defects noted.

	G	F	P	NI	NA
UNIT # 6 FLOOR / SLAB	$\square$				
☑ Concrete	-				

#### Comments:

• General deterioration of flooring present but overall was in good condition for age of structure.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com

05/16/2024 Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 6 Floor / Slab:

### **UNIT #7 FLOOR / SLAB**

G F P NI NA
☑ □ □ □ □

**☑** Concrete

#### Comments:

• Concrete slab had no cracks and appeared acceptable at time of inspection.



Unit # 7 Floor / Slab:



Unit # 7 Floor / Slab:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

	G	F	P	NI	NA
UNIT # 8 FLOOR / SLAB	Ø				

**☑**Concrete

#### Comments:

• Concrete slab had no cracks and appeared acceptable at time of inspection.

			G	F	P	NI	NA
UNIT # 9 FLOOR / SLAB		Recommend Repairs			$\overline{\mathbf{A}}$		
☑ Concrete	✓Moisture						_

#### Comments:

• Basement had signs of active moisture at time of inspection. Source of water was unknown and should be monitored. Further evaluation advised.



Unit # 9 Floor / Slab: ACTIVE WATER / MOISTURE

	G	F	P	NI	NA	
UNIT # 10 FLOOR / SLAB	☑					

**☑**Concrete

#### Comments:

• Concrete slab had no cracks and appeared acceptable at time of inspection.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 10 Floor / Slab:


### **UNIT # 11 FLOOR / SLAB**

G F P NI NA
☑ □ □ □ □

**☑** Concrete

### Comments:

• All visible concrete flooring was in good condition at time of inspection with no major defects noted.

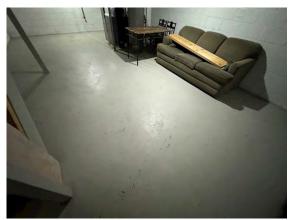

Unit # 11 Floor / Slab:



Unit # 11 Floor / Slab:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

	G	F	P	NI	NA
UNIT # 12 FLOOR / SLAB	Ø				

**☑** Concrete

#### Comments:

All visible concrete flooring was in good condition at time of inspection with no major defects noted.



Unit # 12 Floor / Slab:

	G	F	P	NI	NA
UNIT # 13 FLOOR / SLAB	V				

**☑**Concrete

#### Comments:

• Concrete slab had no cracks and appeared acceptable at time of inspection.



Unit # 13 Floor / Slab:



Unit # 13 Floor / Slab:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**


### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

		G	F	P	NI	NA
UNIT # 14 FLOOR / SLAB	☑ Recommend Repairs			V		

**☑** Concrete

#### Comments:

• Active moisture / water visible on the concrete of the basement. No visible source of water. Recommend further evaluation.

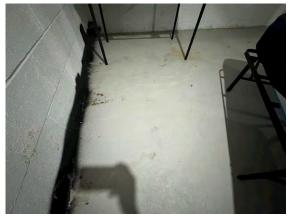

Unit # 14 Floor / Slab:



Unit # 14 Floor / Slab:

	G	F	P	NI	NA	
UNIT # 15 FLOOR / SLAB	$\overline{\mathbf{A}}$					

**☑**Concrete

#### Comments:

• Concrete slab had no cracks and appeared acceptable at time of inspection.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com
05/16/2024 Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 15 Floor / Slab:



Unit # 15 Floor / Slab:

### SUMP/SUMP PUMPS SYSTEMS

☑ No Pump Present

☑ Recommend Repairs

G	F	P	NI	NA
		V		

**☑**Covered

☑ Discharging Next to Foundation

#### Comments:

- Sump pump pit located in unit # 4. Pit was covered buy no pump installed. Pit was dry at time of inspection.
- Sump pump pit located in unit # 5. Pit was covered and dryer installed over top.
- Unit #10 Sump pump discharge pipe was hanging and causing a low point that could trap water or cause clogging. Recommend that discharge pipe is properly installed.
- Unit #11 Sump pump was draining directly into sewer system via the laundry drain. This is no longer allowed by most municipalities.



Sump/Sump Pumps Systems:



Sump/Sump Pumps Systems:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240




Sump/Sump Pumps Systems:



Sump/Sump Pumps Systems: SUMP PUMP DISCHARGE PIPE IN UNIT # 10



Sump/Sump Pumps Systems: UNIT #9

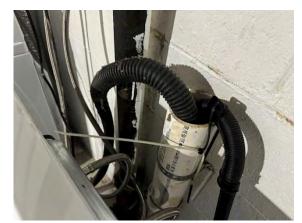

Sump/Sump Pumps Systems: UNIT 11 SUMP PUMP DISCHARGING INTO LAUNDRY

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Sump/Sump Pumps Systems:

### **UNIT #1 ELECTRICAL**

☑ Recommend Repairs

SERVICE SIZE (Main Panel)					
☑ Brand: General Electric ☑ Main Disconnect Location: Basement	<b>☑</b> 100 AMP	☑ 100 AMP			
	G	F	P	NI	NA
SERVICE Overhead	Ø				
ENTRANCE CABLE	Ø				
PANEL Breaker(s)			Ø		
BRANCH CIRCUITS	Ø				
BONDING / GROUNDING	Ø				

#### Comments:

- Receptacles and switches were tested on a random basis.
- Screws used to secure the electrical panel cover were missing. Recommend installing the proper screws (non-pointed) to ensure proper electrical safety.
- Breaker #s 2 & 9 were double tapped. Double tapping is when 2 or more conductors (wires) are wired into a lug intended for 1 conductor. This can lead to arcing in turn damage or fire occurring in panel. Recommend repairs or installation of appropriate breakers to alleviate double tapping. (City inspector will typically allow the box outlet or low voltage transformer to be double tapped).

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

## Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240




Unit #1 Electrical: MISSING PANEL SCREWS



Unit #1 Electrical: DOUBLE TAPPED BREAKER



Unit #1 Electrical:

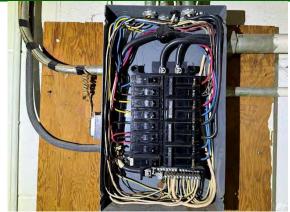

Unit #1 Electrical:



Unit #1 Electrical: DOUBLE TAPPED BREAKER

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

### **UNIT #2 ELECTRICAL**

#### SERVICE SIZE (Main Panel)

SEIT ( TOE SIEE ( um I umoi)						
☑Brand: Eaton	☑ Main Disconnect Location: Basement ☑	☑ 100 AMP				
		G	F	P	NI	NA
SERVICE Underground		$\square$				
ENTRANCE CABLE  Aluminum		Ø				
PANEL Breaker(s)		Ø				
BRANCH CIRCUITS		Ø				
BONDING/GROUNDING		$\square$				

#### Comments:

• Electrical panel and its components were in acceptable condition at the time of the inspection. No tampering of service panel was noted and service panel breakers were installed correctly. Receptacles and switches were tested on a random basis.



Unit #2 Electrical:




Unit #2 Electrical:

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

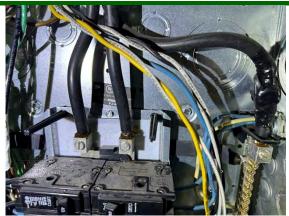





Unit #2 Electrical:

### **UNIT #3 ELECTRICAL**

☑ Recommend Repairs

### **SERVICE SIZE (Main Panel)**

()						
☑ Brand: General Electric E	☑ Main Disconnect Location: Basement	☑ 100 AM	00 AMP			
		G	F	P	NI	NA
SERVICE Underground		Ø				
ENTRANCE CABLE		Ø				
PANEL						
BRANCH CIRCUITS		Ø				
BONDING/GROUNDING		Ø				

#### Comments:

- Receptacles and switches were tested on a random basis.
- Breaker #s 2 & 4 were double tapped. Double tapping is when 2 or more conductors(wires) are wired into a lug intended for 1 conductor. This can lead to arcing in turn damage or fire occurring in panel. Recommend repairs or installation of appropriate breakers to alleviate double tapping. (City inspector will typically allow the box outlet or low voltage transformer to be double tapped)

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

## Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit #3 Electrical:



Unit #3 Electrical:



Unit #3 Electrical:



Unit #3 Electrical:



Unit #3 Electrical:



Unit #3 Electrical: DOUBLE TAPPED BREAKER

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### **UNIT #4 ELECTRICAL** ☑ Monitor Condition **SERVICE SIZE (Main Panel)** ☑ Main Disconnect Location: Basement ☑Brand: General Electric **☑** 100 AMP G P NI NA SERVICE Underground $\overline{\mathbf{V}}$ ENTRANCE CABLE Aluminum $\overline{\mathbf{V}}$ PANEL ☑Breaker(s) $\checkmark$ BRANCH CIRCUITS Copper $\overline{\mathbf{V}}$ BONDING/GROUNDING

#### Comments:

- Receptacles and switches were tested on a random basis.
- Screws used to secure the electrical panel cover were missing. Recommend installing the proper screws (non-pointed) to ensure proper electrical safety.
- Breaker #2 was double tapped. (City inspector will typically allow the box outlet or low voltage transformer to be double tapped)








Unit #4 Electrical:

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

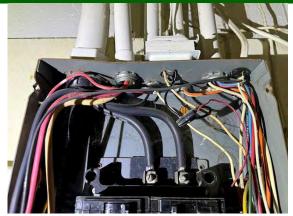

Unit #4 Electrical:



Unit #4 Electrical: LOW VOLTAGE WIRE DOUBLE TAP

#### **UNIT #5 ELECTRICAL**

☑ Recommend Repairs

SERVICE SIZE (Main Panel)

SERVICE SIZE (Main I anei)							
☑ Brand: General Electric	☑ Main Disconnect Location: Basement	<b>☑</b> 1(	☑ 100 AMP				
			G	F	P	NI	NA
SERVICE Underground			Ø				
ENTRANCE CABLE  Aluminum			Ø				
PANEL  Breaker(s)					Ø		
BRANCH CIRCUITS   ☐ Copper			Ø				
BONDING/GROUNDING			Ø				

#### Comments:

- Breaker #8 was double tapped. This can lead to arcing in turn damage or fire occurring in panel. Recommend repairs or installation of appropriate breakers to alleviate double tapping. (City inspector will typically allow the box outlet or low voltage transformer to be double tapped)
- Panel screws missing front cover.

Inspection Date: Inspector: Jay Heckart

05/16/2024 Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit #5 Electrical:



Unit #5 Electrical:



Unit #5 Electrical:



Unit #5 Electrical: DOUBLE TAPPED BREAKER

### **UNIT #6 ELECTRICAL**

☑ Monitor Condition

### **SERVICE SIZE (Main Panel)**

☑ Brand: General Electric ☑ Main Disconnect Location: Basement ☑ 100 AMP

	G	l F	P	NI	NA
SERVICE Underground	Ø				
ENTRANCE CABLE Aluminum	Ø				
PANEL Decaker(s)		Ø			
BRANCH CIRCUITS	Ø				
BONDING/GROUNDING	Ø				

#### Comments:

Inspection Date: Inspector: Jay Heckart

05/16/2024 Inspector Phone: (563) 676-7400




# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

• Screws used to secure the electrical panel cover were missing.



Unit #6 Electrical:

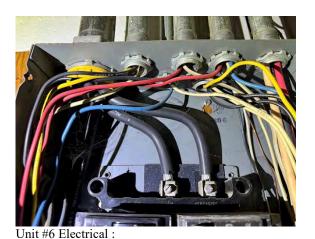

Unit #6 Electrical:



Unit #6 Electrical:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### **UNIT #7 ELECTRICAL** ☑ Recommend Repairs **SERVICE SIZE (Main Panel)** ☑Brand: General Electric ☑ Main Disconnect Location: Basement **☑** 100 AMP G NI NA SERVICE Underground $\overline{\mathbf{Q}}$ ENTRANCE CABLE Aluminum $\overline{\mathbf{V}}$ Breaker(s) PANEL $\checkmark$ BRANCH CIRCUITS Copper $\overline{\mathbf{V}}$ BONDING/GROUNDING

#### Comments:

Breakers #6&9 were double tapped. Further review and repair by qualified electrician advised.





Unit #7 Electrical:

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com Inspector Phone: (563) 676-7400

05/16/2024




# **National Property Inspections**

## Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit #7 Electrical:

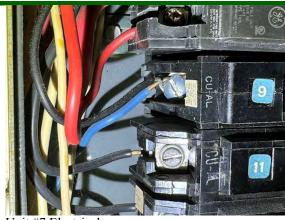

Unit #7 Electrical:



Unit #7 Electrical:

UNIT #8 ELECTRICAL	<ul><li>☑ Monitor Condition</li><li>☑ Recommend Repairs</li></ul>				
SERVICE SIZE (Main Panel)					
☑ Brand: General Electric ☑ Main Disconnect Location: Basement	☑ 100 A	MP			
☑ Improper Splices ☑ Rust / Corrosion ☑ Missin	ng Panel Screws				
	G	F	P	NI	NA
SERVICE Underground	☑				
ENTRANCE CABLE Aluminum	✓				
PANEL Breaker(s)			Ø		
BRANCH CIRCUITS ☑ Copper		Ø			
BONDING/GROUNDING	☑				

Inspection Date: Inspector: Jay Heckart

05/16/2024 Inspector Phone: (563) 676-7400



# **National Property Inspections**


### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### Comments:

- Screws used to secure the electrical panel cover were missing.
- Corrosion noted on breakers. This may cause the breakers to not perform properly and could be a electrical safety problem. Further review by qualified electrician advised.
- There were wire splices in the panel. Advise that wire nuts are used for proper protection.




Unit #8 Electrical:

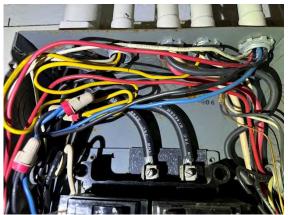

Unit #8 Electrical:



Unit #8 Electrical:

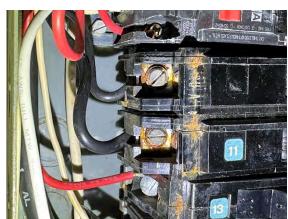

Unit #8 Electrical: RUST BUILD UP ON BREAKERS

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



#### Unit #8 Electrical: SPLICING WITHIN THE PANEI

UNIT #9 ELECTRICA	L	☑ Recommend Repairs					
<b>SERVICE SIZE (Main Panel)</b>	)						
☑Brand: General Electric	☑ Main Disconnect Location: Basement	<b></b>	00 AM	P			
☑ Double Tapping	☑ Missing Panel Screws						
			G	F	P	NI	NA
SERVICE Underground			Ø				
ENTRANCE CABLE Aluminum			Ø				
PANEL Breaker(s)					Ø		
BRANCH CIRCUITS			Ø				
BONDING/GROUNDING			Ø				

### Comments:

• BREAKER # 8 was double tapped at time of inspection. Further review by electrician advised.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

## Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit #9 Electrical:



Unit #9 Electrical:



Unit #9 Electrical:



Unit #9 Electrical: DOUBLE TAPPED BREAKER

Email: jay.heckart@npiinspect.com

UNIT #10 ELECTRICA	AL	☑ Recommend Repairs					
SERVICE SIZE (Main Panel							
☑Brand: General Electric	☑ Main Disconnect Location: Basement	<b>I</b> 1	00 AM	P			
☑ Double Tapping	☑ Rust / Corrosion						
			G	F	P	NI	NA
SERVICE  Underground			Ø				
ENTRANCE CABLE Aluminum			Ø				
PANEL Breaker(s)					Ø		
BRANCH CIRCUITS			V				
BONDING/GROUNDING			V				

Inspection Date: Inspector: Jay Heckart



# **National Property Inspections**


### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

### Comments:

- Corrosion noted on breakers. This may cause the breakers to not perform properly and could be a electrical safety problem. Further review by qualified electrician advised.
- Double tapped breaker present in the panel.



Unit #10 Electrical:

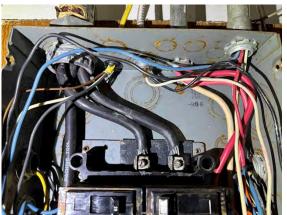

Unit #10 Electrical:



Unit #10 Electrical:



Unit #10 Electrical: RUST BUILD UP ON BREAKERS

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240







Unit #10 Electrical:

### **UNIT #11 ELECTRICAL**

☑ Monitor Condition

### **SERVICE SIZE (Main Panel)**

☑ Brand: General Electric ☑	☑ Main Disconnect Location: Basement	☑ 100 AM	00 AMP			
		G	F	P	NI	NA
SERVICE  Underground		Ø				
ENTRANCE CABLE Aluminum		Ø				
PANEL Breaker(s)			Ø			
BRANCH CIRCUITS		Ø				
BONDING/GROUNDING		Ø				

### Comments:

• Breaker double tapped. (City inspector will typically allow the box outlet or low voltage transformer to be double tapped)

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

## Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit #11 Electrical:





Unit #11 Electrical:



Unit #11 Electrical:



Unit #11 Electrical: DOUBLE TAPPED BREAKER

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

UNIT #12 ELECTRICA	L	<ul><li>☑ Monitor Condition</li><li>☑ Recommend Repairs</li></ul>					
SERVICE SIZE (Main Panel)							
☑Brand: General Electric	☑ Main Disconnect Location: Basement	$\square_1$	00 AM	P			
☑ Missing Panel Screws							
			G	F	P	NI	NA
SERVICE Underground			Ø				
ENTRANCE CABLE Aluminum			V				
PANEL Breaker(s)				Ø			
BRANCH CIRCUITS					V		
BONDING/GROUNDING							

#### Comments:

- Screws used to secure the electrical panel cover were missing. Recommend installing the proper screws (non-pointed) to ensure proper electrical safety.
- Burn / scorch marks visible on outlet next to panel. Further review and replacement of outlet by a qualified electrician advised.
- Splicing of wires within the panel.








Unit #12 Electrical:

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

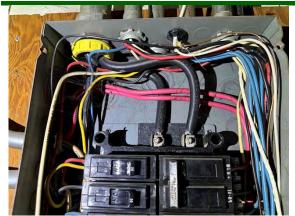

Unit #12 Electrical:



Unit #12 Electrical: SPLICED WIRING



Unit #12 Electrical: SCORCHED AND DAMAGED OUTLET

### **UNIT #13 ELECTRICAL**

☑ Monitor Condition

**SERVICE SIZE (Main Panel)** 

☑ Brand: General Electric ☑ Main Disconnect Location: Basement ☑ 100 AMP ☐ G

	G	F	P	NI	NA
SERVICE Underground	Ø				
ENTRANCE CABLE	Ø				
PANEL Breaker(s)		Ø			
BRANCH CIRCUITS	Ø				
BONDING/GROUNDING	Ø				

Inspection Date: Inspector: Jay Heckart

05/16/2024 Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

### Comments:

- Screws used to secure the electrical panel cover were missing. Recommend installing the proper screws (non-pointed) to ensure proper electrical safety.
- Breaker double tapped. (City inspector will typically allow the box outlet or low voltage transformer to be double tapped)




Unit #13 Electrical:



Unit #13 Electrical:



Unit #13 Electrical:

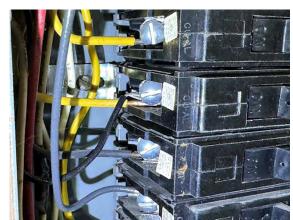

Unit #13 Electrical:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit #13 Electrical:

### **UNIT #14 ELECTRICAL**

☑ Recommend Repairs

### **SERVICE SIZE (Main Panel)**

SERVICE SIZE (Main I and)							
☑Brand: General Electric	☑ Main Disconnect Location: Basement	<b>☑</b> 100	1100 AMP				
			G	F	P	NI	NA
SERVICE Underground			Ø				
ENTRANCE CABLE  Aluminum			Ø				
PANEL Breaker(s)					V		
BRANCH CIRCUITS			Ø				
BONDING/GROUNDING			Ø				

#### Comments:

- The screws used to hold the electric panel cover on were the wrong type (sharp points) and have the potential to pierce an electrical cable or wire.
- Double tapped breaker present in the panel. Further review by electrician advised.

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

## Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit #14 Electrical:



Unit #14 Electrical:



Unit #14 Electrical:



Unit #14 Electrical:



Unit #14 Electrical:



Unit #14 Electrical:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

UNIT #15 ELECTRICA	L	☑ Recommend Repa	irs				
☑ Double Tapping	☑Missing Panel Screws	☑ Improper Screws					
<b>SERVICE SIZE (Main Panel)</b>							
☑ Brand: General Electric	☑ Main Disconnect Location: Base	ement	☑ 100 A	MР			
			G	F	P	NI	NA
SERVICE Underground			✓				
ENTRANCE CABLE Aluminum			✓				
PANEL Breaker(s)					Ø		
BRANCH CIRCUITS			V				
BONDING/GROUNDING			✓				

#### Comments:

- Screws used to secure the electrical panel cover were missing.
- The screws used to hold the electric panel cover on were the wrong type (sharp points) and have the potential to pierce an electrical cable or wire.
- Breaker double tapped. (City inspector will typically allow the box outlet or low voltage transformer to be double tapped)



Unit #15 Electrical:



Unit #15 Electrical: POINTED SCREWS

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com




# **National Property Inspections**

## Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit #15 Electrical:

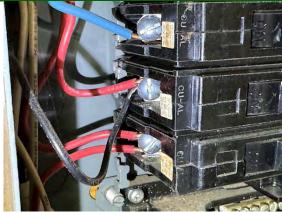

Unit #15 Electrical: DOUBLE TAPPED BREAKER



Unit #15 Electrical:



Unit #15 Electrical:

### **UNIT # 1 PLUMBING**

Water Service

☑ Water Public

☑ Shut Off Location: Basement

Sewage Service

☑ Sewage Public

Fuel Service

☑ Shut Off Location: Individual Units

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

		G	F	P	NI	NA
SUPPLY	☑Copper ☑PEX	Ø				
DRAINS	☑ Cast Iron ☑ Copper ☑ PVC	Ø				
VENTS	☑ Cast Iron ☑ Copper ☑ PVC	Ø				

#### Comments:

• No defects were found pertaining to the main plumbing system.

Main utility line, septic systems and gray water systems are excluded from this Inspection.



Unit # 1 Plumbing:

### **UNIT # 2 PLUMBING**

Water Service

☑ Water Public ☑ Shut Off Location: Basement

Sewage Service

☑ Sewage Public

Fuel Service

☑ Shut Off Location: Individual Units

		G	F	P	NI	NA
SUPPLY	☑ Copper ☑ PEX	Ø				
DRAINS	☑ Cast Iron ☑ Copper ☑ PVC	Ø				
VENTS	☑ Cast Iron ☑ Copper ☑ PVC	Ø				

#### Comments:

• No defects were found pertaining to the main plumbing system.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240







Unit # 2 Plumbing:

☑ Recommend Repairs

### **UNIT # 3 PLUMBING**

Water Service

☑ Water Public

☑ Shut Off Location: Basement

Sewage Service

☑ Sewage Public

Fuel Service

☑ Shut Off Location: Individual Units

☑CSST No Ground

		G	F	P	NI	NA
SUPPLY	☑Copper ☑CSST					
DRAINS	☑ Cast Iron ☑ PVC	Ø				
VENTS	☑ Cast Iron ☑ PVC	Ø				

#### Comments:

- No defects were found pertaining to the main water plumbing system.
- Issues have risen in regards to CSST (corrugated stainless steel tubing) and lighting strikes on or near homes. It is now required that this gas line plumbing be grounded. CSST tubing installed on water heater gas line.

Inspection Date: Inspector: Jay Heckart

05/16/2024 Inspector Phone: (563) 676-7400



# **National Property Inspections**

## Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 3 Plumbing:



Unit # 3 Plumbing: CSST TUBING

### **UNIT # 4 PLUMBING**

**Water Service** 

☑ Water Public ☑ Shut Off Location: Basement

Sewage Service

☑ Sewage Public

Fuel Service

☑ Shut Off Location: Individual Units

		G	F	P	NI	NA
SUPPLY	☑ Copper ☑ PEX	V				
DRAINS	☑ Cast Iron ☑ PVC	V				
VENTS	☑ Cast Iron ☑ PVC	Ø				

### Comments:

• No defects were found pertaining to the main plumbing system.

Inspection Date: Inspector: Jay Heckart

05/16/2024 Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 4 Plumbing:



Unit # 4 Plumbing:



Unit # 4 Plumbing:



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

UNIT # 5 PLUMBING		G	F	P	NI	NA
SUPPLY	☑ Copper ☑ PEX	Ø				
DRAINS	☑ Cast Iron ☑ PVC	Ø				
VENTS	☑ Cast Iron ☑ PVC	Ø				

#### Comments:

• No defects were found pertaining to the main plumbing system.



Unit # 5 Plumbing:



Unit # 5 Plumbing:

### **UNIT # 6 PLUMBING**

Water Service

☑ Water Public ☑ Shut Off Location: Basement

Sewage Service

☑ Sewage Public

Fuel Service

☑ Shut Off Location: Individual Units

		G	F	P	NI	NA
SUPPLY	<b>☑</b> Copper	Ø				
DRAINS	☑ Cast Iron ☑ PVC	Ø				
VENTS	☑ Cast Iron ☑ PVC	Ø				

#### Comments:

• No defects were found pertaining to the main plumbing system.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

## Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 6 Plumbing:



Unit # 6 Plumbing:



Unit # 6 Plumbing:



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### **UNIT #7 PLUMBING**

**Water Service** 

☑ Water Public ☑ Shut Off Location: Basement

Sewage Service

☑ Sewage Public

Fuel Service

☑ Shut Off Location: Individual Units

		G	F	P	NI	NA
SUPPLY	<b>☑</b> Copper	Ø				
DRAINS	☑ Cast Iron ☑ Copper ☑ PVC	Ø				
VENTS	☑ Cast Iron ☑ PVC	Ø				

#### Comments:

• No defects were found pertaining to the main plumbing system.



Unit # 7 Plumbing:



Unit # 7 Plumbing:

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



**UNIT #8 PLUMBING** 

### TwentyOne Enterprises, Inc. DBA

# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

☑ Recommend Repairs

Water Sei	vice					
☑ Water Pu	blic ☑ Shut Off Location: Basement					
Sewage So	rvice					
☑ Sewage	Public					
Fuel Serv	ce					
☑Shut Off	Location: Individual Units					
☑CSST No	Ground					
		G	F	P	NI	NA
SUPPLY	☑Copper ☑CSST			Ø		
DRAINS	☑Cast Iron ☑Copper ☑PVC	Ø				
VENTS	Cast Iron PPVC	N		П		

#### Comments:

• It is now required that CSST gas line plumbing be grounded.



Unit # 8 Plumbing:



Unit # 8 Plumbing : CSST INSTALLED AT WATER HEATER

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com 05/16/2024 Inspector Phone: (563) 676-7400

05/16/2024 ©1996-2024



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 8 Plumbing:



Unit # 8 Plumbing:

#### **UNIT #9 PLUMBING**

**Water Service** 

☑ Water Public ☑ Shut Off Location: Basement

Sewage Service

☑ Sewage Public

Fuel Service

☑ Shut Off Location: Individual Units

		G	F	P	NI	NA
SUPPLY	☑ Copper	Ø				
DRAINS	☑ Cast Iron ☑ PVC	V				
VENTS	☑ Cast Iron ☑ PVC	Ø				

#### Comments:

• No defects were found pertaining to the main plumbing system.

Inspection Date: Inspector: Jay Heckart


05/16/2024 Inspector Phone: (563) 676-7400

Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

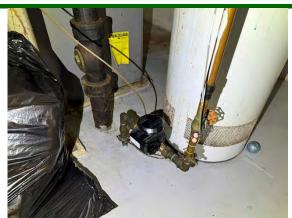

Unit # 9 Plumbing:



Unit # 9 Plumbing:

#### **UNIT # 10 PLUMBING**

**Water Service** 

☑ Water Public ☑ Shut Off Location: Basement

Sewage Service

☑ Sewage Public

Fuel Service

☑ Shut Off Location: Individual Units

		G	F	P	NI	NA
SUPPLY	<b>☑</b> Copper	V				
DRAINS	☑ Cast Iron ☑ PVC	V				
VENTS	☑ Cast Iron ☑ PVC	Ø				

#### Comments:

• No defects were found pertaining to the main plumbing system.

Inspection Date: Inspector: Jay Heckart



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 10 Plumbing:



Unit # 10 Plumbing:

#### **UNIT # 11 PLUMBING**

**Water Service** 

☑ Water Public ☑ Shut Off Location: Basement

**Sewage Service** ☑ Sewage Public **Fuel Service** 

☑ Shut Off Location: Individual Units

		G	F	P	NI	NA
SUPPLY	<b>☑</b> Copper					
DRAINS	☑ Cast Iron ☑ PVC	V				
VENTS	☑ Cast Iron ☑ PVC	Ø				

#### Comments:

• No defects were found pertaining to the main plumbing system.

Inspection Date: Inspector: Jay Heckart


Inspector Phone: (563) 676-7400 05/16/2024

Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

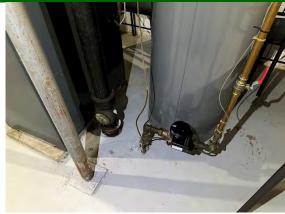

Unit # 11 Plumbing:



Unit # 11 Plumbing:



Unit # 11 Plumbing:



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### **UNIT # 12 PLUMBING**

**Water Service** 

☑ Water Public ☑ Shut Off Location: Basement

Sewage Service

☑ Sewage Public

Fuel Service

☑ Shut Off Location: Individual Units

		G	F	P	NI	NA
SUPPLY	☑ Copper	Ø				
DRAINS	☑ Cast Iron ☑ PVC	Ø				
VENTS	☑ Cast Iron ☑ PVC	Ø				

#### Comments:

• No defects were found pertaining to the main plumbing system.



Unit # 12 Plumbing:



Unit # 12 Plumbing:

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 12 Plumbing:



Unit # 12 Plumbing:

#### **UNIT # 13 PLUMBING**

**Water Service** 

☑ Water Public ☑ Shut Off Location: Basement

**Sewage Service** ☑ Sewage Public **Fuel Service** 

☑ Shut Off Location: Individual Units

		G	F	P	NI	NA
SUPPLY	<b>☑</b> Copper					
DRAINS	☑ Cast Iron ☑ PVC	V				
VENTS	☑ Cast Iron ☑ PVC	Ø				

#### Comments:

• No defects were found pertaining to the main plumbing system.

Inspection Date: Inspector: Jay Heckart 05/16/2024


Inspector Phone: (563) 676-7400

Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

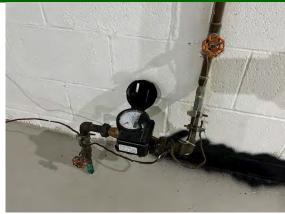

Unit # 13 Plumbing:



Unit # 13 Plumbing:



Unit # 13 Plumbing:



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### **UNIT # 14 PLUMBING**

**Water Service** 

☑ Water Public ☑ Shut Off Location: Basement

Sewage Service

☑ Sewage Public

Fuel Service

☑ Shut Off Location: Individual Units

		G	F	P	NI	NA
SUPPLY	☑ Copper	Ø				
DRAINS	☑ Cast Iron ☑ PVC	Ø				
VENTS	☑ Cast Iron ☑ PVC	Ø				

#### Comments:



Unit # 14 Plumbing:



Unit # 14 Plumbing:

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 14 Plumbing:

#### **UNIT # 15 PLUMBING**

**Water Service** 

☑ Water Public ☑ Shut Off Location: Basement

Sewage Service

☑ Sewage Public

Fuel Service

☑ Shut Off Location: Individual Units

		G	F	P	NI	NA
SUPPLY	<b>☑</b> Copper	Ø				
DRAINS	☑ Cast Iron ☑ PVC	V				
VENTS	☑ Cast Iron ☑ PVC	Ø				

#### Comments:

• No defects were found pertaining to the main plumbing system.

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400

Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 15 Plumbing:

### **UNIT # 1 WATER HEATER**

Brand: AO Smith Model: GCRL 40 400 Size: 40 Gallon(s) Age: 9 Year(s)
Design Life: 10-12 Year(s) SerialNo: 1523A030783

Design Life: 10-12 Year(s) SerialNo: 1523A030783

☑ Gas ☑ At or Near Design Life

#### Comments:

- The operation and installation of the water heater appeared to be satisfactory at time of inspection. Always refer to manufactures' specifications before doing any maintenance on your water heater.
- Recommend the water heater be flushed at least once a year to reduce sedimentation and maximize efficiency.



Unit # 1 Water Heater:



Unit # 1 Water Heater:

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com

05/16/2024 Inspector Phone: (563) 676-7400

ΝI

 $\overline{\checkmark}$ 

NA



## **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 1 Water Heater:



Age: 12 Year(s)

Unit # 1 Water Heater:

Size: 40 Gallons

☑ Recommend Repairs

#### **UNIT # 2 WATER HEATER**

Brand: Richmond Model: RMLN0512430282

Design Life: 10-12 Year(s) SerialNo: 6G40-36F1

☐ Gas ☐ Beyond Design Life ☐ Faulty Flue Connection

Comments:

- Most water heaters have a life span of ten to twelve years. Unit was functional, but was rated marginal due to its age. Ultimately, you should consider budgeting for replacement of the hot water heater in the foreseeable future.
- There should be a minimum of 12" of vertical rise between the draft hood and the first elbow. This allows for proper ventilation of the water heater gases. Further review by a plumber or HVAC tech advised.



Unit # 2 Water Heater:



Unit # 2 Water Heater: LESS THAN 12" OF RISE

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com

05/16/2024 Inspector Phone: (563) 676-7400


ΝI

NA



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

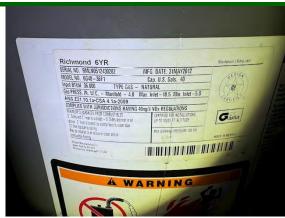

Unit # 2 Water Heater:

#### **UNIT #3 WATER HEATER**

Brand: AO Smith Model: GCR-40 400 Size: 40 Gallons Age: 3 Year(s)

Design Life: 10-12 Year(s) SerialNo: 2138126223365

☑ Gas ☑ Faulty Flue Connection

#### Comments:

• There should be a minimum of 12" of vertical rise between the draft hood and the first elbow. This allows for proper ventilation of the water heater gases. Further review by a plumber or HVAC tech advised.



Unit # 3 Water Heater:



☑ Monitor Condition

G

NI

NA

Unit # 3 Water Heater: NOT ENOUGH VERTICAL RISE

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com




## **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 3 Water Heater:

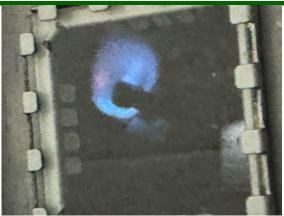

G

ΝI

NA

Unit # 3 Water Heater:

#### **UNIT # 4 WATER HEATER**

Brand: Richmond Model: 6G40-36F3 Design Life: 10-12 Year(s) SerialNo: Q031855343

 Gas ☐ Faulty Flue Connection

☑ Recommend Repairs Size: 40 Gallons

Age: 6 Year(s)

#### Comments:

• There should be a minimum of 12" of vertical rise between the draft hood and the first elbow. This allows for proper ventilation of the water heater gases. Excess build up of rust and corrosion on vent pipe. This could lead to leaking of fumes. Further review by a plumber or HVAC tech advised.

☑ Rust / Corrosion



Unit # 4 Water Heater:



Unit # 4 Water Heater: NO 12" VERTICAL RISE


Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com

Inspector Phone: (563) 676-7400 05/16/2024



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

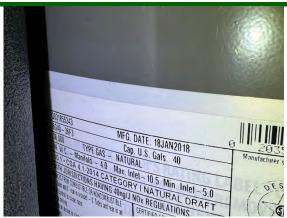

Unit # 4 Water Heater:

#### **UNIT # 5 WATER HEATER**

Brand: AO Smith Model: GCRL 40 400 Size: 40 Gallons Age: 5 Year(s)

Design Life: 10-12 Year(s) SerialNo: 1905113496333

☑ Gas ☑ Rust / Corrosion

#### Comments:

• There was excessive rust present at the cold water copper pipe fittings located at the top of the water heater.



Unit # 5 Water Heater:



Unit # 5 Water Heater:

☑ Monitor Condition

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com

05/16/2024 Inspector Phone: (563) 676-7400

NI

NA



## **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 5 Water Heater:

Design Life: 10-12 Year(s)



Unit # 5 Water Heater: RUST AND CORROSION ON TOP OF UNIT

#### **UNIT # 6 WATER HEATER**

Brand: AO Smith Model: FCG 40 248

SerialNo: ME03-2444534-248

☑ Gas ☑ Beyond Design Life

☑ Faulty Flue Connection

Size: 40 Gallons

☑ Recommend Repairs

☑ Rust / Corrosion

G

Age: 21 Year(s)

 $\overline{\mathbf{Q}}$ 

NI


NA

#### Comments:

- Most water heaters have a life span of ten to twelve years. Unit was functional, but was rated marginal due to its age. Ultimately, you should consider budgeting for replacement of the hot water heater in the foreseeable future.
- A moderate amount of rust flaking visible on the bottom of the tank indicated that water heater components have experienced some deterioration.
- Cover plate for fire chamber was missing at time of inspection. Advise that cover plate is replaced for safety.
- There should be a minimum of 12" of vertical rise between the draft hood and the first elbow. This allows for proper ventilation of the water heater gases. Further review by a plumber or HVAC tech advised.



Unit # 6 Water Heater:

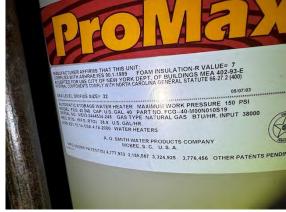

Unit # 6 Water Heater:

Inspection Date: Inspector: Jay Heckart

05/16/2024 Inspector Phone: (563) 676-7400

Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 6 Water Heater: MISSING COVER PLATE



Unit # 6 Water Heater: RUST BUILD UP ON UNIT



Unit # 6 Water Heater: NO VERTICAL RISE

				G	F	P	NI	NA
UNIT # 7 WATER HI	EATER	☑ Monitor Condition			V			
Brand: AO Smith SerialNo: 1828111086570	Model: GCR-40 400	Age: 6 Year(s)	Design Life: 10-12 Year(s)					
☑Gas	☑ Faulty Flue Connection							

#### Comments:

• There should be a minimum of 12" of vertical rise between the draft hood and the first elbow. This allows for proper ventilation of the water heater gases. Further review by a plumber or HVAC tech advised.

Inspection Date: Inspector: Jay Heckart

05/16/2024 Inspector Phone: (563) 676-7400

Email: jay.heckart@npiinspect.com



## **National Property Inspections**


### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 7 Water Heater:



Unit # 7 Water Heater: VERTICAL RISE UNDER 12"

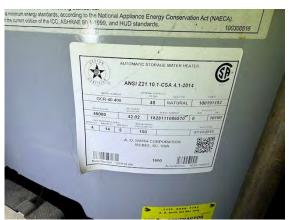

Unit # 7 Water Heater:

				G	F	P	NI	NA
UNIT # 8 WATER HI	☑ Recommend Repa			Ø				
Brand: Reliance Design Life: 10-12 Year(s)	Model: 640GORT 200 SerialNo: 1045A022133	Size: 40 Gallons	Age:	Age: 14 Year(s)				
☑ <sub>Gas</sub>	☑Beyond Design Life	☐ Faulty Flue Connection	⊠Rı	ıst / C	orrosio	on		

#### Comments:

- There should be a minimum of 12" of vertical rise between the draft hood and the first elbow. This allows for proper ventilation of the water heater gases. Further review by a plumber or HVAC tech advised.
- Rust and corrosion visible on flue piping. This may lead to pitting and hole development. Monitor condition and replace flue piping as needed.
- The water heater is believed to be beyond design life but was operational at time of inspection. Monitor condition as early repairs/replacement may be needed

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 8 Water Heater:



Unit # 8 Water Heater: NOT ENOUGH VERTICAL RISE



Unit # 8 Water Heater: RUST AND CORROSION



G

F

P

 $\overline{\mathbf{Q}}$ 

ΝI

NA

Unit # 8 Water Heater:

☑ Recommend Repairs

#### **UNIT #9 WATER HEATER**

Brand: Richmond Model: 6G40-36F1 Size: 40 Gallons Age: 17 Year(s)
Design Life: 10-12 Year(s) SerialNo: RMLN0907406365

☑ Gas ☑ Beyond Design Life ☑ Faulty Flue Connection

Comments:

- The water heater is believed to be beyond design life but was operational at time of inspection.
- There should be a minimum of 12" of vertical rise between the draft hood and the first elbow. Further review by a plumber or HVAC tech advised.
- Cover plate missing from lower compartment of water heater.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 9 Water Heater:



Unit # 9 Water Heater:



Unit # 9 Water Heater:



Unit # 9 Water Heater: COVER PLATE MISSING

				G	F	P	NI	NA
UNIT # 10 WATER HEATER		☑ Monitor Condition			Ø			
Brand: Richmond Design Life: 10-12 Year(s)	Model: 6G40-36F1 SerialNo: RMLNQ351217851	Size: 40 Gallons	Age: 11 Year(s)					
✓Gas	☑ At or Near Design Life	☐ Faulty Flue Connection						

#### Comments:

- There should be a minimum of 12" of vertical rise between the draft hood and the first elbow. This allows for proper ventilation of the water heater gases. Further review by a plumber or HVAC tech advised.
- Unit was functional, but was rated marginal due to its age. Ultimately, you should consider budgeting for replacement of the hot water heater in the foreseeable future.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 10 Water Heater:



Unit # 10 Water Heater:



Unit # 10 Water Heater:

				G	F	P	NI	NA
UNIT # 11 WATE	R HEATER	☑ Monitor Condition	n		Ø			
Brand: Richmond	Model: 9G40-38F3	Size: 40 Gallons	Age	Age: 6 Year(s)				

Design Life: 10-12 Year(s)

SerialNo: Q101816626

☐ Gas ☐ Faulty Flue Connection

#### Comments:

• There should be a minimum of 12" of vertical rise between the draft hood and the first elbow. This allows for proper ventilation of the water heater gases. Further review by a plumber or HVAC tech advised.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 11 Water Heater:



Unit # 11 Water Heater:



Unit # 11 Water Heater:

				G	F	P	NI	NA
UNIT # 12 WATER H	IEATER	☑ Monitor Condition			V			
Brand: AO Smith Design Life: 10-12 Year(s)	Model: KGA 40 916 SerialNo: MB85-32269-Z99	Size: 40 Gallons	Age:	Age: 40 Year(s)				

☐ Gas ☐ Beyond Design Life ☐ Faulty Flue Connection

#### Comments:

- There should be a minimum of 12" of vertical rise between the draft hood and the first elbow. This allows for proper ventilation of the water heater gases. Further review by a plumber or HVAC tech advised.
- Rust and corrosion visible on the lower portion of the water heater tank.
- The water heater is beyond design life but was operational at time of inspection. Monitor condition as early repairs/replacement may be needed

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



## **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 12 Water Heater:



Unit # 12 Water Heater:



Unit # 12 Water Heater:



Unit # 12 Water Heater:

				G	F	P	NI	NA
UNIT # 13 WATER HEATER		☑ Monitor Condition			V			
Brand: Richmond Design Life: 10-12 Year(s)	Model: 6G40-36F1 SerialNo: Q011508510	Size: 40 Gallons	Age:	Age: 9 Year(s)				
<b></b> Gas	☑ At or Near Design Life	☑ Faulty Flue Connection						

#### Comments:

- There should be a minimum of 12" of vertical rise between the draft hood and the first elbow. This allows for proper ventilation of the water heater gases. Further review by a plumber or HVAC tech advised.
- Burner chamber cover plate was missing at time of inspection.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com




# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 13 Water Heater:

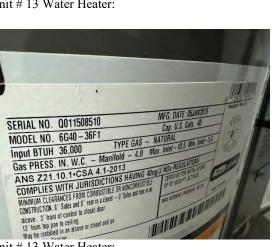

Unit # 13 Water Heater:



Unit # 13 Water Heater:



Unit # 13 Water Heater: MISSING COVER PLATE

				G	F	P	NI	NA
UNIT # 14 WATE	R HEATER	☑ Recommend Repair	rs			Ø		
D J. D.: -1 J	M- 4-1, CC40 2CE1	C: 40 C-11	A	. 16 37	(-)			

Brand: Richmond Model: 6G40-36F1 Size: 40 Gallons Age: 16 Year(s) Design Life: 10-12 Year(s) SerialNo: RMLN1108413501

Gas ☑ Beyond Design Life

#### Comments:

- There should be a minimum of 12" of vertical rise between the draft hood and the first elbow. This allows for proper ventilation of the water heater gases. Further review by a plumber or HVAC tech advised.
- Most water heaters have a life span of ten to twelve years. Unit was functional, but beyond its design life.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com

Inspector Phone: (563) 676-7400 05/16/2024



## **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 14 Water Heater:



Unit # 14 Water Heater:



Unit # 14 Water Heater:

			G	F	P	NI	NA
UNIT # 15 WATER HEATER		☑ Monitor Condition		Ø			
Brand: Rheem	Model: 22V40F1	Size: 40 Gallons	Age: 13 \	ear(s)			

Design Life: 10-12 Year(s) SerialNo: RHLN0811413279

☐ Gas ☐ Beyond Design Life ☐ Faulty Flue Connection

#### Comments:

- There should be a minimum of 12" of vertical rise between the draft hood and the first elbow. This allows for proper ventilation of the water heater gases. Further review by a plumber or HVAC tech advised.
- The water heater is believed to be beyond design life but was operational at time of inspection. Monitor condition as early repairs/replacement may be needed

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 15 Water Heater:



Unit # 15 Water Heater:



Unit # 15 Water Heater:

Location: Basement

#### **LAUNDRY FACILITIES**

☑ Recommend Repairs

	G	F	P	NI	NA
UTILITY HOOKUPS	V				
DRYER VENTS					
LAUNDRY TUB	$\square$				
DRAIN	Ø				

#### Comments:

• The washers were run through a short cycle to test the drain capability. There were no issue at the time of the inspection.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

• Multiple damaged exterior dryer vent covers. Recommend that vent covers are replaced to prevent pest entry.



Laundry Facilities:



Laundry Facilities:



Laundry Facilities: DAMAGED DRYER VENT



Laundry Facilities:



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Laundry Facilities:



Laundry Facilities: MISSING VENT COVER



Laundry Facilities:



Laundry Facilities:

#### **UNIT # 1 FURNACE**

Brand: Goodman Design Life: 15-20 Year(s)	Model: VMES800603AXAA SerialNo: 1911017501	BTUs: 48000	Js: 48000 Age: 5 Year(s)					
<b></b> Gas	☑ Forced Air							
			(	j :	F	P	NI	NA
OPERATION			1	<b>a</b>				

#### Comments:

• The heating system turned on, appeared functional, and responded to normal operating controls at the time of the inspection.

Heat Exchanger - Unable to detect cracks/holes without dismantling unit.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 1 Furnace:



Unit # 1 Furnace:



Unit # 1 Furnace:



Unit # 1 Furnace:

#### **UNIT # 2 FURNACE**

Brand: Bryant Model: 310AAV024045AGJA BTUs: 35000 Age: 6 Year(s)

Design Life: 15-20 Year(s) SerialNo: 0418A18538

— <b>Gu</b> s	-1 6/664 / M					
		G	F	P	NI	NA
OPERATION		Ø				

#### Comments:

• Furnace was clean and running properly at time of inspection. Heat distribution was acceptable with no problems to report. It is important that the furnace be properly maintained for efficiency and greater life span. Recommend a yearly maintenance program be set up with a local heating company to service and clean the furnace. This could greatly improve the life span of unit.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**


### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 2 Furnace:



Unit # 2 Furnace:

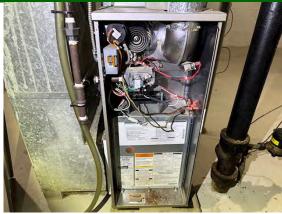

Unit # 2 Furnace:



Age: 31 Year(s)

Unit # 2 Furnace:

UNIT # 3 FURNACE 

✓ Monitor Condition

Brand: Lennox Model: G23Q3-50-1 BTUs: 40000
Design Life: 15-20 Year(s) SerialNo: 5893J 62038

☑ Gas ☑ Forced Air

	G	F	P	NI	NA
OPERATION		Ø			

#### Comments:

• Rated marginal due to unit being beyond standard design life. Due to the age of unit, be aware that it could need repairs or replacing at any time.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 3 Furnace:



Unit # 3 Furnace:



Unit # 3 Furnace:



Unit # 3 Furnace:

#### **UNIT # 4 FURNACE**

Brand: Goodman Model: GMES800604BNAA BTUs: 48000 Age: 3 Year(s)

Design Life: 15-20 Year(s) SerialNo: 2110748570

☑ Gas ☑ Forced Air

	G	F	P	NI	NA
OPERATION	Ø				

#### Comments:

• Furnace was clean and running properly at time of inspection. Heat distribution was acceptable with no problems to report. It is important that the furnace be properly maintained for efficiency and greater life span. Recommend a yearly maintenance program be set up with a local heating company to service and clean the furnace. This could greatly improve the life span of unit.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 4 Furnace:



Unit # 4 Furnace:



Unit # 4 Furnace:



Unit # 4 Furnace:

#### **UNIT # 5 FURNACE**

Brand: Goodman Model: GMES8000604BNAA BTUs: 48000 Age: 3 Year(s)

Design Life: 15-20 Year(s) SerialNo: 2110748574

☑ Gas ☑ Forced Air

	G	F	P	NI	NA
OPERATION	Ø				

#### Comments:

• The heating system turned on, appeared functional, and responded to normal operating controls at the time of the inspection.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



## **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 5 Furnace:



Unit # 5 Furnace:



Unit # 5 Furnace:



Unit # 5 Furnace:

#### UNIT # 6 FURNACE ☐ Recommend Repairs

Brand: Lennox Model: G23Q2/3-75-1 BTUs: 60000 Age: 31 Year(s)
Design Life: 15-20 Year(s) SerialNo: 5893K50486

☑Gas ☑Forced Air

#### Comments:

- Gas connections with visible repairs housed within the furnace system. Further review by a qualified HVAC contractor to determine if repairs are done properly and if gas connections should be moved outside of unit.
- Rated marginal due to unit being beyond standard design life. Due to the age of unit, be aware that it could need repairs or replacing at any time.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com




# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 6 Furnace:

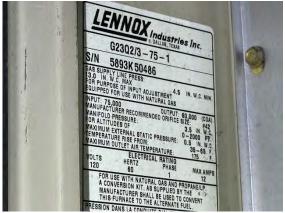

Unit # 6 Furnace:



Unit # 6 Furnace:



Unit # 6 Furnace:



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 6 Furnace: GAS CONNECTION REPAIR WITHIN FURNACE UNIT

#### **UNIT #7 FURNACE**

Brand: Goodman Model: GMES8000604BNAA BTUs: 48000 Age: 3 Year(s)

Design Life: 15-20 Year(s) SerialNo: 2111119924

☑ Gas ☑ Forced Air

	G	F	P	NI	NA
OPERATION	V				

#### Comments:

• The heating system turned on, appeared functional, and responded to normal operating controls at the time of the inspection.



Unit # 7 Furnace:



Unit # 7 Furnace:

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 7 Furnace:



Unit # 7 Furnace:

**UNIT #8 FURNACE** ☑ Monitor Condition

BTUs: 40000 Brand: Lennox Model: G23Q3-50-1 Age: 31 Year(s) SerialNo: 5893K54120

Design Life: 15-20 Year(s)

 Gas ☑ Forced Air ☑ Beyond Design Life

NA OPERATION 

#### Comments:

At the time of inspection, the unit was working. However, it was at or beyond life design.



Unit # 8 Furnace:



Unit # 8 Furnace:

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com

Inspector Phone: (563) 676-7400 05/16/2024



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240







Unit # 8 Furnace:

#### **UNIT #9 FURNACE**

Brand: Comfortmaker Design Life: 15-20 Year(s)	Model: N8MSN0451408A3 SerialNo: A182316940	BTUs: 35000	Age: 6 Year(s)				
<b></b> Gas	☑ Forced Air						
			G	F	P	NI	NA
OPERATION			<u> </u>	1 🗆			

#### Comments:

• The heating system turned on, appeared functional, and responded to normal operating controls at the time of the inspection.



Unit # 9 Furnace:



Unit # 9 Furnace:

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 9 Furnace:

<b>UNIT # 10 FURNACE</b>	☑ Monitor Condition								
Brand: Comfortmaker Design Life: 15-20 Year(s)	Model: N8MSN0701408A2 SerialNo: A124215109	BTUs: 53000 Age: 13 Year(s)							
<b></b> Gas	☑ Forced Air	☑ At or Near Design Life							
			G	F	P	NI	NA		
OPERATION			П	N	П	П			

#### Comments:

• Rated marginal due to age. Unit functional at time of inspection.



Unit # 10 Furnace:



Unit # 10 Furnace:

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 10 Furnace:

#### **UNIT # 11 FURNACE**

Brand: Goodman Model: GMES8000604BNAA BTUs: 48000 Age: 3 Year(s)

Design Life: 15-20 Year(s) SerialNo: 2111134978

☐ Gas ☐ Forced Air

	G	Г	P	INI	INA
OPERATION	$\overline{\mathbf{A}}$				

#### Comments:

• The heating system turned on, appeared functional, and responded to normal operating controls at the time of the inspection.








Unit # 11 Furnace:

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

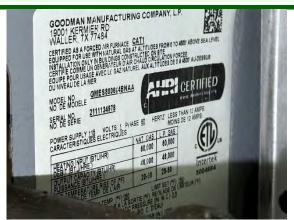

Unit # 11 Furnace:



Unit # 11 Furnace:

#### **UNIT # 12 FURNACE**

Brand: Goodman Model: GMES8000604BNAA BTUs: 48000 Age: 3 Year(s)

Design Life: 15-20 Year(s) SerialNo: 2111134977

☑ Gas
☑ Forced Air

	G	F	P	NI	NA
OPERATION	$\overline{\mathbf{A}}$				

#### Comments:

• Furnace was clean and running properly at time of inspection. Heat distribution was acceptable with no problems to report.



Unit # 12 Furnace:



Unit # 12 Furnace:

Inspection Date: Inspector: Jay Heckart

05/16/2024 Inspector Phone: (563) 676-7400




# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 12 Furnace:

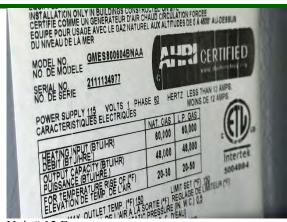

Unit # 12 Furnace:

#### **UNIT # 13 FURNACE**

Brand: Comfortmaker Model: N8MSN0701408A2 BTUs: 53000 Age: 11 Year(s)
Design Life: 15-20 Year(s) SerialNo: A131015028

☑Gas ☑Forced Air

#### Comments:

• Furnace was clean and running properly at time of inspection. Heat distribution was acceptable with no problems to report.



Unit # 13 Furnace:



Unit # 13 Furnace:

Inspection Date: Inspector: Jay Heckart

05/16/2024 Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 13 Furnace:

UNIT # 14 FURNACE 

☑ Monitor Condition

Brand: Goodman Model: GMS80403ANBE BTUs: 32000 Age: 7 Year(s)

Design Life: 15-20 Year(s) SerialNo: 1701347500


☑ Gas
☑ Forced Air

	G	F	P	NI	NA
OPERATION		☑			

#### Comments:

• The flexible gas line was installed through the furnace cabinet in violation of installation instructions. Flex lines are thin and vulnerable to damage. Only a solid metal pipe may be installed through the furnace cabinet. Further review by HVAC tech advised.



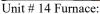




Unit # 14 Furnace:

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

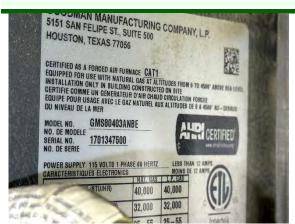

Unit # 14 Furnace:



Unit # 14 Furnace:



Unit # 14 Furnace: FLEX LINE ENTERING FURNACE

UNIT # 15 FURNACE	☑ Monitor Condition
-------------------	---------------------

Brand: Lennox Model: G23Q3-50-1 BTUs: 40000 Age: 31 Year(s)

Design Life: 15-20 Year(s) SerialNo: 5893K55039

☐ Gas ☐ Forced Air ☐ Beyond Design Life

#### Comments:

• Rated fair due to unit being beyond standard design life. Due to the age of unit, be aware that it could need repairs or replacing at any time.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 15 Furnace:



Unit # 15 Furnace:



Unit # 15 Furnace:



Unit # 15 Furnace:

### UNIT # 1 DRAFT CONTROL / VENT

G	F	P	NI	NA
Ø				

☑ Metal Pipe

#### Comments:

• Draft/Control vent appears to be installed correctly.

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 1 Draft Control / Vent:



G

 $\sqrt{\phantom{a}}$ 

NI

NA

Unit # 1 Draft Control / Vent:

### **UNIT # 2 DRAFT CONTROL/VENT**

☑ Metal Pipe

#### Comments:

• Draft/Control vent appears to be installed correctly.



Unit # 2 Draft Control/Vent:



Unit # 2 Draft Control/Vent:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

	G	F	P	NI	NA
UNIT # 3 DRAFT CONTROL/VENT	V				

☑ Metal Pipe

#### Comments:

• Draft/Control vent appears to be installed correctly.



Unit # 3 Draft Control/Vent:



 $\overline{\mathbf{V}}$ 

Unit # 3 Draft Control/Vent:

### **UNIT # 4 DRAFT CONTROL/VENT**

☑ Metal Pipe

#### Comments:

• Draft/Control vent appears to be installed correctly.



Unit # 4 Draft Control/Vent:



Unit # 4 Draft Control/Vent:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400

Email: jay.heckart@npiinspect.com

NI



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

	G	F	P	NI	NA
UNIT # 5 DRAFT CONTROL/VENT	Ø				

☑ Metal Pipe

#### Comments:

• Draft/Control vent appears to be installed correctly.



Unit # 5 Draft Control/Vent:



Unit # 5 Draft Control/Vent:

	G	F	P	NI	NA
UNIT # 6 DRAFT CONTROL/VENT	Ø				

☑ Metal Pipe

#### Comments:

• Draft/Control vent appears to be installed correctly.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com 05/16/2024 Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 6 Draft Control/Vent:



G

NI

NA

Unit # 6 Draft Control/Vent:

### **UNIT # 7 DRAFT CONTROL/VENT**

☑ Metal Pipe

#### Comments:

• Draft/Control vent appears to be installed correctly.



Unit # 7 Draft Control/Vent:



Unit # 7 Draft Control/Vent:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

	<b>—</b>			_		
UNIT # 8 DRAFT CONTROL/VENT	Recommend Repairs			$\overline{\mathbf{A}}$		
		G	F	P	NI	NA


☑ Metal Pipe ☑ Excessive Corrosion / Perforation ☑ Loose Connection

#### Comments:

- The exhaust flue for the furnace was loose inside of the attic creating a health hazard for CO leakage. Advise that pipe is properly secured and installed for safety.
- Test hole in flue pipe should be sealed to help prevent combustion gases from entering the house.



Unit # 8 Draft Control/Vent:

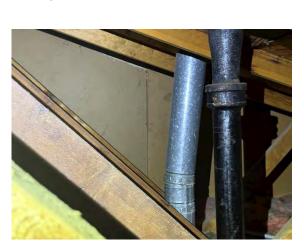

Unit # 8 Draft Control/Vent: LOOSE FLUE CONNECTIONS



Unit # 8 Draft Control/Vent: TEST HOLE SHOULD BE SEALED



Unit # 8 Draft Control/Vent:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

	G	F	P	NI	NA
UNIT # 9 DRAFT CONTROL/VENT	V				

☑ Metal Pipe

#### Comments:

• Draft/Control vent appears to be installed correctly.



Unit # 9 Draft Control/Vent:



 $\overline{\mathbf{V}}$ 

Unit # 9 Draft Control/Vent:

### **UNIT # 10 DRAFT CONTROL/VENT**

☑Metal Pipe

#### Comments:

• Draft/Control vent appears to be installed correctly.



Unit # 10 Draft Control/Vent:



Unit # 10 Draft Control/Vent:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400

Email: jay.heckart@npiinspect.com

NI



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

UNIT # 11 DRAFT CONTROL/VENT	G	F	P	NI	NA
UNIT # 11 DRAFT CONTROL/VENT	Ø				

☑ Metal Pipe

#### Comments:

• Draft/Control vent appears to be installed correctly.



Unit # 11 Draft Control/Vent:



G

 $\overline{\mathbf{Q}}$ 

Unit # 11 Draft Control/Vent:

### **UNIT # 12 DRAFT CONTROL/VENT**

☑ Metal Pipe

#### Comments:

• Draft/Control vent appears to be installed correctly.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com 05/16/2024 Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 12 Draft Control/Vent:



G

NI

NA

Unit # 12 Draft Control/Vent:

### **UNIT # 13 DRAFT CONTROL/VENT**

☑ Metal Pipe

#### Comments:

• Draft/Control vent appears to be installed correctly.



Unit # 13 Draft Control/Vent:



Unit # 13 Draft Control/Vent:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

	G	F	P	NI	NA
UNIT # 14 DRAFT CONTROL/VENT	Ø				

☑ Metal Pipe

#### Comments:

• Draft/Control vent appears to be installed correctly.



Unit # 14 Draft Control/Vent:



Unit # 14 Draft Control/Vent:

		G	F	P	NI	N
UNIT # 15 DRAFT CONTROL/VENT	☑ Recommend Repairs			Ø		[

☑ Metal Pipe

#### Comments:

• Rain cap missing from exterior flue. Rust build up and corrosion visible on interior flue.



Unit # 15 Draft Control/Vent:



Unit # 15 Draft Control/Vent: MISSING RAIN CAP

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### **UNIT # 1 HVAC DISTRIBUTION**

☑Ductwork					
	G	F	P	NI	NA
DISTRIBUTION	Ø				
BLOWER					
CONTROLS/THERMOSTAT (CALIBRATIONS/TIMED FUNCTIONS NOT CHECKED.)	☑				

#### Comments:

- Thermostat appeared to operate as designed at time of inspection. Adequate air flow was present. Recommend biannual cleaning of furnace in order to maintain proper operation and to extend life expectancy of heating unit. Regular filter changing/cleaning (3-4 Months) is required as a part of proper maintenance.
- Air loss in duct systems could lower system efficiency. Duct systems could easily be sealed with heat tape or use of furnace tape (not duct tape) on seams and joints.



Unit # 1 HVAC Distribution:



Unit # 1 HVAC Distribution:

#### **UNIT # 2 HVAC DISTRIBUTION**

☑Ductwork					
	G	F	P	NI	NA
DISTRIBUTION	Ø				
BLOWER	☑				
CONTROLS/THERMOSTAT (CALIBRATIONS/TIMED FUNCTIONS NOT CHECKED.)	Ø				

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### Comments:

• Thermostat appeared to operate as designed at time of inspection. Adequate air flow was present. Recommend biannual cleaning of furnace in order to maintain proper operation and to extend life expectancy of heating unit. Regular filter changing/cleaning (3-4 Months) is required as a part of proper maintenance.



Unit # 2 HVAC Distribution:



Unit # 2 HVAC Distribution:



Unit # 2 HVAC Distribution:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### **UNIT # 3 HVAC DISTRIBUTION** ☑ Recommend Repairs ☑Ductwork ☑ Noisy Blower ☑ Dirty Blower Fins G NA DISTRIBUTION $\overline{\mathbf{Q}}$ BLOWER $\overline{\mathbf{Q}}$ CONTROLS/THERMOSTAT (CALIBRATIONS/TIMED FUNCTIONS NOT CHECKED.)

#### Comments:

• Fins on the blower had accumulated dirt and debris which have slowed down the fans rotation and reduced the amount of air that the blower motor is capable of moving. Excessive noise from fan motor. Advise that the blower fins are properly cleaned by a qualified HVAC tech.



Unit # 3 HVAC Distribution:



Unit # 3 HVAC Distribution: DEBRIS CAUGHT AND DIRTY BLOWER FINS

#### **UNIT # 4 HVAC DISTRIBUTION**

☑Ductwork					
	G	F	P	NI	NA
DISTRIBUTION	Ø				
BLOWER	Ø				
CONTROLS/THERMOSTAT (CALIBRATIONS/TIMED FUNCTIONS NOT CHECKED.)	Ø				

#### Comments:

• Thermostat appeared to operate as designed at time of inspection. Adequate air flow was present. Recommend biannual cleaning of furnace in order to maintain proper operation and to extend life expectancy of heating unit. Regular filter changing/cleaning (3-4 Months) is required as a part of proper maintenance.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com




# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 4 HVAC Distribution:

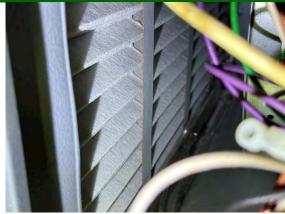

Unit # 4 HVAC Distribution:



Unit # 4 HVAC Distribution:

UNIT # 5 HVAC DIS	TRIBUTION	☑ Monitor Condition					
☑Ductwork	☑ Rusted						
			G	F	P	NI	NA
DISTRIBUTION				V			
BLOWER			Ø				
CONTROLS/THERMOSTAT	(CALIBRATIONS/TIMED FUNCTIONS NOT CH	ECKED.)	$\overline{\mathbf{Q}}$				

#### Comments:

• Gaps and rust present in air ducts. Recommend that any gaps are properly sealed and rust is monitored for holes or additional damage. Repair or replace damaged duct system as needed.

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240




Unit # 5 HVAC Distribution:



Unit # 5 HVAC Distribution:



Unit # 5 HVAC Distribution: RUST BUILD UP

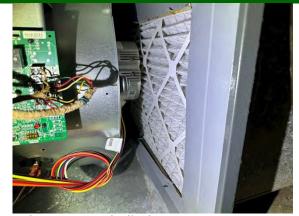

Unit # 5 HVAC Distribution:



Unit # 5 HVAC Distribution: GAPS IN DUCT SYSTEM

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### **UNIT # 6 HVAC DISTRIBUTION** ☑ Monitor Condition ☑Ductwork ☑ Dirty Blower Fins G ΝI NA DISTRIBUTION $\overline{\mathbf{V}}$ BLOWER $\overline{\mathbf{Q}}$

#### Comments:

CONTROLS/THERMOSTAT

• Fins on the blower had accumulated dirt which may slow down the fans rotation and reduce the amount of air that the blower motor is capable of moving. Advise that the blower fins are properly cleaned by a qualified HVAC tech.

(CALIBRATIONS/TIMED FUNCTIONS NOT CHECKED.)



Unit # 6 HVAC Distribution:



 $\square$ 

Unit # 6 HVAC Distribution:



Unit # 6 HVAC Distribution: DIRTY BLOWER FINS

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### **UNIT #7 HVAC DISTRIBUTION**

☑Ductwork

	G	F	P	NI	NA
DISTRIBUTION	Ø				
BLOWER	$\square$				
CONTROLS/THERMOSTAT (CALIBRATIONS/TIMED FUNCTIONS NOT CHECKED.)	Ø				

#### Comments:

• Thermostat appeared to operate as designed at time of inspection. Adequate air flow was present. Recommend biannual cleaning of furnace in order to maintain proper operation and to extend life expectancy of heating unit. Regular filter changing/cleaning (3-4 Months) is required as a part of proper maintenance.



Unit # 7 HVAC Distribution:



Unit # 7 HVAC Distribution:



Unit # 7 HVAC Distribution:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### **UNIT #8 HVAC DISTRIBUTION**

☑Ductwork

	G	F	P	NI	NA
DISTRIBUTION	V				
BLOWER	Ø				
CONTROLS/THERMOSTAT (CALIBRATIONS/TIMED FUNCTIONS NOT CHECKED.)	Ø				

#### Comments:

• Thermostat appeared to operate as designed at time of inspection. Adequate air flow was present.



Unit # 8 HVAC Distribution:



Unit # 8 HVAC Distribution:



Unit # 8 HVAC Distribution:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### **UNIT #9 HVAC DISTRIBUTION** ☑ Recommend Repairs **☑** Ductwork G ΝI NA DISTRIBUTION $\overline{\mathbf{V}}$ BLOWER $\overline{\mathbf{Q}}$ CONTROLS/THERMOSTAT (CALIBRATIONS/TIMED FUNCTIONS NOT CHECKED.) $\square$

#### Comments:

• Blower compartment and fan was full of debris and dust build up. This may cause damage to the fan and its components. Further repair and cleaning by HVAC tech advised.





CONTROLS/THERMOSTAT



Unit # 9 HVAC Distribution:

UNIT # 10 HVAC	DISTRIBUTION	✓ Recommend Repairs					
☑Ductwork	☑ Dirty Blower Fins						
			G	F	P	NI	NA
DISTRIBUTION			Ø				
BLOWER					Ø		

#### Comments:

• Fins on the blower had accumulated dirt which may slow down the fans rotation and reduce the amount of air that the blower motor is capable of moving. Advise that the blower fins are properly cleaned by a qualified HVAC tech.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com

(CALIBRATIONS/TIMED FUNCTIONS NOT CHECKED.)

05/16/2024 Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 10 HVAC Distribution:



Unit # 10 HVAC Distribution:



Unit # 10 HVAC Distribution: DIRTY BLOWER FINS

### **UNIT # 11 HVAC DISTRIBUTION**

☑Ductwork

	G	F	P	NI	NA
DISTRIBUTION	Ø				
BLOWER	Ø				
CONTROLS/THERMOSTAT (CALIBRATIONS/TIMED FUNCTIONS NOT CHECKED.)	Ø				

#### Comments:

• Distribution was acceptable at time of inspection.

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 11 HVAC Distribution:



Unit # 11 HVAC Distribution:


### **UNIT # 12 HVAC DISTRIBUTION**

☑Ductwork

	G	F	P	NI	NA
DISTRIBUTION	Ø				
BLOWER	Ø				
CONTROLS/THERMOSTAT (CALIBRATIONS/TIMED FUNCTIONS NOT CHECKED.)	Ø				

#### Comments:

• Distribution was acceptable at time of inspection.

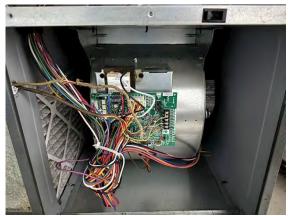

Unit # 12 HVAC Distribution:



Unit # 12 HVAC Distribution:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

### **UNIT # 13 HVAC DISTRIBUTION**

☑Ductwork

	G	F	P	NI	NA
DISTRIBUTION	V				
BLOWER	Ø				
CONTROLS/THERMOSTAT (CALIBRATIONS/TIMED FUNCTIONS NOT CHECKED.)	Ø				

#### Comments:

• Thermostat appeared to operate as designed at time of inspection. Adequate air flow was present.



Unit # 13 HVAC Distribution:



Unit # 13 HVAC Distribution:



Unit # 13 HVAC Distribution:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

### **UNIT # 14 HVAC DISTRIBUTION**

☑Ductwork

	G	F	P	NI	NA
DISTRIBUTION	Ø				
BLOWER	Ø				
CONTROLS/THERMOSTAT (CALIBRATIONS/TIMED FUNCTIONS NOT CHECKED.)	Ø				

#### Comments:

• Distribution was acceptable at time of inspection.



Unit # 14 HVAC Distribution:



Unit # 14 HVAC Distribution:



Unit # 14 HVAC Distribution:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### **UNIT # 15 HVAC DISTRIBUTION** ☑ Recommend Repairs ☑Ductwork ☑ Dirty Blower Fins G ΝI NA DISTRIBUTION $\overline{\mathbf{V}}$ BLOWER $\overline{\mathbf{Q}}$

#### Comments:

CONTROLS/THERMOSTAT

• Fins on the blower had accumulated dirt which may slow down the fans rotation and reduce the amount of air that the blower motor is capable of moving. Advise that the blower fins are properly cleaned by a qualified HVAC tech.

(CALIBRATIONS/TIMED FUNCTIONS NOT CHECKED.)



Unit # 15 HVAC Distribution:



 $\square$ 

Unit # 15 HVAC Distribution:



Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

				G	F	P	NI	NA
UNIT # 1 COOLING		☑ Monitor Condition			Ø			
Brand: Goodman Design Life: 15-20 Year(s)	Model: GSX130181ED SerialNo: 1403396045	Size: 2.0 Tons	Age	10 Y	ear(s)			-
☑Electric	☑Central Air	☑ Outside Unit Not Level						
☑ Damaged or Missing Suction	Line Insulation							

#### Comments:

- The air conditioning system responded to the controls and appeared to operate in a satisfactory manner.
- A/C suction line requires re-insulation to improve efficiency.
- The HVAC condenser unit was not level. It is very important for the condenser to be level to reduce wear on the fan barings and enable the lubricating oil to reach all parts of the compressor motor.



Unit # 1 Cooling:



Unit # 1 Cooling: INSULATION MISSING FROM SUCTION LINE



Unit # 1 Cooling: UN LEVEL AC UNIT



Unit # 1 Cooling:

Inspection Date: Inspector: Jay Heckart

05/16/2024 Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

				G	F	P	NI	NA
UNIT # 2 COOLING   ☑ Recommend Repairs						V		
Brand: Internation Comfort Products	Model: HAC024AKA1	Size: 2.0 Tons	Age:	23 Ye	ear(s)			
Design Life: 15-20 Year(s)	SerialNo: L012015016							
☑Electric	☑ Central Air	☑Beyond Design Life	ØŊ	o Pad	Under	Unit		

#### Comments:

- The air conditioning system responded to the controls and appeared to operate in a satisfactory manner. All visible components of the air-conditioning system appeared to be in serviceable condition at the time of the inspection.
- Unit is at or near design life. Due to the age of unit, be aware that it could need repairs or replacing at any time.
- No pad. The air conditioner compressor housing was not mounted on a stable surface. Over time, it could move out of level which will create mechanical problems such as premature fan bearing wear.







Unit # 2 Cooling:

				G	F	P	NI	NA
<b>UNIT # 3 COOLING</b>		☑ Monitor Condition			Ø			
Brand: Unknown	Model: Label Not Legible	Design Life: 15-20 Year(s)	SerialNo: N/A					
☑Electric	☑Central Air							

#### Comments:

• Unit is at or near design life. Due to the age of unit, be aware that it could need repairs or replacing at any time.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 3 Cooling:

#### **UNIT # 4 COOLING**

Model: 2A7A3024A1000AA Size: 2.0 Tons

G F P NI NA
□ □ □ □ □

Brand: American Standard Design Life: 15-20 Year(s)

SerialNo: 6172S785F

5120. 2.0 10115

Age: 18 Year(s)

☑Electric

☑ Central Air

☑ At or Near Design Life

☑ Needs Normal Maintenance / Cleaning

☑ Outside Unit Not Level

#### Comments:

- Rated marginal due to unit being at or near design life. Due to the age of unit, be aware that it could need repairs or replacing at any time.
- The HVAC condenser unit was not level. It is very important for the condenser to be level to reduce wear on the fan barings and enable the lubricating oil to reach all parts of the compressor motor.
- Condenser service wire is exposed due to conduit coming loose from breaker box. Recommend that conduit is properly secured to prevent damage to wire and for electrical safety.







Unit # 4 Cooling: UN LEVEL SYSTEM

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 4 Cooling:



Unit # 4 Cooling: LOOSE CONDUIT AND EXPOSED WIRE



Unit # 4 Cooling:



## **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

				G	F	P	NI	NA
UNIT # 5 COOLING		☑ Monitor Condition			V			
Brand: Intertek Design Life: 15-20 Year(s)	Model: JS6BD-024K SerialNo: JSG170718674	Size: 2.0 Tons	Age:	17 Y	ear(s)			
☑ Electric	☑ Central Air	☑ At or Near Design Life						
☑ Needs Normal Maintenance /	Cleaning							

#### Comments:

- The air conditioning system responded to the controls and appeared to operate in a satisfactory manner.
- Rated marginal due to unit being at or near design life. Due to the age of unit, be aware that it could need repairs or replacing at any time.
- A/C suction line requires re-insulation to improve efficiency.



Unit # 5 Cooling:





Unit # 5 Cooling:

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

				G	F	P	NI	NA
UNIT # 6 COOLING		☑ Monitor Condition			Ø			
Brand: Unknown SerialNo: E060616732	Model: Label Not Legible	Size: 2.0 Tons	Desi	Design Life: 15-20 Year(s)				
☑Electric	☑ Central Air							

#### Comments:

• Rated marginal due to unit being at or near design life. Due to the age of unit, be aware that it could need repairs or replacing at any time.



Unit # 6 Cooling:



Unit # 6 Cooling:



Unit # 6 Cooling:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

				G	F	P	NI	NA
UNIT # 7 COOLING				Ø				
Brand: Internation Comfort Products	Model: N4A324AKC100	Size: 2.0 Tons	Age:	10-15	Year	(s)		
Design Life: 15-20 Year(s)	SerialNo: E141911048							
☑Electric	☑Central Air							

#### Comments:

 The air conditioning system responded to the controls and appeared to operate in a satisfactory manner. All visible components of the air-conditioning system appeared to be in serviceable condition at the time of the inspection.



Unit # 7 Cooling:



Unit # 7 Cooling:



Unit # 7 Cooling:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

				G	F	P	NI	NA
UNIT # 8 COOLING				V				
Brand: Internation Comfort Products	Model: N4A324AKB200	Size: 2.0 Tons	Age:	13 Y	ear(s)			
Design Life: 15-20 Year(s)	SerialNo: E111918591							
☑Electric	☑Central Air							

#### Comments:

• The air conditioning system responded to the controls and appeared to operate in a satisfactory manner.



Unit # 8 Cooling:



Unit # 8 Cooling:



Unit # 8 Cooling:

Inspection Date: Inspector: Jay Heckart

05/16/2024 Inspector Phone: (563) 676-7400



# **National Property Inspections**

#### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

				G	F	P	NI	NA
<b>UNIT # 9 COOLING</b>		Recommend Repairs				V		
Brand: Goodman Design Life: 15-20 Year(s)	Model: GSX130181EJ SerialNo: 21982794297	Size: 2.0 Tons	Age:	3 Yea	ır(s)			
<b>☑</b> Electric	☑Central Air							

#### Comments:

- The HVAC condenser was not installed on a visible pad and may become un level due to settling. It is very important for the condenser to be level to enable the lubricating oil to reach all parts of the compressor motor.
- The presence of condensation on the interior side of the suction lines noted during the inspection. The presence of frost or ice could indicate the unit was not operating properly and requires service.



Unit # 9 Cooling:



Unit # 9 Cooling:



Unit # 9 Cooling: CONDENSATION FORMING ON SUCTION LINES

Inspection Date: Inspector: Jay Heckart

05/16/2024 Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

				G	F	P	NI	NA
<b>UNIT # 10 COOLING</b>		☑ Recommend I	Repairs			V		
Brand: Comfortmaker	Model: N4A324AKB200	Size: 2.0 Tons	Age	14 Y	ear(s)			
Design Life: 15-20 Year(s)	SerialNo: E102725930							

☑ Electric ☑ Central Air

#### Comments:

• AC unit was not installed on a visible pad. Advise that pad be installed to prevent AC unit from settling or being uneven.



Unit # 10 Cooling:



Unit # 10 Cooling:



Unit # 10 Cooling:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



## **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

				G	F	P	NI	NA
UNIT # 11 COOLING		☑ Monitor Condition			V			
Brand: Goodman Design Life: 15-20 Year(s)	Model: GSX130181EC SerialNo: 1563383089	Size: 2.0 Tons	Age:	9 Yea	ır(s)			_
☑ Electric	☑Central Air							

#### Comments:

• No visible pad installed under AC unit. Advise that AC unit is installed on top of a concrete or plastic pad to prevent settling.



☑ Central Air

Unit # 11 Cooling:



Unit # 11 Cooling:

				G	F	P	NI	NA
UNIT # 12 COOLING		☑ Monitor Condition			V			
Brand: Goodman Design Life: 15-20 Year(s)	Model: GSX130181EJ SerialNo: 2105386594	Size: 2.0 Tons	Age:	3 Yea	r(s)			

#### Comments:

**☑**Electric

• Leaf debris built up around the AC unit. Clean exterior condensing unit on a routine basis. Obstructed air flow could lead to poor efficiency/damage to the unit.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com




## **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 12 Cooling:

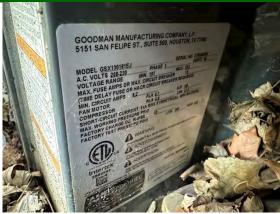

Unit # 12 Cooling:



Unit # 12 Cooling: CLEAR LEAF DEBRIS FROM AWAY FROM UNIT

	G	F	P	NI	NA
UNIT # 13 COOLING	V				

Brand: Goodman Model: GSX130181EJ Size: 2.0 Tons Age: 3 Year(s)
Design Life: 15-20 Year(s) SerialNo: 2105298299

☑ Electric ☑ Central Air

#### Comments:

• The air conditioning system responded to the controls and appeared to operate in a satisfactory manner. All visible components of the air-conditioning system appeared to be in serviceable condition at the time of the inspection.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



## **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 13 Cooling:



G

ΝI

NA

Unit # 13 Cooling:

#### **UNIT # 14 COOLING**

☑ Monitor Condition

Brand: Comfortmaker Model: CAC024AKA1 Size: 2.0 Tons Age: 22 Year(s)
Design Life: 15-20 Year(s) SerialNo: L022518443

☑ Electric ☑ Central Air

#### Comments:

• Rated marginal due to unit being at or near design life. Due to the age of unit, be aware that it could need repairs or replacing at any time.



Unit # 14 Cooling:



Unit # 14 Cooling:

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

				G	F	P	NI	NA
<b>UNIT # 15 COOLING</b>		☑ Monitor Condition			V			
Brand: Internation Comfort Products	Model: N4A324AKB200	Size: 2.0 Tons	Age:	13 Ye	ear(s)			
Design Life: 15-20 Year(s)	SerialNo: E111918593							
☑Electric	☑ Central Air							

#### Comments:

• Unit is at or near design life. Due to the age of unit, be aware that it could need repairs or replacing at any time.



Unit # 15 Cooling:



Unit # 15 Cooling:

	_					
UNIT # 1 KITCHEN	✓ Recommend Repairs	G	F	P	NI	NA
CEILINGS		Ø				
WALL(S)		Ø				
FLOOR/FINISH		Ø				
INTERIOR DOORS/HARDWARE		Ø				
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXTURES.)		Ø				
GFCI PROTECTION (CHECKED WITH TEST BUTTON ONLY. MONTHLY TEST R	ECOMMENDED.)	Ø				
HEAT/AIR DISTRIBUTION		Ø				
COUNTERTOPS/CABINETS		Ø				
SINK/FAUCET		Ø				
EXHAUST FAN		Ø				

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

STOVE TOP/OVEN		V	
WATER PRESSURE/FLOW/DRAINAGE	Ø		
DISHWASHER/CROSS FLOW PROTECTION	Ø		
REFRIGERATOR	Ø		
MICROWAVE	Ø		
GARBAGE DISPOSAL			Ø

#### Comments:

- GFCI outlets tripped when tested.
- Stove top and oven were installed in direct contact with drywall. Recommend a protective material is installed in between oven for fire protection.



Unit # 1 Kitchen:



Unit # 1 Kitchen:



Unit # 1 Kitchen:



Unit # 1 Kitchen: STOVE IN DIRECT CONTACT WITH DRYWALL

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

#### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

TINDE II A TZIECTIENI	Monitor Condition					ı
UNIT # 2 KITCHEN	☑ Recommend Repairs	G	F	P	NI	NA
CEILINGS		☑				
WALL(S)		Ø				
FLOOR/FINISH		Ø				
INTERIOR DOORS/HARDWARE		Ø				
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXTURES.)		Ø				
GFCI PROTECTION (CHECKED WITH TEST BUTTON ONLY. MONTHLY TEST	RECOMMENDED.)	Ø				
HEAT/AIR DISTRIBUTION		Ø				
COUNTERTOPS/CABINETS		Ø				
SINK/FAUCET			Ø			
EXHAUST FAN		Ø				
STOVE TOP/OVEN				Ø		
WATER PRESSURE/FLOW/DRAINAGE		Ø				
DISHWASHER/CROSS FLOW PROTECTION				Ø		
REFRIGERATOR		Ø				
MICROWAVE		Ø				
GARBAGE DISPOSAL						Ø

#### Comments:

- GFCI outlets were in acceptable condition and properly tripped.
- Stove top and oven were installed in direct contact with drywall. Oven door was also rubbing on wall causing damage to drywall. Recommend a protective material is installed in between oven for fire protection.
- Dishwasher drainage loop not properly installed. A high loop prevents waste water back flowing from your sink to your dishwasher. If the drain hose is not elevated, there is a potential for water to run the wrong way through your drain hose and can cause standing water at the bottom of the dishwasher. Recommend proper high loop be installed.
- Dishwasher status lights were blinking and would not respond to touch. Further evaluation advised.
- Sink faucet head was leaking at time of inspection. Advise that faucet head is repaired or replaced.
- Large amounts of grease build up on stove top surface. Recommend that surface is properly cleaned.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 2 Kitchen:



Unit # 2 Kitchen: DISHWASHER DRAINAGE LOOP NOT INSTALLED HIGH ENOUGH



Unit # 2 Kitchen:



Unit # 2 Kitchen:



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 2 Kitchen: FAUCET HEAD LEAKS

UNIT # 3 KITCHEN	☑ Recommend Repairs	G	F	P	NI	NA
CEILINGS		V				
WALL(S)		Ø				
FLOOR/FINISH		Ø				
INTERIOR DOORS/HARDWARE		V				
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXTU	URES.)	V				
GFCI PROTECTION (CHECKED WITH TEST BUTTON ONLY. MONTE	ILY TEST RECOMMENDED.)	V				
HEAT/AIR DISTRIBUTION		V				
COUNTERTOPS/CABINETS		V				
SINK/FAUCET		V				
EXHAUST FAN		V				
STOVE TOP/OVEN				Ø		
WATER PRESSURE/FLOW/DRAINAGE		V				
DISHWASHER/CROSS FLOW PROTECTION		V				
REFRIGERATOR		V				
MICROWAVE		V				
GARBAGE DISPOSAL						Ø

#### Comments:

• Stove top and oven were installed in direct contact with drywall. Recommend a protective material is installed in between oven for fire protection.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 3 Kitchen:



Unit # 3 Kitchen:



Unit # 3 Kitchen:



Unit # 3 Kitchen: OVEN INSTALLED IN DIRECT CONTACT WITH DRYWALL

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

	☑ Monitor Condition					
UNIT # 4 KITCHEN	☑ Recommend Repairs	G	F	P	NI	NA
CEILINGS			V			
WALL(S)		$\square$				
FLOOR/FINISH		Ø				
INTERIOR DOORS/HARDWARE		Ø				
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXTURES.)		Ø				
GFCI PROTECTION (CHECKED WITH TEST BUTTON ONLY. MONTHLY TE	EST RECOMMENDED.)	Ø				
HEAT/AIR DISTRIBUTION		Ø				
COUNTERTOPS/CABINETS		Ø				
SINK/FAUCET		Ø				
EXHAUST FAN		Ø				
STOVE TOP/OVEN				Ø		
WATER PRESSURE/FLOW/DRAINAGE		Ø				
DISHWASHER/CROSS FLOW PROTECTION		Ø				
REFRIGERATOR		Ø				
MICROWAVE		Ø				
GARBAGE DISPOSAL						Ø

#### Comments:

- Stove top and oven were installed in direct contact with drywall. Recommend a protective material is installed in between oven for fire protection. Burn marks / discoloration and heat damage visible on wall next to stove.
- Ceiling was stained above the over. Recommend that stains are cleaned off to prevent permanent staining of ceiling.







Unit # 4 Kitchen:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 4 Kitchen:



Unit # 4 Kitchen:



Unit # 4 Kitchen: BURN MARKS AND PAINT DAMAGE NEAR STOVE



Unit # 4 Kitchen: CEILING STAINS

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

UNIT # 5 KITCHEN	☑ Recommend Repairs	G	F	Р	NI	NA
CEILINGS	E Recommend Repairs	Ø	<u>г</u>		INI	NA D
CEILINGS						
WALL(S)		V				
FLOOR/FINISH		Ø				
INTERIOR DOORS/HARDWARE		Ø				
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXTURES.)		Ø				
GFCI PROTECTION (CHECKED WITH TEST BUTTON ONLY. MONTHLY TEST	RECOMMENDED.)	Ø				
HEAT/AIR DISTRIBUTION		Ø				
COUNTERTOPS/CABINETS		Ø				
SINK/FAUCET		Ø				
EXHAUST FAN		Ø				
STOVE TOP/OVEN 🗹 Electric						
WATER PRESSURE/FLOW/DRAINAGE		Ø				
DISHWASHER/CROSS FLOW PROTECTION		Ø				
REFRIGERATOR		Ø				
MICROWAVE		Ø				
GARBAGE DISPOSAL						Ø

#### Comments:

• Stove top and oven were installed in direct contact with drywall. Recommend a protective material is installed in between oven for fire protection. Heat damage to drywall next to oven visible.







Unit # 5 Kitchen:

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 5 Kitchen:



Unit # 5 Kitchen: STOVE INSTALLED NEXT TO DRYWALL



Unit # 5 Kitchen: WALL DAMAGE



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

UNIT # 6 KITCHEN	G	F	P	NI	NA
CEILINGS	☑				
WALL(S)	Ø				
FLOOR/FINISH	Ø				
INTERIOR DOORS/HARDWARE	Ø				
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXTURES.)	Ø				
GFCI PROTECTION (CHECKED WITH TEST BUTTON ONLY. MONTHLY TEST RECOMMENDED.)	Ø				
HEAT/AIR DISTRIBUTION	Ø				
COUNTERTOPS/CABINETS	Ø				
SINK/FAUCET	Ø				
EXHAUST FAN	Ø				
STOVE TOP/OVEN	Ø				
WATER PRESSURE/FLOW/DRAINAGE	Ø				
DISHWASHER/CROSS FLOW PROTECTION	Ø				
REFRIGERATOR	Ø				
MICROWAVE	Ø				
GARBAGE DISPOSAL					Ø

#### Comments:

- All components in kitchen were acceptable at time of inspection.
- Protective wall covering installed next to stove.



Unit # 6 Kitchen:



Unit # 6 Kitchen:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240







Unit # 6 Kitchen:

UNIT # 7 KITCHEN	☑ D		Б	D	N.I.T.	37.4
	☑ Recommend Repairs	G	F	P	NI	NA
CEILINGS		☑				
WALL(S)		Ø				
FLOOR/FINISH		Ø				
INTERIOR DOORS/HARDWARE		Ø				
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXTURES.	)	Ø				
GFCI PROTECTION (CHECKED WITH TEST BUTTON ONLY. MONTHLY T	EST RECOMMENDED.)	Ø				
HEAT/AIR DISTRIBUTION		Ø				
COUNTERTOPS/CABINETS		Ø				
SINK/FAUCET		Ø				
EXHAUST FAN		Ø				
STOVE TOP/OVEN				Ø		
WATER PRESSURE/FLOW/DRAINAGE		Ø				
DISHWASHER/CROSS FLOW PROTECTION				Ø		
REFRIGERATOR		Ø				
MICROWAVE		Ø				
GARBAGE DISPOSAL						Ø

Comments:

Inspection Date: Inspector: Jay Heckart

05/16/2024 Inspector Phone: (563) 676-7400



# **National Property Inspections**

#### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

- Dishwasher cross-flow protection not installed properly. Discharge tube should be mounted to the underside of the countertop to create a high point to prevent water from flowing backwards into the dishwasher unit from the sink or drainage pipes.
- Oven and stove top was installed directly against unprotected drywall. Drywall showing signs of heat damage and discoloration.



Unit # 7 Kitchen:



Unit # 7 Kitchen:



Unit # 7 Kitchen:



Unit # 7 Kitchen:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 7 Kitchen:

UNIT # 8 KITCHEN	☑ Recommend Repairs	G	F	P	NI	NA
CEILINGS					Ø	
WALL(S)					V	
FLOOR/FINISH					V	
INTERIOR DOORS/HARDWARE					Ø	
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXTURES.)					Ø	
GFCI PROTECTION (CHECKED WITH TEST BUTTON ONLY. MONTHLY TEST	RECOMMENDED.)				Ø	
HEAT/AIR DISTRIBUTION					V	
COUNTERTOPS/CABINETS					Ø	
SINK/FAUCET					V	
EXHAUST FAN					$\square$	
STOVE TOP/OVEN				Ø		
WATER PRESSURE/FLOW/DRAINAGE					Ø	
DISHWASHER/CROSS FLOW PROTECTION					V	
REFRIGERATOR					V	
MICROWAVE					V	
GARBAGE DISPOSAL						Ø

#### Comments:

- Tenant was cooking and present in the kitchen at time of inspection. Visual inspection only of space and no photos available.
- Stove installed in direct contact with drywall.

Inspection Date: Inspector: Jay Heckart

05/16/2024 Inspector Phone: (563) 676-7400




# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

	☑ Monitor Condition					
UNIT # 9 KITCHEN	☑ Recommend Repairs	G	F	P	NI	NA
CEILINGS		Ø				
WALL(S)			Ø			
FLOOR/FINISH		Ø				
INTERIOR DOORS/HARDWARE		$\square$				
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXTURES.)		Ø				
GFCI PROTECTION (CHECKED WITH TEST BUTTON ONLY. MONTHLY TEST	Γ RECOMMENDED.)	Ø				
HEAT/AIR DISTRIBUTION		Ø				
COUNTERTOPS/CABINETS				Ø		
SINK/FAUCET		Ø				
EXHAUST FAN		Ø				
STOVE TOP/OVEN				Ø		
WATER PRESSURE/FLOW/DRAINAGE		Ø				
DISHWASHER/CROSS FLOW PROTECTION		Ø				
REFRIGERATOR		Ø				
MICROWAVE		Ø				
GARBAGE DISPOSAL						Ø

#### Comments:

- Lower sink left door was damaged at time of inspection.
- Drywall next to oven is starting to show heat damage and staining. Advise that a protective barrier is installed between oven and wall.

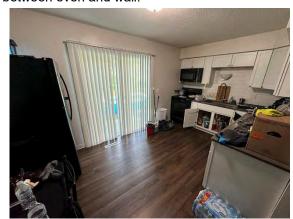





Unit # 9 Kitchen:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 9 Kitchen: DAMAGED / LOOSE CABINET DOOR



Unit # 9 Kitchen:



Unit # 9 Kitchen: DRYWALL DAMAGE DUE TO OVER PROXIMITY



Unit # 9 Kitchen:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**


### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

UNIT # 10 ZITCHEN	□ 1 D .	~	-	_		27.
UNIT # 10 KITCHEN	☑ Recommend Repairs	G	F	P	NI	NA
CEILINGS		V				
WALL(S)		Ø				
FLOOR/FINISH		Ø				
INTERIOR DOORS/HARDWARE		Ø				
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXTURES.)		Ø				
GFCI PROTECTION (CHECKED WITH TEST BUTTON ONLY. MONTHLY TEST	RECOMMENDED.)	Ø				
HEAT/AIR DISTRIBUTION		Ø				
COUNTERTOPS/CABINETS		Ø				
SINK/FAUCET		Ø				
EXHAUST FAN		Ø				
STOVE TOP/OVEN				Ø		
WATER PRESSURE/FLOW/DRAINAGE		Ø				
DISHWASHER/CROSS FLOW PROTECTION		Ø				
REFRIGERATOR		Ø				
MICROWAVE		Ø				
GARBAGE DISPOSAL						Ø

#### Comments:

• Stove was installed in contact with the drywall. Recommend a protective material is installed to prevent damage to dry wall and possible fire risk.



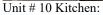



Unit # 10 Kitchen:


Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



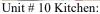



Unit # 10 Kitchen:

UNIT # 11 KITCHEN	G	F	P	NI	NA
CEILINGS	V				
WALL(S)	Ø				
FLOOR/FINISH	Ø				
INTERIOR DOORS/HARDWARE	Ø				
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXTURES.)	Ø				
GFCI PROTECTION (CHECKED WITH TEST BUTTON ONLY. MONTHLY TEST RECOMMENDED.)	Ø				
HEAT/AIR DISTRIBUTION	Ø				
COUNTERTOPS/CABINETS	Ø				
SINK/FAUCET	Ø				
EXHAUST FAN	Ø				
STOVE TOP/OVEN	V				
WATER PRESSURE/FLOW/DRAINAGE	Ø				
DISHWASHER/CROSS FLOW PROTECTION	Ø				
REFRIGERATOR	Ø				
MICROWAVE	V				
GARBAGE DISPOSAL					Ø

#### Comments:

• All components in kitchen were acceptable at time of inspection.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 11 Kitchen:



Unit # 11 Kitchen:



Unit # 11 Kitchen:



# **National Property Inspections**


### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

UNIT # 12 KITCHEN	☑ Recommend Repairs	G	F	P	NI	NA
CEILINGS		Ø				
WALL(S)		Ø				
FLOOR/FINISH		$\square$				
INTERIOR DOORS/HARDWARE		Ø				
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXTURES	.)	$\square$				
GFCI PROTECTION (CHECKED WITH TEST BUTTON ONLY. MONTHLY	TEST RECOMMENDED.)	$\square$				
HEAT/AIR DISTRIBUTION		Ø				
COUNTERTOPS/CABINETS		$\square$				
SINK/FAUCET		Ø				
EXHAUST FAN		$\square$				
STOVE TOP/OVEN		$\square$				
WATER PRESSURE/FLOW/DRAINAGE		Ø				
DISHWASHER/CROSS FLOW PROTECTION				V		
REFRIGERATOR		Ø				
MICROWAVE		$\square$				
GARBAGE DISPOSAL						Ø

#### Comments:

• Dishwasher cross-flow protection not installed properly. Discharge tube should be mounted to the underside of the countertop to create a high point to prevent water from flowing backwards into the dishwasher unit from the sink or drainage pipes.



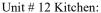



Unit # 12 Kitchen:

Inspection Date: Inspector: Jay Heckart

05/16/2024 Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 12 Kitchen: NO DISHWASHER DRAINAGE LOOP

UNIT # 13 KITCHEN	G	F	P	NI	NA
CEILINGS	V				
WALL(S)	V				
FLOOR/FINISH	V				
INTERIOR DOORS/HARDWARE	Ø				
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXTURES.)	V				
GFCI PROTECTION (CHECKED WITH TEST BUTTON ONLY. MONTHLY TEST RECOMMENDED.)	V				
HEAT/AIR DISTRIBUTION	V				
COUNTERTOPS/CABINETS	V				
SINK/FAUCET	V				
EXHAUST FAN	V				
STOVE TOP/OVEN	V				
WATER PRESSURE/FLOW/DRAINAGE	V				
DISHWASHER/CROSS FLOW PROTECTION	V				
REFRIGERATOR	V				
MICROWAVE	Ø				
GARBAGE DISPOSAL					Ø

#### Comments:

• All components in kitchen were acceptable at time of inspection.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 13 Kitchen:



Unit # 13 Kitchen:



Unit # 13 Kitchen:



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

UNIT # 14 KITCHEN	G	F	Р	NI	NA
CEILINGS	Ø		Г П	INI	INA.
CEILINGS	N.	Ш	Ш	Ш	
WALL(S)	☑				
FLOOR/FINISH	Ø				
INTERIOR DOORS/HARDWARE	Ø				
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXTURES.)	Ø				
GFCI PROTECTION (CHECKED WITH TEST BUTTON ONLY. MONTHLY TEST RECOMMENDED.)	Ø				
HEAT/AIR DISTRIBUTION	Ø				
COUNTERTOPS/CABINETS	Ø				
SINK/FAUCET	Ø				
EXHAUST FAN	Ø				
STOVE TOP/OVEN	Ø				
WATER PRESSURE/FLOW/DRAINAGE	Ø				
DISHWASHER/CROSS FLOW PROTECTION	Ø				
REFRIGERATOR	Ø				
MICROWAVE	Ø				
GARBAGE DISPOSAL					Ø

#### Comments:

• All components in kitchen were acceptable at time of inspection.



Unit # 14 Kitchen:



Unit # 14 Kitchen:


Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



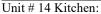



Unit # 14 Kitchen:

UNIT # 15 KITCHEN	G	F	P	NI	NA
CEILINGS	Ø				
WALL(S)	Ø				
FLOOR/FINISH	Ø				
INTERIOR DOORS/HARDWARE	Ø				
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXTURES.)	Ø				
GFCI PROTECTION (CHECKED WITH TEST BUTTON ONLY. MONTHLY TEST RECOMMENDED.)	Ø				
HEAT/AIR DISTRIBUTION	$\square$				
COUNTERTOPS/CABINETS	Ø				
SINK/FAUCET	$\square$				
EXHAUST FAN	Ø				
STOVE TOP/OVEN	$\square$				
WATER PRESSURE/FLOW/DRAINAGE	$\square$				
DISHWASHER/CROSS FLOW PROTECTION	$\square$				
REFRIGERATOR	Ø				
MICROWAVE	Ø				
GARBAGE DISPOSAL	Ø				

#### Comments:

• All components in kitchen were acceptable at time of inspection.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 15 Kitchen:



Unit # 15 Kitchen:



Unit # 15 Kitchen:



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

UNIT # 1 BATHROOM	☑ Monitor Condition	G	F	P	NI	NA
CEILINGS		$\square$				
WALL(S)		$\square$				
FLOOR/FINISH		Ø				
INTERIOR DOORS/HARDWARE		Ø				
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXT	URES.)	Ø				
GFCI PROTECTION (CHECKED WITH TEST BUTTON ONLY. MONTH	HLY TEST RECOMMENDED.)	Ø				
HEAT/AIR DISTRIBUTION		Ø				
COUNTERTOPS/CABINETS			Ø			
SINK/FAUCET		$\square$				
TOILET		Ø				
TUB/SHOWER			Ø			
TILE WORK/ENCLOSURE		$\square$				
EXHAUST FAN		$\square$				
WATER PRESSURE/FLOW/DRAINAGE		$\square$				

#### Comments:

- Countertop along backsplash is not caulked. Recommend that caulk is applied to avoid water getting behind cabinets.
- Shower / tub enclosure needs improvement in caulking to create a water tight seal.



Unit # 1 Bathroom:



Unit # 1 Bathroom: CAULKING NEEDED ALONG BACKSPLASH

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



## **National Property Inspections**

#### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 1 Bathroom: GAPS IN SHOWER ENCLOSURE

	✓ Monitor Condition					
UNIT # 2 BATHROOM	☑ Recommend Repairs	G	F	P	NI	NA
CEILINGS		Ø				
WALL(S)		Ø				
FLOOR/FINISH		Ø				
INTERIOR DOORS/HARDWARE		Ø				
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXTURES.)		Ø				
GFCI PROTECTION (CHECKED WITH TEST BUTTON ONLY. MONTHLY TEST	T RECOMMENDED.)	Ø				
HEAT/AIR DISTRIBUTION		Ø				
COUNTERTOPS/CABINETS			Ø			
SINK/FAUCET		Ø				
TOILET		Ø				
TUB/SHOWER		Ø				
TILE WORK/ENCLOSURE				Ø		
EXHAUST FAN		V				
WATER PRESSURE/FLOW/DRAINAGE		Ø				

#### Comments:

- GFCI outlet tripped appropriately
- Countertop along backsplash is not caulked. Recommend that caulk is applied to avoid water getting behind cabinets.
- Shower enclosure was chipped and showing damage. Advise that enclosure is repaired or replaced to prevent leaks from developing.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 2 Bathroom:



Unit # 2 Bathroom: CHIPPED AND DAMAGED ENCLOSURE

	☑ Monitor Condition					
UNIT # 3 BATHROOM	Recommend Repairs	G	F	P	NI	NA
CEILINGS		Ø				
WALL(S)		Ø				
FLOOR/FINISH		Ø				
INTERIOR DOORS/HARDWARE		Ø				
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXTURES.)		Ø				
GFCI PROTECTION (CHECKED WITH TEST BUTTON ONLY. MONTHLY TEST	ST RECOMMENDED.)	Ø				
HEAT/AIR DISTRIBUTION		Ø				
COUNTERTOPS/CABINETS			Ø			
SINK/FAUCET		Ø				
TOILET				Ø		
TUB/SHOWER		Ø				
TILE WORK/ENCLOSURE		Ø				
EXHAUST FAN				Ø		
WATER PRESSURE/FLOW/DRAINAGE		Ø				

#### Comments:

GFCI outlet tripped appropriately

Inspection Date: In 05/16/2024 In

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



## **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

- Countertop along backsplash is not caulked. Recommend that caulk is applied to avoid water getting behind cabinets.
- The toilet was loose at base. This may cause unseen seepage to occur which may not show until some later date. Also there is a potential for sewage gas to enter the dwelling when a toilet is loose at base. Further evaluation and repair by a qualified plumber advised.
- Exhaust fan did not respond to the switch. Further evaluation and repair advised.



Unit # 3 Bathroom:

	☑ Monitor Condition					
UNIT # 4 BATHROOM	☑ Recommend Repairs	G	F	P	NI	NA
CEILINGS		V				
WALL(S)		Ø				
FLOOR/FINISH		Ø				
INTERIOR DOORS/HARDWARE		Ø				
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXTURES.)		Ø				
GFCI PROTECTION (CHECKED WITH TEST BUTTON ONLY. MONTHLY TEST	Γ RECOMMENDED.)	Ø				
HEAT/AIR DISTRIBUTION		Ø				
COUNTERTOPS/CABINETS			Ø			
SINK/FAUCET		Ø				
TOILET		Ø				
TUB/SHOWER				Ø		
TILE WORK/ENCLOSURE		Ø				
EXHAUST FAN		Ø				
WATER PRESSURE/FLOW/DRAINAGE		Ø				

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



## **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### Comments:

- GFCI outlet tripped appropriately.
- Shower / tub faucet head was loose and not properly secured to enclosure. Recommend that faucet head is properly installed and caulked to prevent moisture / water entry behind enclosure.
- Countertop along backsplash is not caulked. Recommend that caulk is applied to avoid water getting behind cabinets.



Unit # 4 Bathroom:



Unit # 4 Bathroom: LOOSE FAUCET HEAD

UNIT # 5 BATHROOM	M ' C 1''		-	ъ	) II	27.4
UNII # 5 DA I II KUUNI	☑ Monitor Condition	G	F	P	NI	NA
CEILINGS		Ø				
WALL(S)		Ø				
FLOOR/FINISH		Ø				
INTERIOR DOORS/HARDWARE		Ø				
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXTURES.)		Ø				
GFCI PROTECTION (CHECKED WITH TEST BUTTON ONLY. MONTHLY TEST	RECOMMENDED.)	Ø				
HEAT/AIR DISTRIBUTION		Ø				
COUNTERTOPS/CABINETS			Ø			
SINK/FAUCET		Ø				
TOILET		Ø				
TUB/SHOWER		Ø				
TILE WORK/ENCLOSURE		$\square$				
EXHAUST FAN		Ø				
WATER PRESSURE/FLOW/DRAINAGE		Ø				

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### Comments:

- GFCI outlet tripped appropriately
- Countertop along backsplash is not caulked. Recommend that caulk is applied to avoid water getting behind cabinets.



Unit # 5 Bathroom:

	✓ Monitor Condition					
UNIT # 6 BATHROOM	☑ Recommend Repairs	G	F	P	NI	NA
CEILINGS		Ø				
WALL(S)		Ø				
FLOOR/FINISH		Ø				
INTERIOR DOORS/HARDWARE		Ø				
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXTURES	.)	Ø				
GFCI PROTECTION (CHECKED WITH TEST BUTTON ONLY. MONTHLY T	EST RECOMMENDED.)	Ø				
HEAT/AIR DISTRIBUTION		Ø				
COUNTERTOPS/CABINETS			Ø			
SINK/FAUCET		Ø				
TOILET Loose at Base				Ø		
TUB/SHOWER		Ø				
TILE WORK/ENCLOSURE		☑				
EXHAUST FAN		Ø				
WATER PRESSURE/FLOW/DRAINAGE		Ø				

#### Comments:

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

- The toilet was loose at base. Further evaluation and repair by a qualified plumber advised.
- Countertop along backsplash is not caulked. Recommend that caulk is applied to avoid water getting behind cabinets.



Unit # 6 Bathroom:

UNIT # 7 BATHROOM	☑ Monitor Condition	G	F	P	NI	NA
CEILINGS		$\square$				
WALL(S)		Ø				
FLOOR/FINISH		Ø				
INTERIOR DOORS/HARDWARE		Ø				
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXT	URES.)	$\square$				
GFCI PROTECTION (CHECKED WITH TEST BUTTON ONLY. MONT	HLY TEST RECOMMENDED.)	Ø				
HEAT/AIR DISTRIBUTION		Ø				
COUNTERTOPS/CABINETS			Ø			
SINK/FAUCET		Ø				
TOILET		Ø				
TUB/SHOWER		Ø				
TILE WORK/ENCLOSURE		Ø				
EXHAUST FAN		Ø				
WATER PRESSURE/FLOW/DRAINAGE		Ø				

#### Comments:

• GFCI outlet tripped appropriately

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

• Recommend that caulk is applied to avoid water getting behind cabinets.



Unit # 7 Bathroom:

	✓ Monitor Condition					
UNIT # 8 BATHROOM	☑ Recommend Repairs	G	F	P	NI	NA
CEILINGS		V				
WALL(S)		Ø				
FLOOR/FINISH		Ø				
INTERIOR DOORS/HARDWARE		Ø				
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXTURES.)		Ø				
GFCI PROTECTION (CHECKED WITH TEST BUTTON ONLY. MONTHLY TEST	RECOMMENDED.)	Ø				
HEAT/AIR DISTRIBUTION		Ø				
COUNTERTOPS/CABINETS			V			
SINK/FAUCET		☑				
TOILET Loose at Base				Ø		
TUB/SHOWER		Ø				
TILE WORK/ENCLOSURE		V				
EXHAUST FAN		V				
WATER PRESSURE/FLOW/DRAINAGE		V				

#### Comments:

GFCI outlet tripped appropriately

Inspection Date: Inspector: Jay Heckart

05/16/2024 Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

- The toilet was loose at base. Further evaluation and repair by a qualified plumber advised.
- Countertop along backsplash is not caulked. Recommend that caulk is applied to avoid water getting behind cabinets.



Unit # 8 Bathroom:

	✓ Monitor Condition					
UNIT # 9 BATHROOM	Recommend Repairs	G	F	P	NI	NA
CEILINGS		Ø				
WALL(S)		$\square$				
FLOOR/FINISH		Ø				
INTERIOR DOORS/HARDWARE		Ø				
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXTURES.)		Ø				
GFCI PROTECTION (CHECKED WITH TEST BUTTON ONLY. MONTHLY TEST	T RECOMMENDED.)	Ø				
HEAT/AIR DISTRIBUTION		Ø				
COUNTERTOPS/CABINETS			Ø			
SINK/FAUCET		Ø				
TOILET		$\square$				
TUB/SHOWER		Ø				
TILE WORK/ENCLOSURE						
EXHAUST FAN		Ø				
WATER PRESSURE/FLOW/DRAINAGE		Ø				

Comments:

Inspection Date: Inspector: Jay Heckart

05/16/2024 Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

- Countertop along backsplash is not caulked. Recommend that caulk is applied to avoid water getting behind cabinets.
- Shower / Tub enclosure was chipped and damaged. This may lead to holes or cracks developing. Advise that enclosure is repaired or replaced to prevent possible water related damage.



Unit # 9 Bathroom:



Unit # 9 Bathroom: CHIPS VISIBLE IN SHOWER ENCLOSURE

	☑ Monitor Condition					
UNIT # 10 BATHROOM	☑ Recommend Repairs	G	F	P	NI	NA
CEILINGS		Ø				
WALL(S)		☑				
FLOOR/FINISH		☑				
INTERIOR DOORS/HARDWARE						
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXTURES.)		☑				
GFCI PROTECTION (CHECKED WITH TEST BUTTON ONLY. MONTHLY TEST	RECOMMENDED.)	V				
HEAT/AIR DISTRIBUTION		☑				
COUNTERTOPS/CABINETS			V			
SINK/FAUCET						
TOILET Loose at Base				Ø		
TUB/SHOWER				Ø		
TILE WORK/ENCLOSURE		Ø				
EXHAUST FAN		Ø				
WATER PRESSURE/FLOW/DRAINAGE		Ø				

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



## **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### Comments:

- GFCI outlet tripped appropriately
- Countertop along backsplash is not caulked. Recommend that caulk is applied to avoid water getting behind cabinets.
- The toilet was loose at base.
- Tub / shower enclosure was chipped and damaged. Recommend that enclosure is repaired or replaced to prevent leaks from developing.



Unit # 10 Bathroom:



Unit # 10 Bathroom: DAMAGED ENCLOSURE

Inspection Date: Inspection Date: Use Inspection Date: In

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

	☑ Monitor Condition					
UNIT # 11 BATHROOM	☑ Recommend Repairs	G	F	P	NI	NA
CEILINGS		Ø				
WALL(S)		$\square$				
FLOOR/FINISH		Ø				
INTERIOR DOORS/HARDWARE		$\square$				
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXTURES.)		Ø				
GFCI PROTECTION (CHECKED WITH TEST BUTTON ONLY. MONTHLY TEST	ST RECOMMENDED.)	$\square$				
HEAT/AIR DISTRIBUTION		$\square$				
COUNTERTOPS/CABINETS			Ø			
SINK/FAUCET		$\square$				
TOILET				Ø		
TUB/SHOWER		$\square$				
TILE WORK/ENCLOSURE		$\square$				
EXHAUST FAN		$\square$				
WATER PRESSURE/FLOW/DRAINAGE		$\square$				

#### Comments:

- GFCI outlet tripped appropriately
- Toilet was loud and runs continuously after flushing. Further review and repair by plumber advised.
- Countertop along backsplash is not caulked. Recommend that caulk is applied to avoid water getting behind cabinets.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



## **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

	☑ Monitor Condition					
UNIT # 12 BATHROOM	☑ Recommend Repairs	G	F	P	NI	NA
CEILINGS		☑				
WALL(S)		Ø				
FLOOR/FINISH		Ø				
INTERIOR DOORS/HARDWARE		V				
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXTURES.)		Ø				
GFCI PROTECTION (CHECKED WITH TEST BUTTON ONLY. MONTHLY TEST	RECOMMENDED.)	Ø				
HEAT/AIR DISTRIBUTION		Ø				
COUNTERTOPS/CABINETS			Ø			
SINK/FAUCET				Ø		
TOILET		Ø				
TUB/SHOWER		V				
TILE WORK/ENCLOSURE		Ø				
EXHAUST FAN		Ø				
WATER PRESSURE/FLOW/DRAINAGE		Ø				

#### Comments:

- The sink was draining very slowly, suggesting there is a restriction in the drain pipe or trap located under the sink. Further review by plumber advised.
- Countertop along backsplash is not caulked. Recommend that caulk is applied to avoid water getting behind cabinets.







Unit # 12 Bathroom:

Inspection Date: Inspector: Jay Heckart



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

	_	_	_		
Monitor Condition	G	F	P	NI	NA
	Ø				
	$\square$				
	Ø				
	Ø				
ES.)	Ø				
Y TEST RECOMMENDED.)	Ø				
	Ø				
		Ø			
	Ø				
	Ø				
	Ø				
	☑				
	☑				
	☑				
	ES.) Y TEST RECOMMENDED.)	ES.) Y TEST RECOMMENDED.)		ES.) Y TEST RECOMMENDED.)	ES.)  Y TEST RECOMMENDED.)  D D D D D D D D D D D D D D D D D D

#### Comments:

- GFCI outlet tripped appropriately
- Countertop along backsplash is not caulked. Recommend that caulk is applied to avoid water getting behind cabinets.



Unit # 13 Bathroom:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

UNIT # 14 BATHROOM	✓ Pasammand Passasiss		Г	n	NII	NIA
	☑ Recommend Repairs	G	F	P	NI	NA
CEILINGS		☑				
WALL(S)		V				
FLOOR/FINISH		Ø				
INTERIOR DOORS/HARDWARE		Ø				
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXT	URES.)	Ø				
GFCI PROTECTION (CHECKED WITH TEST BUTTON ONLY. MONTH	HLY TEST RECOMMENDED.)	Ø				
HEAT/AIR DISTRIBUTION		V				
COUNTERTOPS/CABINETS		☑				
SINK/FAUCET		Ø				
TOILET		Ø				
TUB/SHOWER		Ø				
TILE WORK/ENCLOSURE		Ø				
EXHAUST FAN				Ø		
WATER PRESSURE/FLOW/DRAINAGE				Ø		

#### Comments:

- Water was shut off to bathroom sink. Advise that water is turned on and fixture & plumbing are checked for leaks.
- Exhaust fan had excess noise when in operation. Recommend that fan is cleaned and checked for proper operation.



Unit # 14 Bathroom:



Unit # 14 Bathroom: NO WATER TO SINK

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 14 Bathroom:

	☑ Monitor Condition					
UNIT # 15 BATHROOM	☑ Recommend Repairs	G	F	P	NI	NA
CEILINGS						
WALL(S)		V				
FLOOR/FINISH		Ø				
INTERIOR DOORS/HARDWARE		☑				
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXTURES.)		☑				
GFCI PROTECTION (CHECKED WITH TEST BUTTON ONLY. MONTHLY TEST	Γ RECOMMENDED.)	Ø				
HEAT/AIR DISTRIBUTION						
COUNTERTOPS/CABINETS			Ø			
SINK/FAUCET		☑				
TOILET Loose at Base				Ø		
TUB/SHOWER				Ø		
TILE WORK/ENCLOSURE		Ø				
EXHAUST FAN		Ø				
WATER PRESSURE/FLOW/DRAINAGE		Ø				

#### Comments:

- The toilet was loose at base. Further evaluation and repair by a qualified plumber advised.
- Countertop along backsplash is not caulked. Recommend that caulk is applied to avoid water getting behind cabinets.
- Shower / tub enclosure was chipped and damaged. Advise that tub enclosure is repaired to prevent leaks from developing.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240







Unit # 15 Bathroom: DAMAGED TUB ENCLOSURE

UNIT # 1 BEDROOMS & LIVING SPACE	☑ Monitor Condition	G	F	P	NI	NA
CEILINGS		Ø				
WALLS		$\square$				
WINDOWS/TRIM		Ø				
FLOOR/FINISH		Ø				
INTERIOR DOORS/HARDWARE		Ø				
CLOSET			Ø			
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXTURE	S.)	Ø				
HEAT/AIR DISTRIBUTION		Ø				

#### Comments:

- Ceiling and walls were free of cracks. Window(s) functioned properly and seals were acceptable. Receptacles and lights were wired correctly.
- Be aware of exposed bulb in closet. Lights in closets should be in an enclosed fixture for fire safety or to prevent breakage. Newer LED bulbs are less of a concern with heat and breakage due to plastic.

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 1 Bedrooms & Living Space:



Unit # 1 Bedrooms & Living Space:



Unit # 1 Bedrooms & Living Space:



Unit # 1 Bedrooms & Living Space:



Unit # 1 Bedrooms & Living Space:



Unit # 1 Bedrooms & Living Space:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



## **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

UNIT # 2 BEDROOMS & LIVING SPACE	☑ Monitor Condition	G	F	P	NI	NA
CEILINGS		Ø				
WALLS		Ø				
WINDOWS/TRIM		Ø				
FLOOR/FINISH		Ø				
INTERIOR DOORS/HARDWARE		Ø				
CLOSET			Ø			
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXTURES.)		Ø				
HEAT/AIR DISTRIBUTION		Ø				

#### Comments:

- Ceiling and walls were free of cracks. Window(s) functioned properly and seals were acceptable. Receptacles and lights were wired correctly.
- Be aware of exposed bulb in closet. Lights in closets should be in an enclosed fixture for fire safety or to prevent breakage. Newer LED bulbs are less of a concern with heat and breakage due to plastic.
- Missing window screen in front bedroom.



Unit # 2 Bedrooms & Living Space:



Unit # 2 Bedrooms & Living Space:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400




# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 2 Bedrooms & Living Space:

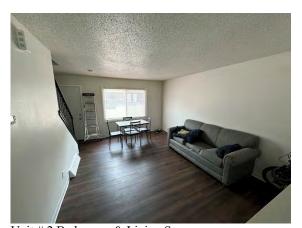

Unit # 2 Bedrooms & Living Space:



Unit # 2 Bedrooms & Living Space:



Unit # 2 Bedrooms & Living Space:

UNIT # 3 BEDROOMS & LIVING SPACE	Monitor Condition	G	F	P	NI	NA
CEILINGS		V				
WALLS		☑				
WINDOWS/TRIM		☑				
FLOOR/FINISH		Ø				
INTERIOR DOORS/HARDWARE		Ø				
CLOSET			Ø			
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXTURES	.)	Ø				
HEAT/AIR DISTRIBUTION		Ø				

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### Comments:

- Window screens missing.
- Be aware of exposed bulb in closet.




Unit # 3 Bedrooms & Living Space:



Unit # 3 Bedrooms & Living Space:



Unit # 3 Bedrooms & Living Space:

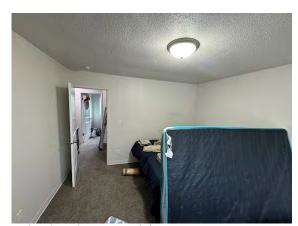


Unit # 3 Bedrooms & Living Space:



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

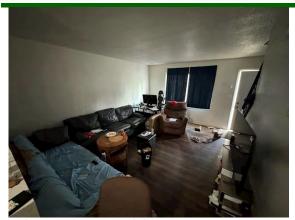

Unit # 3 Bedrooms & Living Space:



Unit # 3 Bedrooms & Living Space:

UNIT II A DEDDOOMG A LIMING CDA CE	_				1	
UNIT # 4 BEDROOMS & LIVING SPACE	☑ Monitor Condition	G	F	P	NI	NA
CEILINGS		Ø				
WALLS		Ø				
WINDOWS/TRIM		Ø				
FLOOR/FINISH		Ø				
INTERIOR DOORS/HARDWARE		Ø				
CLOSET			Ø			
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXT	URES.)	Ø				
HEAT/AIR DISTRIBUTION		Ø				

#### Comments:

- Window were operational and electrical components were properly wired. No cracks or damage on ceilings and walls visible.
- Be aware of exposed bulb in closet.

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**


### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 4 Bedrooms & Living Space:



Unit # 4 Bedrooms & Living Space:

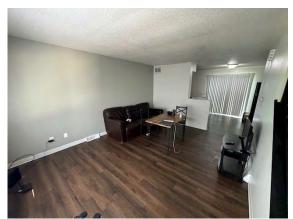

Unit # 4 Bedrooms & Living Space:



Unit # 4 Bedrooms & Living Space:



Unit # 4 Bedrooms & Living Space:



Unit # 4 Bedrooms & Living Space:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



## **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

UNIT # 5 BEDROOMS & LIVING SPACE	☑ Monitor Condition	G	F	P	NI	NA
CEILINGS		Ø				
WALLS		Ø				
WINDOWS/TRIM		Ø				
FLOOR/FINISH		Ø				
INTERIOR DOORS/HARDWARE		Ø				
CLOSET			Ø			
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXTURES.)		Ø				
HEAT/AIR DISTRIBUTION		Ø				

#### Comments:

- Ceiling and walls were free of cracks. Window(s) functioned properly and seals were acceptable. Receptacles and lights were wired correctly.
- Be aware of exposed bulb in closet. Lights in closets should be in an enclosed fixture for fire safety or to prevent breakage. Newer LED bulbs are less of a concern with heat and breakage due to plastic.



Unit # 5 Bedrooms & Living Space:



Unit # 5 Bedrooms & Living Space:

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 5 Bedrooms & Living Space:





Unit # 5 Bedrooms & Living Space:



Unit # 5 Bedrooms & Living Space:

UNIT # 6 BEDROOMS & LIVING SPACE	☑ Monitor Condition	G	F	P	NI	NA
CEILINGS		Ø				
WALLS		V				
WINDOWS/TRIM		Ø				
FLOOR/FINISH		Ø				
INTERIOR DOORS/HARDWARE		Ø				
CLOSET			V			
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXTU	RES.)	Ø				
HEAT/AIR DISTRIBUTION		Ø				

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### Comments:

- Bedroom windows were operational and electrical components were properly wired. No cracks or damage on ceilings and walls visible.
- Be aware of exposed bulb in closet. Lights in closets should be in an enclosed fixture for fire safety or to prevent breakage. Newer LED bulbs are less of a concern with heat and breakage due to plastic.



Unit # 6 Bedrooms & Living Space:



Unit # 6 Bedrooms & Living Space:



Unit # 6 Bedrooms & Living Space:



Unit # 6 Bedrooms & Living Space:

Inspection Date: 05/16/2024

Inspector: Jay Heckart


Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



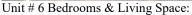



Unit # 6 Bedrooms & Living Space:

UNIT # 7 BEDROOMS & LIVING SPACE	☑ Monitor Condition	G	F	P	NI	NA
CEILINGS		Ø				
WALLS		Ø				
WINDOWS/TRIM		Ø				
FLOOR/FINISH		Ø				
INTERIOR DOORS/HARDWARE			Ø			
CLOSET			Ø			
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXT	URES.)	Ø				
HEAT/AIR DISTRIBUTION		Ø				

#### Comments:

- Be aware of exposed bulb in closet.
- Upstairs bedroom door knobs were loose and not properly secured. Recommend that knobs are secured to the door for proper operation.

Inspection Date: Inspector: Jay Heckart Email: jay.heckart@npiinspect.com



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 7 Bedrooms & Living Space:



Unit # 7 Bedrooms & Living Space:



Unit # 7 Bedrooms & Living Space:



Unit # 7 Bedrooms & Living Space:



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 7 Bedrooms & Living Space: LOOSE DOOR KNOBS



Unit # 7 Bedrooms & Living Space:



Unit # 7 Bedrooms & Living Space:

UNIT # 8 BEDROOMS & LIVING SPACE	☑ Monitor Condition	G	F	P	NI	NA
CEILINGS						
WALLS		$\square$				
WINDOWS/TRIM		Ø				
FLOOR/FINISH		Ø				
INTERIOR DOORS/HARDWARE		Ø				
CLOSET			Ø			
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXTURE)	JRES.)	Ø				
HEAT/AIR DISTRIBUTION		V				

Inspection Date: Inspection Date: Unspection Date: Inspection Date: Unspection Date: Unspec

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### Comments:

- Inspected rooms and areas were in acceptable condition at time of inspection. Limited photos due to tenants being inside of unit at time of inspection.
- Be aware of exposed bulb in closet.



Unit # 8 Bedrooms & Living Space:



Unit # 8 Bedrooms & Living Space:



Unit # 8 Bedrooms & Living Space:



Unit # 8 Bedrooms & Living Space:



## **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

UNIT # 9 BEDROOMS & LIVING SPACE	☑ Monitor Condition	G	F	P	NI	NA
CEILINGS		Ø				
WALLS		Ø				
WINDOWS/TRIM		Ø				
FLOOR/FINISH		Ø				
INTERIOR DOORS/HARDWARE		Ø				
CLOSET			V			
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXTURES.)		Ø				
HEAT/AIR DISTRIBUTION		Ø				

#### Comments:

- Ceiling and walls were free of cracks. Window(s) functioned properly and seals were acceptable. Receptacles and lights were wired correctly. Tenant was present at time of inspection and no photo of living room possible.
- Be aware of exposed bulb in closet.



Unit # 9 Bedrooms & Living Space:



Unit # 9 Bedrooms & Living Space:

Inspection Date: 05/16/2024


Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

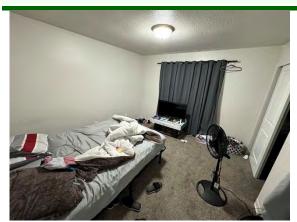

Unit # 9 Bedrooms & Living Space:



Unit # 9 Bedrooms & Living Space:

UNIT # 10 BEDROOMS & LIVING SPACE	☑ Monitor Condition	G	F	P	NI	NA
CEILINGS		Ø				
WALLS		Ø				
WINDOWS/TRIM		Ø				
FLOOR/FINISH		Ø				
INTERIOR DOORS/HARDWARE		Ø				
CLOSET			Ø			
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXTU	URES.)	Ø				
HEAT/AIR DISTRIBUTION		Ø				

#### Comments:

- Bedrooms & family room were in acceptable condition with operational window. Lights and switches were wired properly and no damage to ceilings or walls at time of inspection.
- Be aware of exposed bulb in closet.

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 10 Bedrooms & Living Space:



Unit # 10 Bedrooms & Living Space:



Unit # 10 Bedrooms & Living Space:



Unit # 10 Bedrooms & Living Space:



Unit # 10 Bedrooms & Living Space:



Unit # 10 Bedrooms & Living Space:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

UNIT # 11 BEDROOMS & LIVING SPACE	☑ Monitor Condition	G	F	P	NI	NA
CEILINGS		V				
WALLS		V				
WINDOWS/TRIM		V				
FLOOR/FINISH		V				
INTERIOR DOORS/HARDWARE		Ø				
CLOSET			Ø			
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXTUR	ES.)	V				
HEAT/AIR DISTRIBUTION		Ø				

#### Comments:

- Ceiling and walls were free of cracks. Window(s) functioned properly and seals were acceptable. Receptacles and lights were wired correctly.
- Be aware of exposed bulb in closet.



Unit # 11 Bedrooms & Living Space:



Unit # 11 Bedrooms & Living Space:

Inspection Date: Ins 05/16/2024 Ins

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 11 Bedrooms & Living Space:



Unit # 11 Bedrooms & Living Space:



Unit # 11 Bedrooms & Living Space:

UNIT # 12 BEDROOMS & LIVING SPACE	☑ Monitor Condition	G	F	P	NI	NA
CEILINGS		Ø				
WALLS		Ø				
WINDOWS/TRIM		Ø				
FLOOR/FINISH		Ø				
INTERIOR DOORS/HARDWARE		Ø				
CLOSET			Ø			
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXTU	RES.)	Ø				
HEAT/AIR DISTRIBUTION		Ø				

Inspection Date: Inspector: Jay Heckart

05/16/2024 Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### Comments:

- Ceiling and walls were free of cracks. Window(s) functioned properly and seals were acceptable. Receptacles and lights were wired correctly.
- Be aware of exposed bulb in closet.



Unit # 12 Bedrooms & Living Space:



Unit # 12 Bedrooms & Living Space:



Unit # 12 Bedrooms & Living Space:



Unit # 12 Bedrooms & Living Space:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 12 Bedrooms & Living Space:



Unit # 12 Bedrooms & Living Space:

UNIT # 13 BEDROOMS & LIVING SPACE	☑ Monitor Condition	G	F	P	NI	NA
CEILINGS		V				
WALLS		V				
WINDOWS/TRIM		Ø				
FLOOR/FINISH		V				
INTERIOR DOORS/HARDWARE		V				
CLOSET			Ø			
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXTURES	.)	V				
HEAT/AIR DISTRIBUTION		V				

#### Comments:

- Ceiling and walls were free of cracks. Window(s) functioned properly and seals were acceptable. Receptacles and lights were wired correctly.
- Be aware of exposed bulb in closet.

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 13 Bedrooms & Living Space:



Unit # 13 Bedrooms & Living Space:



Unit # 13 Bedrooms & Living Space:



Unit # 13 Bedrooms & Living Space:



Unit # 13 Bedrooms & Living Space:



Unit # 13 Bedrooms & Living Space:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

UNIT # 14 BEDROOMS & LIVING SPACE	☑ Monitor Condition	G	F	P	NI	NA
CEILINGS		V				
WALLS		Ø				
WINDOWS/TRIM		Ø				
FLOOR/FINISH		Ø				
INTERIOR DOORS/HARDWARE		Ø				
CLOSET			Ø			
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXTURES	)	Ø				
HEAT/AIR DISTRIBUTION		☑				

#### Comments:

- Bedrooms & living room were in acceptable condition with operational window. Lights and switches were wired properly and no damage to ceilings or walls at time of inspection.
- Be aware of exposed bulb in closet.



Unit # 14 Bedrooms & Living Space:



Unit # 14 Bedrooms & Living Space:

Inspection Date: Inspector: Jay Heckart 05/16/2024 Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 14 Bedrooms & Living Space:



Unit # 14 Bedrooms & Living Space:



Unit # 14 Bedrooms & Living Space:



Unit # 14 Bedrooms & Living Space:

UNIT # 15 BEDROOMS & LIVING SPACE	☑ Monitor Condition	G	F	P	NI	NA
CEILINGS		V				
WALLS		V				
WINDOWS/TRIM		Ø				
FLOOR/FINISH		Ø				
INTERIOR DOORS/HARDWARE		V				
CLOSET			Ø			
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXTUR	ES.)	V				
HEAT/AIR DISTRIBUTION		V				

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### Comments:

- Ceiling and walls were free of cracks. Window(s) functioned properly and seals were acceptable. Receptacles and lights were wired correctly.
- Be aware of exposed bulb in closet. Lights in closets should be in an enclosed fixture for fire safety or to prevent breakage. Newer LED bulbs are less of a concern with heat and breakage due to plastic.



Unit # 15 Bedrooms & Living Space:



Unit # 15 Bedrooms & Living Space:



Unit # 15 Bedrooms & Living Space:



Unit # 15 Bedrooms & Living Space:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240



Unit # 15 Bedrooms & Living Space:




Unit # 15 Bedrooms & Living Space:

### **UNIT # 1 STAIRS / RAILINGS**

G	F	P	NI	NA
Ø				

#### Comments:

• Stairs in the home were in acceptable condition at the time of the inspection.

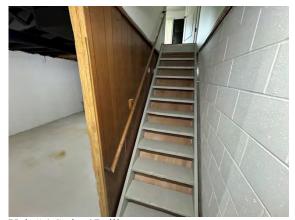

Unit # 1 Stairs / Railings:



Unit # 1 Stairs / Railings:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400




# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

	G	F	P	NI	NA
UNIT # 2 STAIRS / RAILINGS	V				

#### Comments:

• Stairs in the home were in acceptable condition at the time of the inspection. Always monitor condition of handrails and repair/replace as needed for safety.

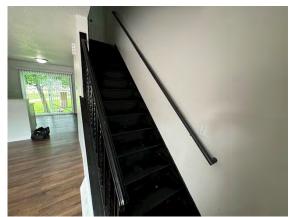


Unit # 2 Stairs / Railings:

UNIT # 3 STAIRS / RAILINGS			
	<b>IINIT # 3</b>	STAIRS / R	AILINGS

G	F	P	NI	NA
Ø				

#### Comments:

• Stairs in the home were in acceptable condition at the time of the inspection. Always monitor condition of handrails and repair/replace as needed for safety.

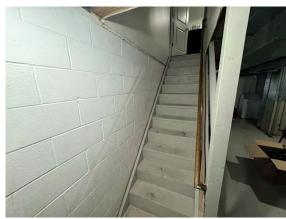

Unit # 3 Stairs / Railings:



Unit # 3 Stairs / Railings:

Inspection Date: Inspector: Jay Heckart

05/16/2024 Inspector Phone: (563) 676-7400




# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

	G	F	P	NI	NA
UNIT # 4 STAIRS / RAILINGS	V				

#### Comments:

• Stairs in the home were in acceptable condition at the time of the inspection. Always monitor condition of handrails and repair/replace as needed for safety.

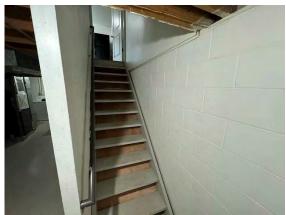


Unit # 4 Stairs / Railings:

### **UNIT # 5 STAIRS / RAILINGS**


G	F	P	NI	NA
V				

### Comments:

• Stairs in the home were in acceptable condition at the time of the inspection. Always monitor condition of handrails and repair/replace as needed for safety.

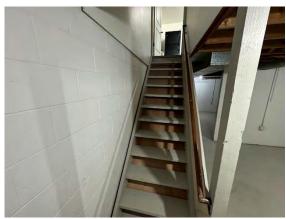

Unit # 5 Stairs / Railings:

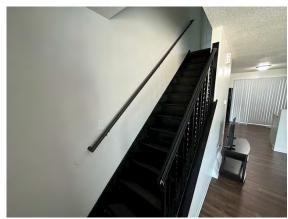

Unit # 5 Stairs / Railings:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

	G	F	P	NI	NA
UNIT # 6 STAIRS / RAILINGS	Ø				

#### Comments:

• Stairs in the home were in acceptable condition at the time of the inspection. Always monitor condition of handrails and repair/replace as needed for safety.



Unit # 6 Stairs / Railings:

### **UNIT # 7 STAIRS / RAILINGS**

G	F	P	NI	NA
$\square$				

#### Comments:

• Stairs in the home were in acceptable condition at the time of the inspection.



Unit # 7 Stairs / Railings:

Inspection Date: Inspector: Jay Heckart

05/16/2024 Inspector Phone: (563) 676-7400



## **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### 

#### Comments:

• Stairs in the home were in acceptable condition at the time of the inspection.




Unit # 8 Stairs / Railings:

	G	F	P	NI	NA
UNIT # 9 STAIRS / RAILINGS	☑				

#### Comments:

• Stairs in the home were in acceptable condition at the time of the inspection. Always monitor condition of handrails and repair/replace as needed for safety.

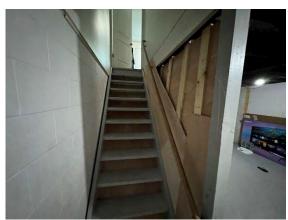

Unit # 9 Stairs / Railings:

Inspection Date: Inspector: Jay Heckart

05/16/2024 Inspector Phone: (563) 676-7400




# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

	G	F	P	NI	NA
UNIT # 10 STAIRS / RAILINGS	V				

#### Comments:

• Stairs in the home were in acceptable condition at the time of the inspection. Always monitor condition of handrails and repair/replace as needed for safety.

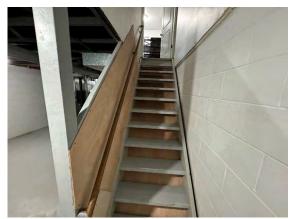


Unit # 10 Stairs / Railings:

#### **UNIT # 11 STAIRS / RAILINGS**

G	F	P	NI	NA
$\overline{\mathbf{V}}$				

### Comments:

• Stairs in the home were in acceptable condition at the time of the inspection.

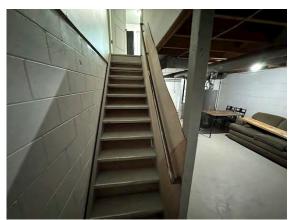

Unit # 11 Stairs / Railings:

Inspection Date: Inspector: Jay Heckart 05/16/2024

Inspector Phone: (563) 676-7400



# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

	G	F	P	NI	NA
UNIT # 12 STAIRS / RAILINGS	Ø				

#### Comments:

• Stairs in the home were in acceptable condition at the time of the inspection. Always monitor condition of handrails and repair/replace as needed for safety.



Unit # 12 Stairs / Railings:




Unit # 12 Stairs / Railings:

#### **UNIT # 13 STAIRS / RAILINGS**

#### Comments:

• Stairs in the home were in acceptable condition at the time of the inspection.

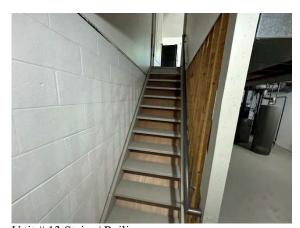

Unit # 13 Stairs / Railings:



Unit # 13 Stairs / Railings:

Inspection Date: 05/16/2024

Inspector: Jay Heckart

Inspector Phone: (563) 676-7400

Email: jay.heckart@npiinspect.com

NI

 $\overline{\mathbf{V}}$ 




# **National Property Inspections**

### Johnson County - NPI Commercial, 1102 Hollywood Blvd, Iowa City, IA, 52240

#### 

#### Comments:

• Stairs in the home were in acceptable condition at the time of the inspection.

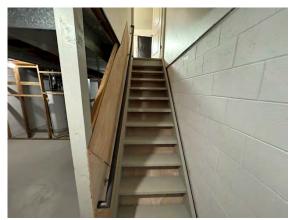


Unit # 14 Stairs / Railings:

	G	F	P	NI	NA
UNIT # 15 STAIRS / RAILINGS	$\overline{\mathbf{A}}$				

#### Comments:

• Stairs in the home were in acceptable condition at the time of the inspection. Always monitor condition of handrails and repair/replace as needed for safety.

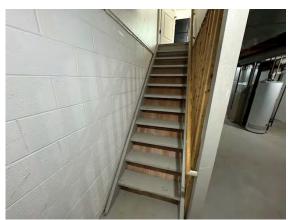

Unit # 15 Stairs / Railings:

Inspection Date: Inspector: Jay Heckart

05/16/2024 Inspector Phone: (563) 676-7400